

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 2

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 1434 Camp St.
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-25-93

Substrate:

- B - Brick
- C - Concrete
- G - Gypsum
- P - Plaster
- W - Wood
- M - Metal
- T - Tile
- CP - Carpet

Paint Condition:

- I - intact
- D - defective (peeling, cracked, loose)
- FF - factory finish

Comments: Exterior Positive: Siding, Soffit, Facia, Threshold
Interior Positive: Baseboard, Ceiling, Door Trim,

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope

SIGNATURES



[Signature]

Technician/Inspector

Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated

1st

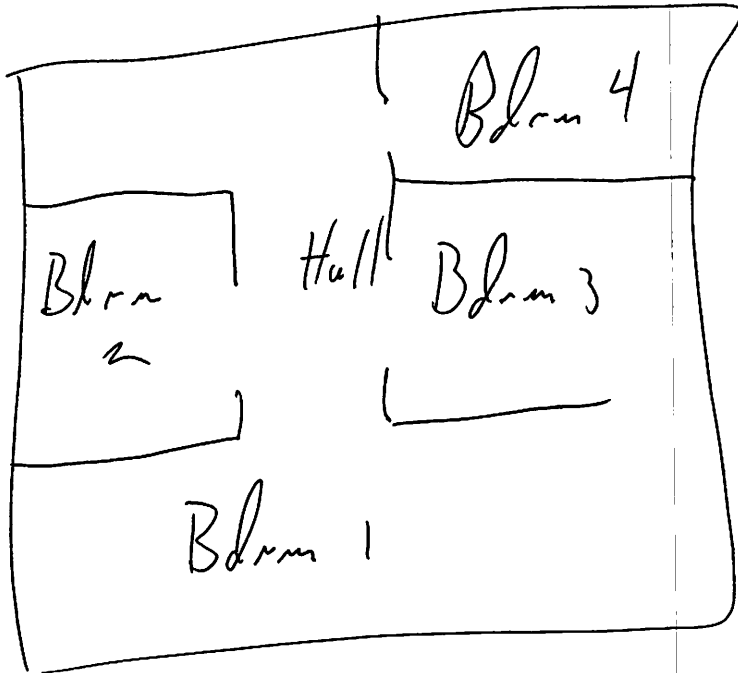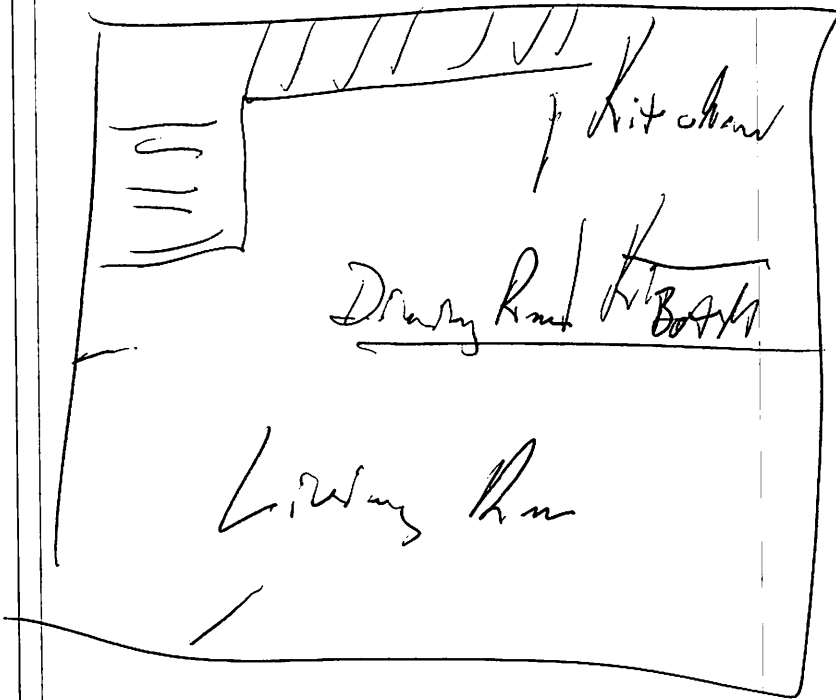

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 2

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 1434 Camp St.
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-25-93

Substrate:

B - Brick
C - Concrete
G - Gypsum
P - Plaster
W - Wood
M - Metal
T - Tile
CP - Carpet

Paint Condition:

I - intact
D - defective (peeling, cracked, loose)
F - factory finish

Comments: Exterior Positive: Siding, Soffit, Fasia, Threshold
Interior Positive: Baseboard, Ceiling, Door Trim,

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope

SIGNATURES

[Signature]



Technician/Inspector

Agency Representative

No indication of Lead Based Paint in this unit.

Paint samples taken for analysis Lead indicated

1st

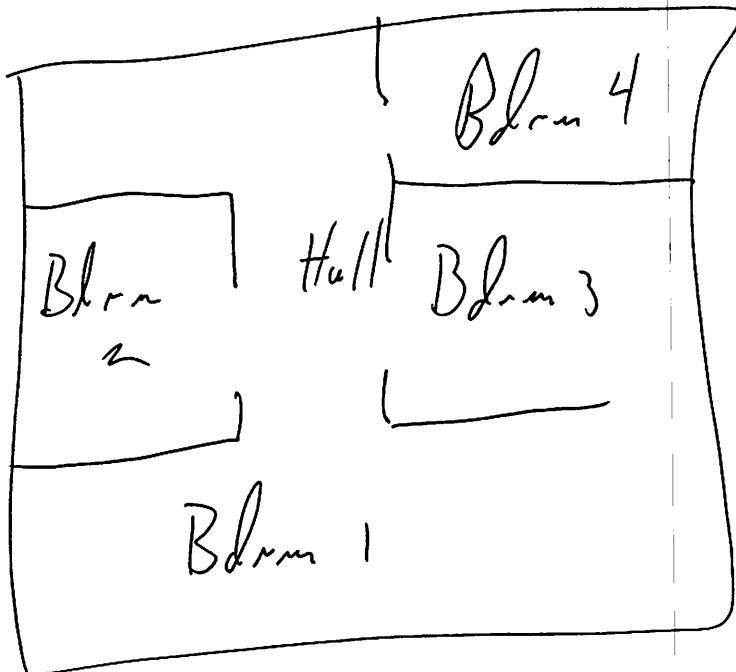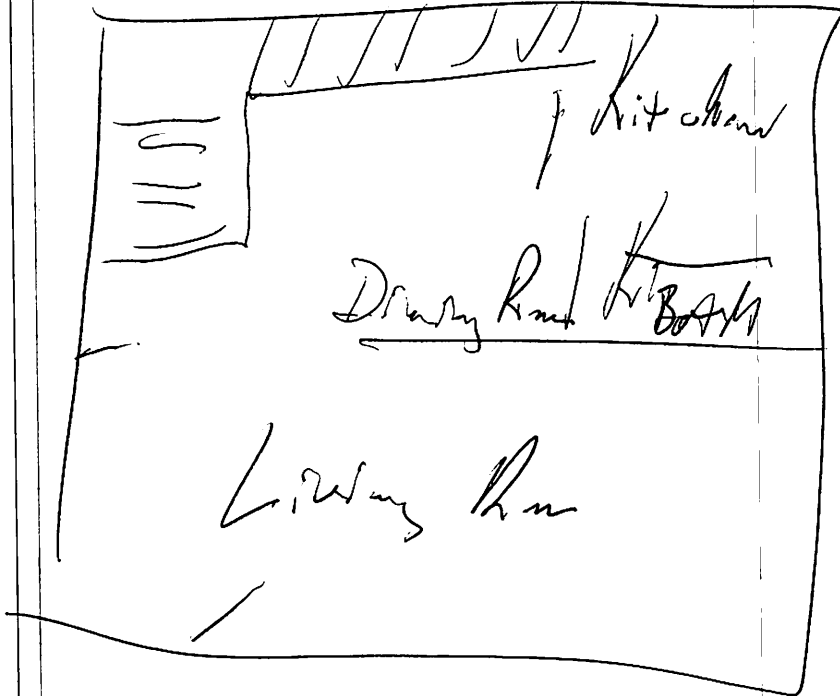

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 2

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 1434 Camp St.
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-25-93

Substrate:

- B - Brick
- Ⓒ - Concrete
- G - Gypsum
- ⒫ - Plaster
- Ⓦ - Wood
- Ⓜ - Metal
- T - Tile
- CP - Carpet

Paint Condition:

- Ⓘ - intact
- Ⓓ - defective (peeling, cracked, loose)
- Ⓔ - factory finish

Comments: Exterior Positive: Siding, Soffit, Facia, Threshold
Interior Positive: Baseboard, Ceiling, Door Trim,

This testing was accomplished utilizing: X

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope

SIGNATURES



[Signature]

Technician/Inspector

Agency Representative


No indication of Lead Based Paint in this unit.

Paint samples taken for analysis X Lead indicated

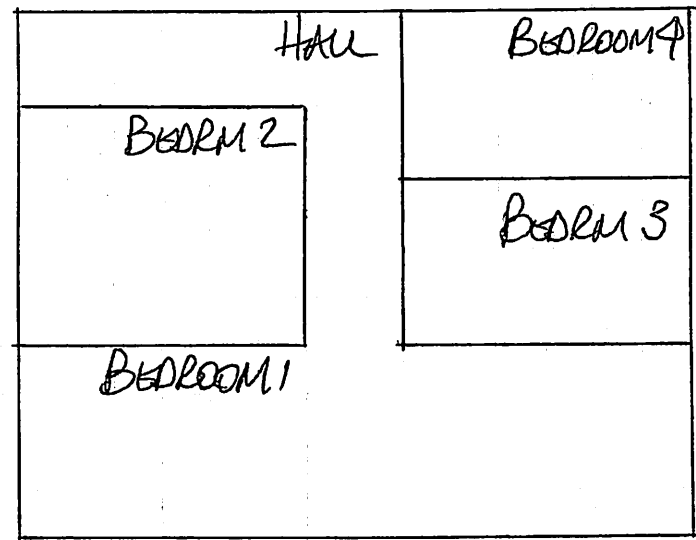
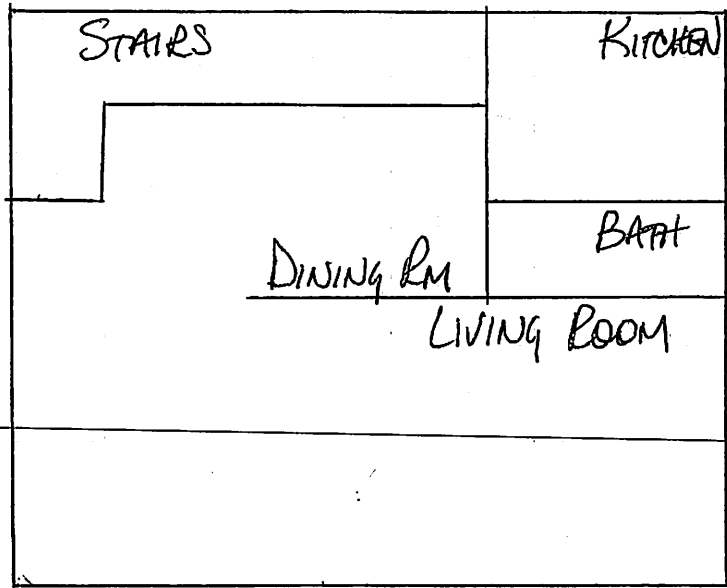


UNIT ADDRESS 1434 Camp # _____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING	B	C			(W)	M		(D)	D	FF			13.2	
EXTERIOR TRIM	B	C			W	M	T	I	D	FF				
SOFFIT					(W)	M		(D)	D	FF			11.0	
FACIA					(W)	M		(D)	D	FF			14.8	
WINDOW EXTERIOR SASH					W	(M)		I	D	(FF)				
WINDOW TRIM					W	(M)		I	D	(FF)				
WINDOW PRIMARY SASH					W	(M)		I	D	(FF)				
WINDOW SILL					W	(M)		I	D	(FF)				
PORCH COLUMN		C			W	M		I	D	FF				
PORCH CEILING					(W)	M		I	D	(FF)			0.0	
PORCH FLOOR		(C)			W	M		I	(D)	FF			0.1	
STAIR STEPS		(C)			W	M		I	(D)	FF			0.0	
STAIR STRINGER					W			I	D	FF				
DOOR					(W)	M		(D)	D	FF			0.0	
DOOR TRIM					W	M		I	D	FF				
DOOR JAMB					(W)	M		I	D	(FF)			0.0	
SKIRTING	B	C	G	P	W	M	T	I	D	FF				
THRESHOLD	B	C	G	P	(W)	M	T	(I)	D	FF			3.1	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

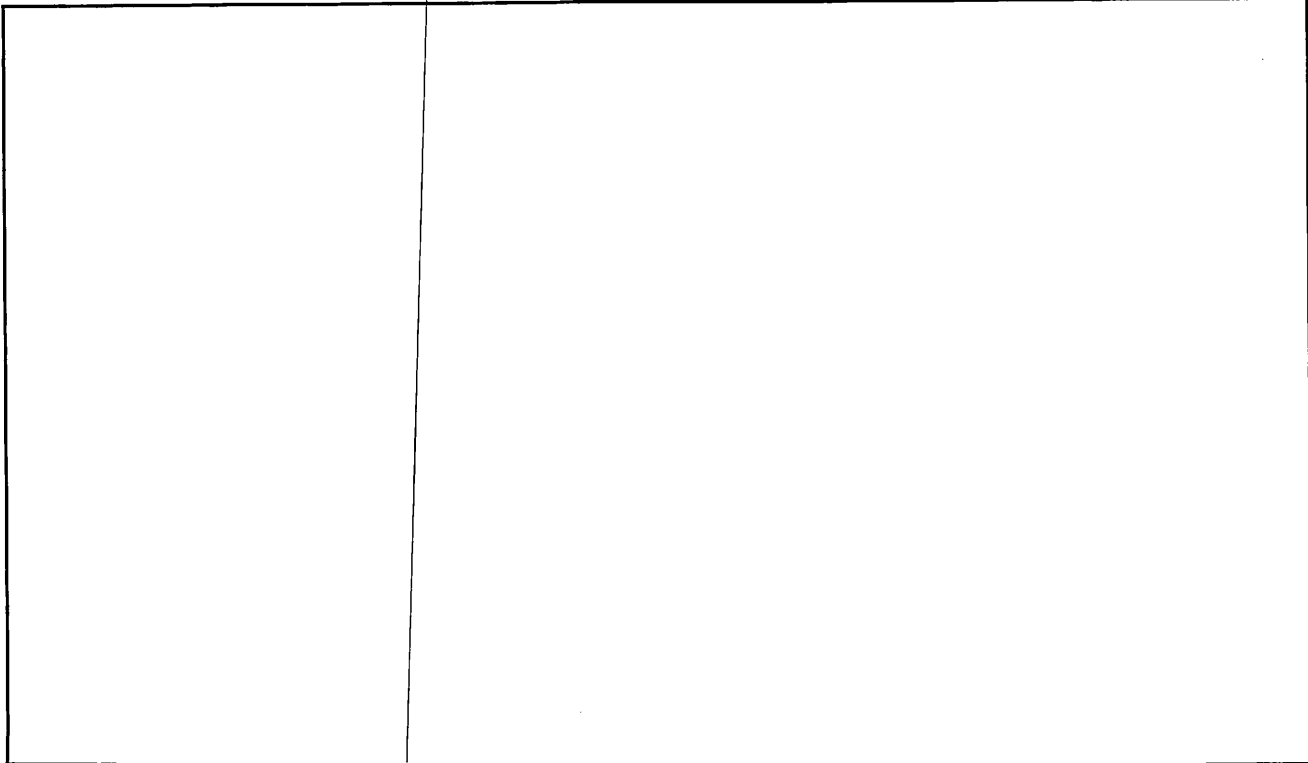

1st

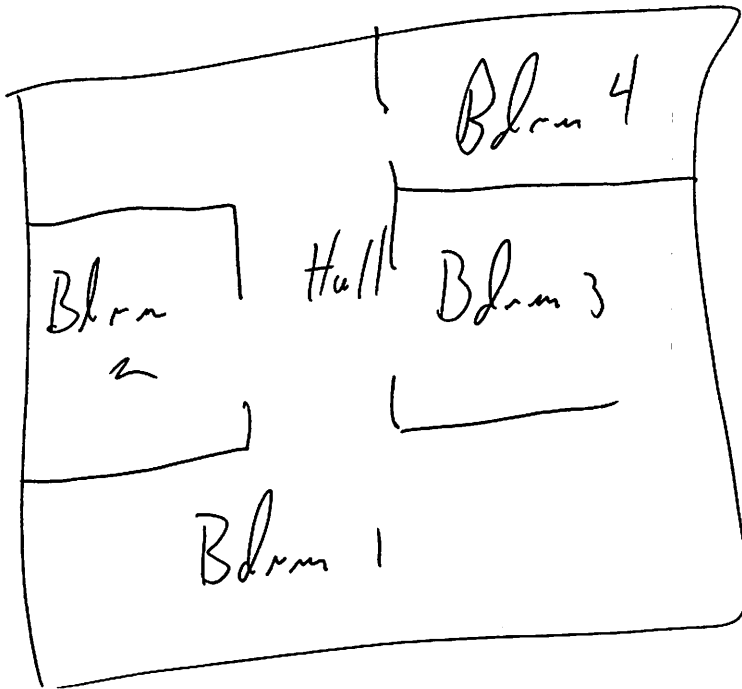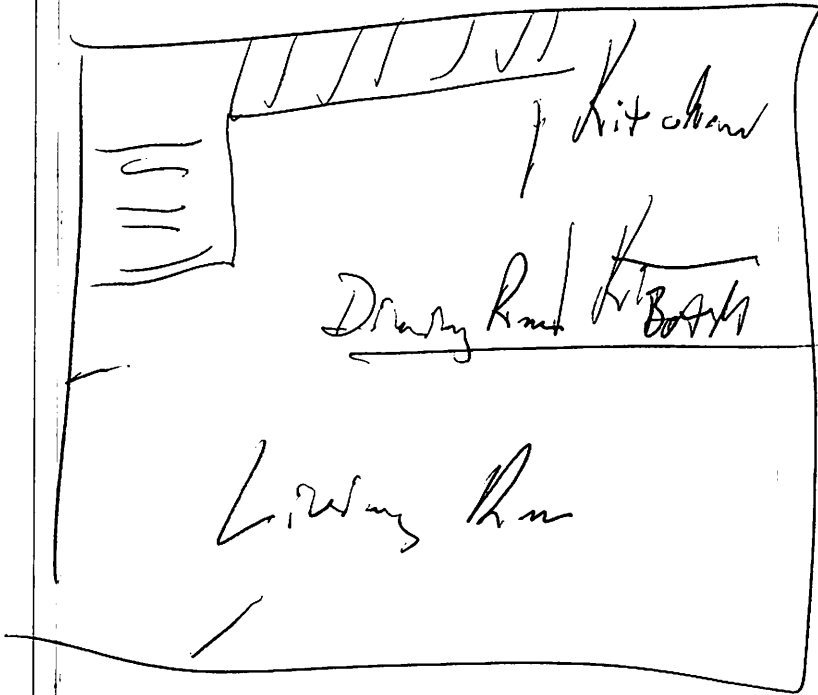

1434 Camp

ROOM NAME Living Rm # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		I	D	(FF)				
CEILING <u>Tile</u>			G	P	W	M		I	D	FF				
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		I	D	(FF)				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.1	
WINDOW SASH					W	(M)		I	D	FF				
WINDOW TRIM					(W)	M		I	D	(FF)				
WINDOW SILL					(W)	M		I	D	(FF)				
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				



ROOM NAME Dining Room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF			0.1	
CEILING <u>Tile</u>			G	P	W	M		I	D	FF				
DOOR					(W)	M		(D)	D	FF			0.0	
DOOR TRIM					(W)	M		(D)	D	FF			0.2	
SHELF					(W)	M		I	D	(FF)			0.1	
SHELF SUPPORT					(W)	M		I	D	(FF)			0.1	
WALL	E	C	G	P	(W)	M	T	I	D	(FF)			0.0	
WINDOW SASH					W	(M)		I	D	(FF)			0.2	
WINDOW TRIM					(W)	M		(D)	D	FF			0.0	
WINDOW SILL					(W)	M		(D)	D	FF			0.2	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME BATH # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				(Vinyl)	W	M		I	D	FF				
CEILING			G	(P)	W	M		(D)	D	FF			0.1	
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		I	D	(FF)				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			(Vinyl)	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

1st

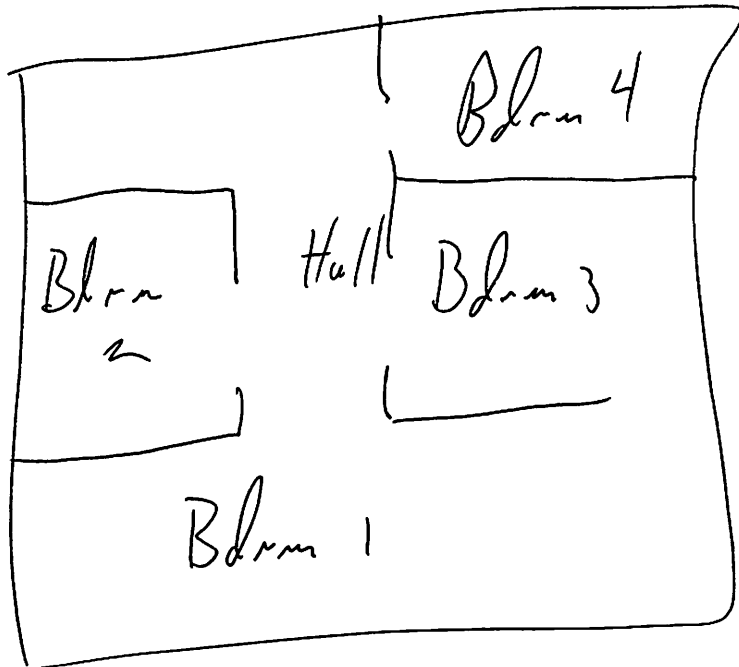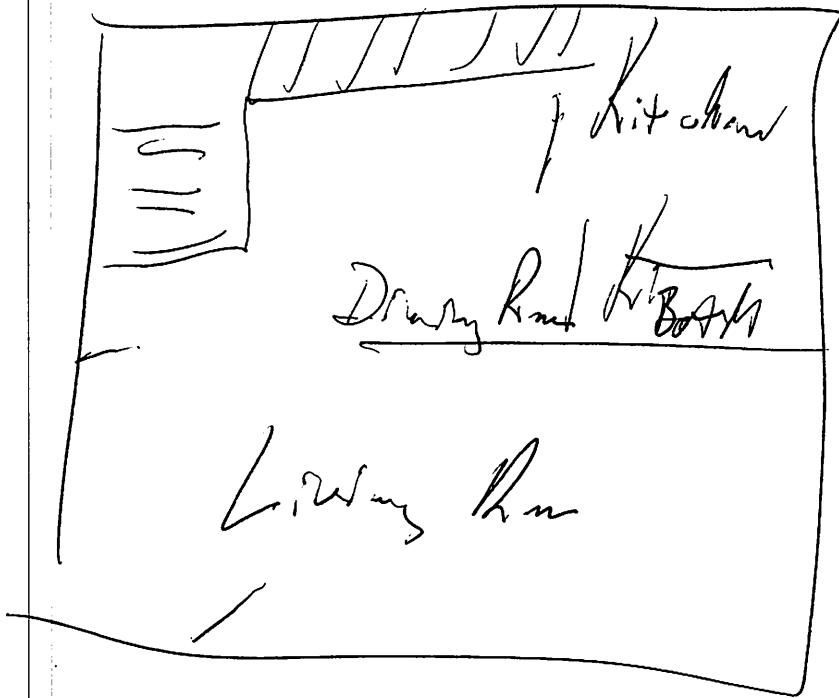

ROOM NAME Bedroom 2

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.2	
CEILING			G	(P)	W	M		(I)	D	FF			0.1	
DOOR					(W)	M		(I)	D	FF			0.0	
DOOR TRIM					(W)	M		(I)	(D)	FF			0.0	
SHELF					(W)	M		(I)	D	FF			0.2	
SHELF SUPPORT					(W)	M		(I)	D	FF			0.2	
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.1	
WINDOW SASH					W	(M)		(I)	D	FF				
WINDOW TRIM					(W)	M		(I)	D	FF			0.0	
WINDOW SILL					(W)	M		(I)	D	FF			0.0	
FLOOR	(CP)			Vinyl	W			(I)	D	FF				
	B	C	G	P	W	M	T	(I)	D	FF				
	B	C	G	P	W	M	T	(I)	D	FF				
	B	C	G	P	W	M	T	(I)	D	FF				

ROOM NAME Bedroom 3

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	(D)	FF			0.0	
CEILING			G	(P)	W	(M)		(I)	D	FF			0.1	
DOOR					(W)	M		(I)	(D)	FF			0.3	
DOOR TRIM					(W)	M		(I)	D	FF			0.1	
SHELF					(W)	M		(I)	D	FF			0.0	
SHELF SUPPORT					(W)	M		(I)	D	FF			0.2	
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.0	
WINDOW SASH					W	(M)		(I)	D	(FF)				
WINDOW TRIM					(W)	M		(I)	D	FF			0.1	
WINDOW SILL					(W)	M		(I)	D	FF			0.1	
FLOOR	(CP)			Vinyl	W			(I)	D	FF				
	B	C	G	P	W	M	T	(I)	D	FF				
	B	C	G	P	W	M	T	(I)	D	FF				
	B	C	G	P	W	M	T	(I)	D	FF				

ROOM NAME Bedroom 4

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.2	
CEILING			G	(P)	W	M		(I)	D	FF			0.1	
DOOR					(W)	M		(I)	(D)	FF			0.0	
DOOR TRIM					(W)	M		(I)	(D)	FF			0.3	
SHELF					W	M		(I)	D	FF				
SHELF SUPPORT					W	M		(I)	D	FF				
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.0	
WINDOW SASH					W	(M)		(I)	D	(FF)				
WINDOW TRIM					(W)	M		(I)	D	FF			0.2	
WINDOW SILL					(W)	M		(I)	D	FF			0.0	
FLOOR	(CP)			Vinyl	W			(I)	D	FF				
Attic Access Panel	B	C	G	P	(W)	M	T	(I)	D	FF			0.2	
	B	C	G	P	W	M	T	(I)	D	FF				
	B	C	G	P	W	M	T	(I)	D	FF				

ROOM NAME Basement 1-

REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF				
CEILING			G	P	W	M	I	D	FF			
DOOR					W	M	I	D	FF			
DOOR TRIM					W	M	I	D	FF			
SHELF					W	M	I	D	FF			
SHELF SUPPORT					W	M	I	D	FF			
WALL	B	(C)	G	P	W	M	T	I	(D)	FF		0.1
WINDOW SASH					W	M	I	D	FF			
WINDOW TRIM					W	M	I	D	FF			
WINDOW SILL					W	M	I	D	FF			
FLOOR	CP		Vinyl	W			I	D	FF			
<u>Stair</u>	B	C	G	P	W	M	T	I	D	FF		
<u>Stringer</u>	B	C	G	P	(W)	M	T	I	(D)	FF		0.2
	B	C	G	P	W	M	T	I	D	FF		

ROOM NAME Back Hall

REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W)	M	(I)	D	FF				3.0
CEILING			G	P	(W)	M	(I)	D	FF			3.1
DOOR					(W)	M	I	D	(FF)			
DOOR TRIM					(W)	M	I	(D)	FF			3.5
SHELF					W	M	I	D	FF			
SHELF SUPPORT					W	M	I	D	FF			
WALL	B	C	G	(P)	W	M	T	(I)	(D)	FF		0.1
WINDOW SASH					W	M	I	D	FF			
WINDOW TRIM					W	M	I	D	FF			
WINDOW SILL					W	M	I	D	FF			
FLOOR	CP		Vinyl	(W)			I	(D)	FF			0.1
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		

ROOM NAME _____

REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF				
CEILING			G	P	W	M	I	D	FF			
DOOR					W	M	I	D	FF			
DOOR TRIM					W	M	I	D	FF			
SHELF					W	M	I	D	FF			
SHELF SUPPORT					W	M	I	D	FF			
WALL	B	C	G	P	W	M	T	I	D	FF		
WINDOW SASH					W	M	I	D	FF			
WINDOW TRIM					W	M	I	D	FF			
WINDOW SILL					W	M	I	D	FF			
FLOOR	CP		Vinyl	W			I	D	FF			
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		

KITCHEN	STAIRS
	BATHRM
DINING ROOM	BEDROOM 2
LIVING ROOM	BEDROOM 1