

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 15

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 1612 Central Ave.
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-26-93

Substrate:

B - Brick
C - Concrete
G - Gypsum
P - Plaster
 Wood
 Metal
T - Tile
CP - Carpet

Paint Condition:

intact
 defective (peeling, cracked, loose)
 factory finish

Comments:

Exterior Positive: Porch Column

Interior Positive: Living Room - Baseboard
Dining Room - Baseboard Bath - Door, Door Trim, Windows
Trim + Sill Hall - Linen Door Bedrooms 1, 2 + 3 -
Baseboard, Door, Door Trim, Shelf Support, Windows
Trim + Sill

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope



SIGNATURES


Technician/Inspector

Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated

1612 Central Ave.

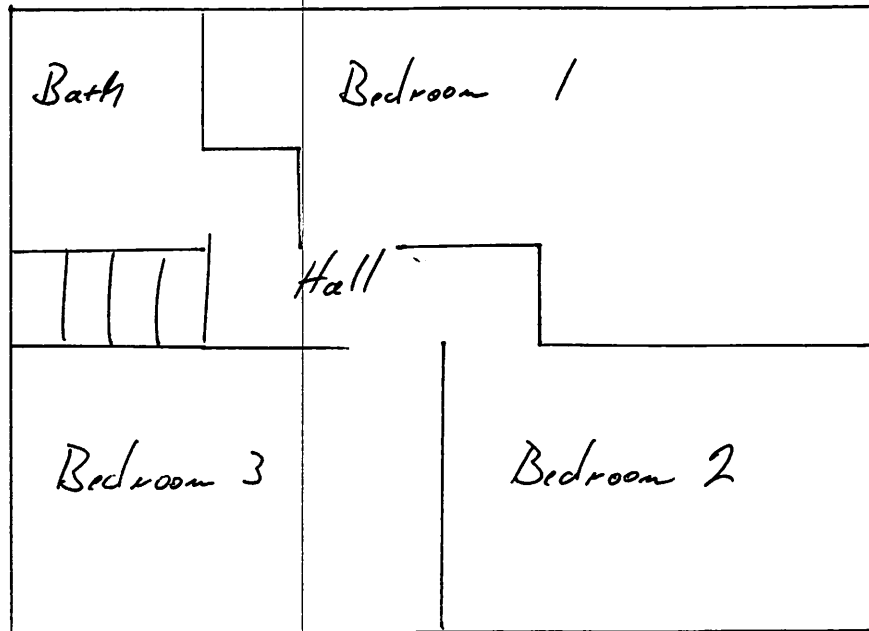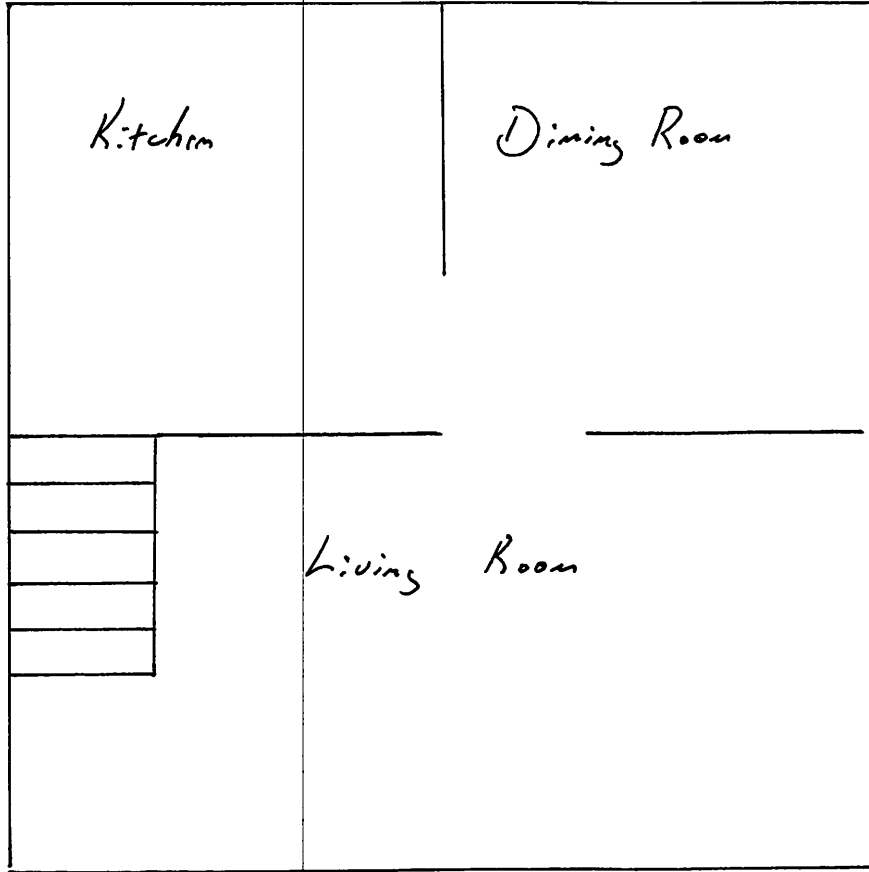

UNIT ADDRESS 1612 Central Ave

_____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING <i>Vingl</i>	B	C			W	M		I	D	FF				
EXTERIOR TRIM <i>Vingl</i>	B	C			W	M	T	I	D	FF				
SOFFIT					W	M		I	D	FF				
FACIA					W	M		I	D	FF				
WINDOW EXTERIOR SASH					W	M		I	D	FF			0.1	
WINDOW TRIM					W	M		I	D	FF				
WINDOW PRIMARY SASH					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
PORCH COLUMN		C			W	M		I	D	FF			46.6	
PORCH CEILING					W	M		I	D	FF				
PORCH FLOOR		C			W	M		I	D	FF			0.2	
STAIR STEPS		C			W	M		I	D	FF				
STAIR STRINGER					W			I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
DOOR JAMB					W	M		I	D	FF				
SKIRTING	B	C	G	P	W	M	T	I	D	FF				
THRESHOLD	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Living Room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	(W)	M	I	(D)	FF				1.7		
CEILING			G	(P)	W	M	(I)	D	FF				0.2		
DOOR					W	(M)	I	D	FF						
DOOR TRIM					(W)	M	(I)	D	FF						
SHELF					W	M	I	D	FF						
SHELF SUPPORT					W	M	I	D	FF						
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.3		
WINDOW SASH					W	(M)	I	D	FF						
WINDOW TRIM					(W)	M	(I)	D	FF				0.1		
WINDOW SILL					(W)	M	(I)	D	FF				0.0		
FLOOR	(CP)			Vinyl	W			I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					

ROOM NAME Dining Room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	(W)	M	(I)	D	FF				3.2		
CEILING			G	(P)	W	M	(I)	D	FF				0.1		
DOOR					(W)	M	(I)	D	FF						
DOOR TRIM					(W)	M	(I)	D	FF						
SHELF					W	M	I	D	FF						
SHELF SUPPORT					W	M	I	D	FF						
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.1		
WINDOW SASH					W	(M)	I	D	(FF)						
WINDOW TRIM					(W)	M	(I)	D	FF				0.0		
WINDOW SILL					(W)	M	(I)	D	FF				0.0		
FLOOR	CP			Vinyl	W			I	D	FF					
<u>Bench Seat</u>	B	C	G	P	(W)	M	T	(I)	D	FF			0.1		
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					

ROOM NAME Kitchen # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	(W)	M	I	D	(FF)						
CEILING <u>Tile</u>			G	P	W	M	I	D	FF						
DOOR					(W)	M	I	D	(FF)						
DOOR TRIM					(W)	M	(I)	D	FF				0.1		
SHELF					W	M	I	D	FF						
SHELF SUPPORT					W	M	I	D	FF						
WALL	B	C	(G)	(P)	W	M	T	(I)	D	FF			0.1		
WINDOW SASH					W	(M)	I	D	(FF)						
WINDOW TRIM					(W)	M	(I)	D	FF				0.0		
WINDOW SILL					(W)	M	(I)	D	FF				0.2		
FLOOR	CP			(Vinyl)	W			I	D	FF					
<u>Cup board</u>	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					

ROOM NAME Stairway to 2nd Flr

REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF		0.0	
CEILING			G	W	M	D	D	FF		0.1	
DOOR				W	M	I	D	FF			
DOOR TRIM				W	M	I	D	FF			
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	W	M	T	D	FF			
WINDOW SASH				W	M	I	D	FF			
WINDOW TRIM				W	M	D	D	FF		0.0	
WINDOW SILL				W	M	D	D	FF		0.2	
FLOOR	CP		Vinyl	W		I	D	FF			
Post	B	C	G	P	W	M	T	D	FF		0.1
Railing	B	C	G	P	W	M	T	D	FF		0.0
	B	C	G	P	W	M	T	D	FF		

ROOM NAME Bath

REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF			
CEILING			G	W	M	D	D	FF		0.0	
DOOR				W	M	D	D	FF		7.0	
DOOR TRIM				W	M	D	D	FF		9.1	
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	W	M	T	D	FF		0.0	
WINDOW SASH				W	M	I	D	FF			
WINDOW TRIM				W	M	D	D	FF		6.2	
WINDOW SILL				W	M	D	D	FF		7.8	
FLOOR	CP		Vinyl	W		I	D	FF			
	B	C	G	P	W	M	T	D	FF		
	B	C	G	P	W	M	T	D	FF		
	B	C	G	P	W	M	T	D	FF		

ROOM NAME Bohannon Hall

REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF			
CEILING			G	W	M	D	D	FF		0.0	
DOOR				W	M	D	D	FF		11.0	
DOOR TRIM				W	M	I	D	FF			
SHELF				W	M	D	D	FF		0.0	
SHELF SUPPORT				W	M	D	D	FF		0.1	
WALL	B	C	G	P	W	M	T	D	FF		
WINDOW SASH				W	M	I	D	FF			
WINDOW TRIM				W	M	I	D	FF			
WINDOW SILL				W	M	I	D	FF			
FLOOR	CP		Vinyl	W		I	D	FF			
	B	C	G	P	W	M	T	D	FF		
	B	C	G	P	W	M	T	D	FF		
	B	C	G	P	W	M	T	D	FF		

ROOM NAME Bedroom 1 # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			6.2	
CEILING			G	W	M			I	D	FF			0.1	
DOOR				W	M			I	D	FF			7.9	
DOOR TRIM				W	M			I	D	FF			12.3	
SHELF				W	M			I	D	FF			0.1	
SHELF SUPPORT				W	M			I	D	FF			10.0	
WALL	B	C	G	W	M	T		I	D	FF			0.0	
WINDOW SASH				W	M			I	D	FF				
WINDOW TRIM				W	M			I	D	FF			4.9	
WINDOW SILL				W	M			I	D	FF			5.4	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 2 # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			8.3	
CEILING			G	W	M			I	D	FF			0.2	
DOOR				W	M			I	D	FF			9.5	
DOOR TRIM				W	M			I	D	FF			11.0	
SHELF				W	M			I	D	FF			0.0	
SHELF SUPPORT				W	M			I	D	FF			15.0	
WALL	B	C	G	W	M	T		I	D	FF			0.1	
WINDOW SASH				W	M			I	D	FF				
WINDOW TRIM				W	M			I	D	FF			3.8	
WINDOW SILL				W	M			I	D	FF			6.7	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 3 # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			7.7	
CEILING			G	W	M			I	D	FF			0.1	
DOOR				W	M			I	D	FF			5.5	
DOOR TRIM				W	M			I	D	FF			10.4	
SHELF				W	M			I	D	FF			0.0	
SHELF SUPPORT				W	M			I	D	FF			13.1	
WALL	B	C	G	W	M	T		I	D	FF			0.0	
WINDOW SASH				W	M			I	D	FF				
WINDOW TRIM				W	M			I	D	FF			9.9	
WINDOW SILL				W	M			I	D	FF			6.2	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Basement - N/A - Dags # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl		W	M		I	D	FF	
CEILING			G	P	W	M		I	D	FF	
DOOR					W	M		I	D	FF	
DOOR TRIM					W	M		I	D	FF	
SHELF					W	M		I	D	FF	
SHELF SUPPORT					W	M		I	D	FF	
WALL	B	C	G	P	W	M	T	I	D	FF	
WINDOW SASH					W	M		I	D	FF	
WINDOW TRIM					W	M		I	D	FF	
WINDOW SILL					W	M		I	D	FF	
FLOOR	CP		Vinyl		W			I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME _____ # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl		W	M		I	D	FF	
CEILING			G	P	W	M		I	D	FF	
DOOR					W	M		I	D	FF	
DOOR TRIM					W	M		I	D	FF	
SHELF					W	M		I	D	FF	
SHELF SUPPORT					W	M		I	D	FF	
WALL	B	C	G	P	W	M	T	I	D	FF	
WINDOW SASH					W	M		I	D	FF	
WINDOW TRIM					W	M		I	D	FF	
WINDOW SILL					W	M		I	D	FF	
FLOOR	CP		Vinyl		W			I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME _____ # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl		W	M		I	D	FF	
CEILING			G	P	W	M		I	D	FF	
DOOR					W	M		I	D	FF	
DOOR TRIM					W	M		I	D	FF	
SHELF					W	M		I	D	FF	
SHELF SUPPORT					W	M		I	D	FF	
WALL	B	C	G	P	W	M	T	I	D	FF	
WINDOW SASH					W	M		I	D	FF	
WINDOW TRIM					W	M		I	D	FF	
WINDOW SILL					W	M		I	D	FF	
FLOOR	CP		Vinyl		W			I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	