

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 24

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 908 Hancock
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-27-93

Substrate:

B - Brick
C - Concrete
G - Gypsum
P - Plaster

W - Wood
 M - Metal
T - Tile
CP - Carpet

Paint Condition:

intact
D - defective (peeling, cracked, loose)
 - factory finish

Comments:

Exterior Positive: Porch Columns

Interior Positive: Living Room - Window Sill Bedroom 1 -
Window Trim + Sill Kitchen - Window Sill
Bedroom 2 - Door Trim

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope

SIGNATURES


Thomas Gumbel
Technician/Inspector

Agency Representative

____ No indication of Lead Based Paint in this unit.


____ Paint samples taken for analysis Lead indicated

908 Hancock

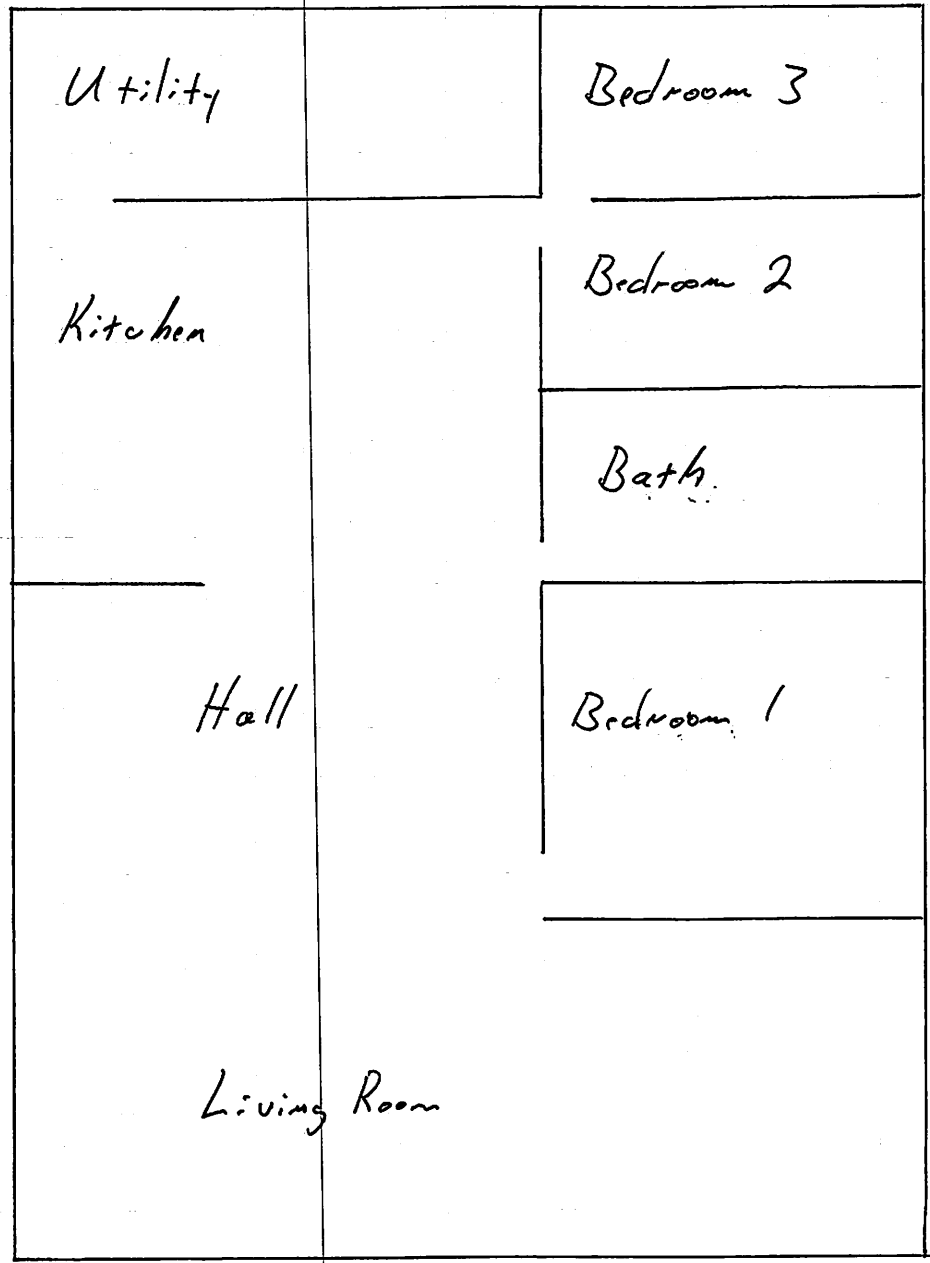

UNIT ADDRESS 908 Hancock # _____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE						PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING <i>Viny /</i>	B	C			W	M		I	D	FF			
EXTERIOR TRIM <i>Viny /</i>	B	C			W	M	T	I	D	FF			
SOFFIT					W	M		I	D	FF			
FACIA					W	M		I	D	FF			
WINDOW EXTERIOR SASH					W	M		I	D	FF			
WINDOW TRIM					W	M		I	D	FF			
WINDOW PRIMARY SASH					W	M		I	D	FF			
WINDOW SILL					W	M		I	D	FF			
PORCH COLUMN		C			W	M		I	D	FF		6-1	
PORCH CEILING					W	M		I	D	FF			
PORCH FLOOR		C			W	M		I	D	FF			
STAIR STEPS		C			W	M		I	D	FF			
STAIR STRINGER					W			I	D	FF			
DOOR					W	M		I	D	FF			
DOOR TRIM					W	M		I	D	FF			
DOOR JAMB					W	M		I	D	FF			
SKIRTING	B	C	G	P	W	M	T	I	D	FF			
THRESHOLD	B	C	G	P	W	M	T	I	D	FF			
<i>Railings</i>	B	C	G	P	W	M	T	I	D	FF		0.2	
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			



UNIT ADDRESS 908 Howell Garage # _____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING	B	C			(W)	M		(1)	D	FF			0.2	
EXTERIOR TRIM	B	C			(W)	M	T	(1)	D	FF			0.0	
SOFFIT					W	M		I	D	FF				
FACIA					W	M		I	D	FF				
WINDOW EXTERIOR SASH					W	M		I	D	FF				
WINDOW TRIM					(W)	M		(0)	D	FF			6.8	
WINDOW PRIMARY SASH					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
PORCH COLUMN		C			W	M		I	D	FF				
PORCH CEILING					W	M		I	D	FF				
PORCH FLOOR		C			W	M		I	D	FF				
STAIR STEPS		C			W	M		I	D	FF				
STAIR STRINGER					W			I	D	FF				
DOOR					(W)	M		(1)	D	FF			0.1	
DOOR TRIM					(W)	M		(0)	D	FF			0.0	
DOOR JAMB					(W)	M		(1)	D	FF			0.0	
SKIRTING	B	C	G	P	W	M	T	I	D	FF				
THRESHOLD	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Living Room

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF			0.0	
CEILING			G	(P)	W	M		(D)	D	FF				
DOOR					(W)	M		(D)	D	FF			0.1	
DOOR TRIM					(W)	M		(D)	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.0	
WINDOW SASH					W	(W)		I	D	FF				
WINDOW TRIM					(W)	M		(D)	D	FF			0.1	
WINDOW SILL					(W)	M		(D)	D	FF			3.1	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Hall

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF			0.3	
CEILING			G	(P)	W	M		(D)	D	FF			0.1	
DOOR					W	M		I	D	FF				
DOOR TRIM					(W)	M		(D)	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	(G)	P	W	M	T	(D)	D	FF			0.1	
WINDOW SASH					W	(W)		I	D	(FF)				
WINDOW TRIM					(W)	M		(D)	D	FF			0.2	
WINDOW SILL					(W)	M		(D)	D	FF			0.0	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 1

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF				
CEILING			G	(P)	W	M		(D)	D	FF			0.0	
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		(D)	D	FF			0.1	
SHELF					W	(W)		I	D	(FF)				
SHELF SUPPORT					W	(W)		I	D	(FF)				
WALL	B	C	(G)	P	W	M	T	(D)	D	FF			0.0	
WINDOW SASH					W	(W)		I	D	FF				
WINDOW TRIM					(W)	M		(D)	D	FF			13.1	
WINDOW SILL					(W)	M		(D)	D	FF			8.3	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 2 Bath # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF				0.0
CEILING			(G)	P	W	M		(D)	D	FF				0.0
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		(D)	D	FF				0.1
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	(G)	P	W	M	T	I	(D)	FF				0.1
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			(Vinyl)	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Kitchen # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				0.2
CEILING			(G)	P	W	M		(D)	D	FF				0.0
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		(D)	D	FF				0.1
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	(G)	P	W	M	T	I	(D)	FF				0.0
WINDOW SASH					W	(M)		I	D	(FF)				
WINDOW TRIM					(W)	M		(D)	D	FF				0.0
WINDOW SILL					(W)	M		(D)	D	FF				7.4
FLOOR	CP			(Vinyl)	W			I	D	FF				
<u>Ceapboard</u>	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 2 # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF				0.1
CEILING			(G)	P	W	M		(D)	D	FF				2.0
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		(D)	D	FF				3.1
SHELF					W	(M)		I	D	(FF)				
SHELF SUPPORT					W	(M)		I	D	(FF)				
WALL	B	C	(G)	P	W	M	T	I	(D)	FF				0.0
WINDOW SASH					W	(M)		I	D	FF				
WINDOW TRIM					(W)	M		(D)	D	FF				0.3
WINDOW SILL					(W)	M		(D)	D	FF				0.3
FLOOR	(CP)			(Vinyl)	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 3 # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.1	
CEILING			G	P	W	M		I	D	FF			0.0	
DOOR					W	M		I	D	EE				
DOOR TRIM					W	M		I	D	FF			0.2	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	EE				
WINDOW TRIM					W	M		I	D	FF			0.0	
WINDOW SILL					W	M		I	D	FF			0.3	
FLOOR	CP			Vinyl	W			I	D	FF				
Wall Trim	B	C	G	P	W	M	T	I	D	FF			0.2	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Utility Room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.0	
CEILING			G	P	W	M		I	D	FF			0.0	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF			0.0	
WINDOW TRIM					W	M		I	D	FF			0.1	
WINDOW SILL					W	M		I	D	FF			0.0	
FLOOR	CP	C		Vinyl	W			I	D	FF			0.1	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME _____ # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				