

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 12

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Erie Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 132 Homestead
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-26-93

Substrate:

- B - Brick
- C - Concrete
- G - Gypsum
- P - Plaster
- W - Wood
- M - Metal
- T - Tile
- CP - Carpet

Paint Condition:

- I - intact
- D - defective (peeling, cracked, loose)
- FF - factory finish

1999
SIOED
~~12/28/93~~


Comments:

Exterior Positive: Siding, Window Trim & Sill,
Porch Column, Door, Door Trim, Porch Trim
Interior Positive: Bedroom 1 - Baseboard, Door Trim,
Window Trim & Sill Kitchen - Baseboard, Door Trim
Hall - Door Trim Stairway - Door Trim, Wall
Bedroom 2 - Window Sash & Sill Sitting Room - Window
Sash & Sill

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope

SIGNATURES

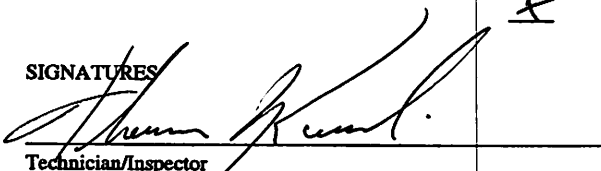


Technician/Inspector


Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated

132 Homestead

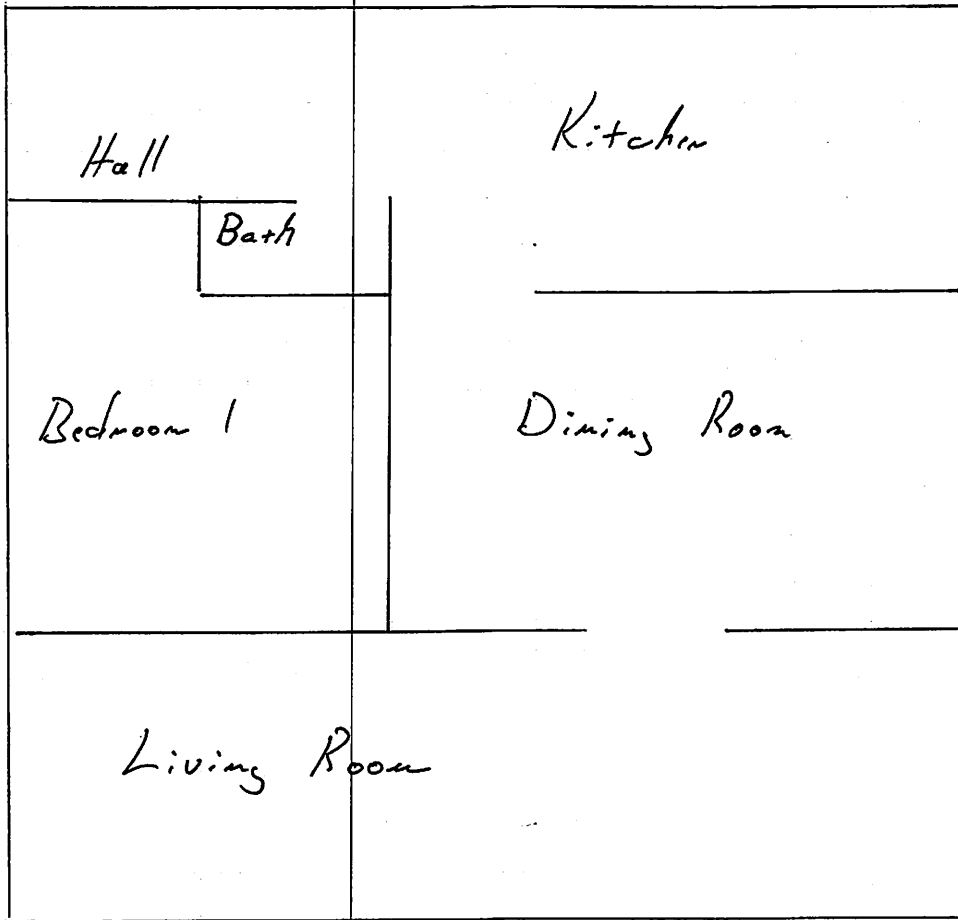


2nd Floor

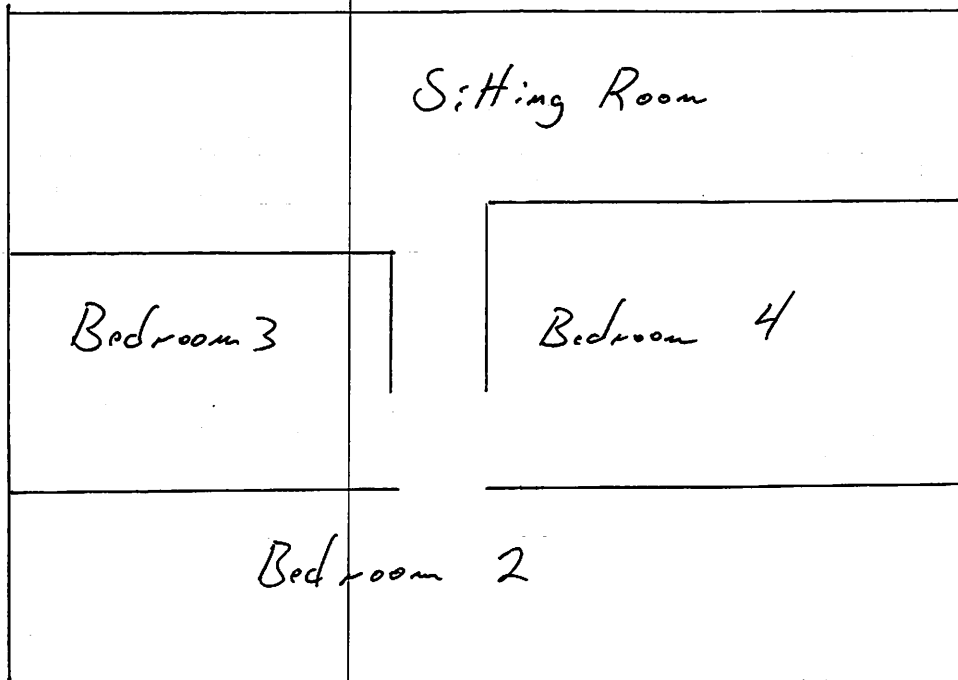

UNIT ADDRESS 132 Homestead

_____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
SIDING <i>Slate</i>	B	C			W	M		①	D	FF		8.4
EXTERIOR TRIM	B	C			W	M	T	I	D	FF		
SOFFIT					W	M		I	D	FF		
FACIA					W	M		I	D	FF		
WINDOW EXTERIOR SASH					Ⓜ	M		①	D	FF		0.0
WINDOW TRIM					Ⓜ	M		I	Ⓛ	FF		2.3
WINDOW PRIMARY SASH					W	Ⓜ		I	D	Ⓛ		
WINDOW SILL					Ⓜ	M		I	Ⓛ	FF		2.6
PORCH COLUMN		C			W	M		I	D	FF		
PORCH CEILING					Ⓜ	M		①	D	FF		48.1
PORCH FLOOR		C			Ⓜ	M		①	D	FF		0.1
STAIR STEPS		Ⓛ			W	M		Ⓛ	D	FF		0.0
STAIR STRINGER					W			I	D	FF		
DOOR					Ⓜ	M		①	D	FF		2.8
DOOR TRIM					Ⓜ	M		Ⓛ	D	FF		3.6
DOOR JAMB					Ⓜ	M		①	D	FF		0.2
SKIRTING	B	C	G	P	W	M	T	I	D	FF		
THRESHOLD	B	C	G	P	Ⓜ	M	T	I	Ⓛ	FF		
<i>Porch Trim</i>	B	C	G	P	Ⓜ	M	T	I	Ⓛ	FF		56.4
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		

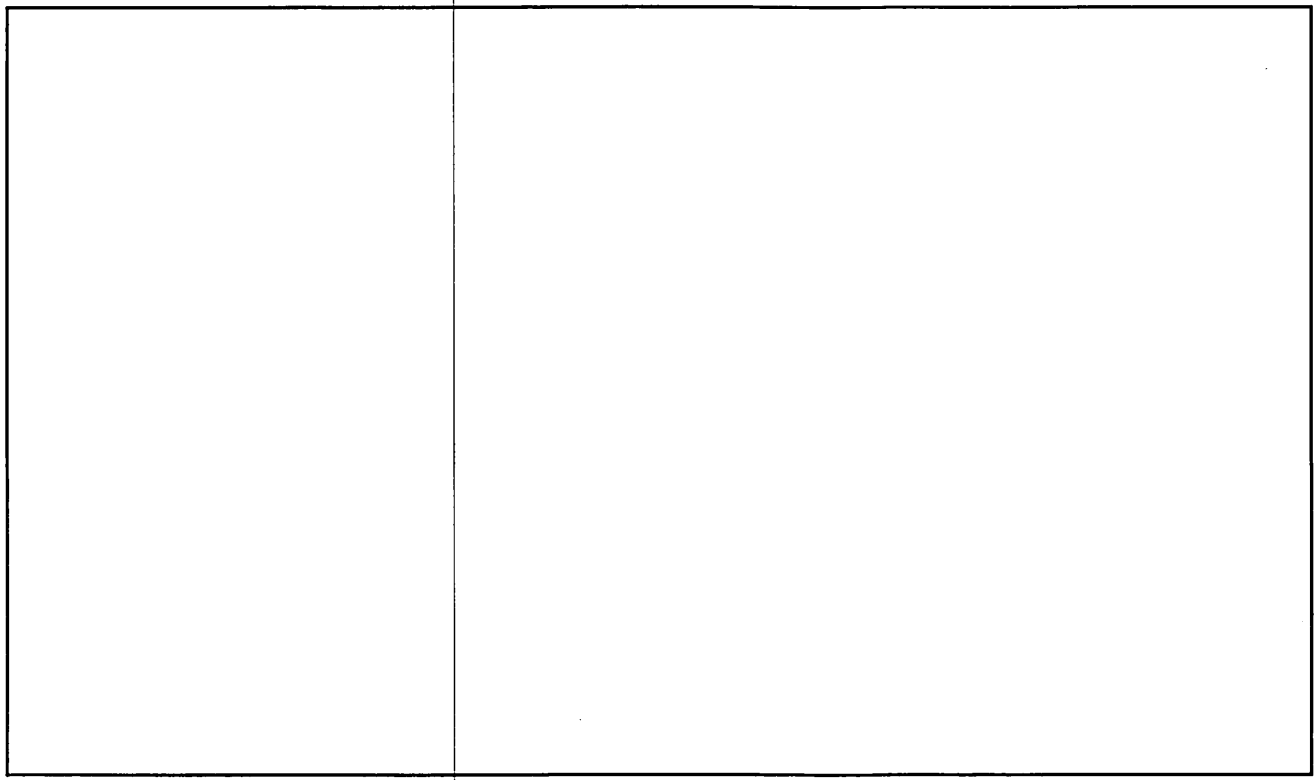

ROOM NAME Living Room

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		I	D	(FF)				
CEILING <u>Tile</u>				G	(P)	W	M	(D)	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					(W)	M		I	D	(FF)				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.0	
WINDOW SASH					(W)	M		I	D	(FF)				
WINDOW TRIM					(W)	M		I	D	(FF)				
WINDOW SILL					(W)	M		I	D	(FF)				
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Dining Room

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		I	D	(FF)				
CEILING				G	(P)	W	M	I	(D)	FF			0.2	
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		I	D	(FF)				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.3	
WINDOW SASH					(W)	M		I	D	(FF)				
WINDOW TRIM					(W)	M		I	D	(FF)				
WINDOW SILL					(W)	M		I	D	(FF)				
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 1

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	(FF)			2.4	
CEILING				G	(P)	W	M	(D)	D	FF				
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		I	(D)	(FF)			3.4	
SHELF					(W)	M		(D)	D	FF			0.1	
SHELF SUPPORT					(W)	M		(D)	D	FF			0.0	
WALL	B	C	G	(P)	W	M	T	(D)	D	FF				
WINDOW SASH					(W)	M		(D)	D	(FF)			0.2	
WINDOW TRIM					(W)	M		I	(D)	(FF)			2.6	
WINDOW SILL					(W)	M		I	(D)	(FF)			2.1	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Kitchen

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			3.7	
CEILING			G	P	W	M		I	D	FF			0.0	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF			15.6	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF			0.0	
WINDOW TRIM					W	M		I	D	FF			0.3	
WINDOW SILL					W	M		I	D	FF			0.1	
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Cupboard</u>	B	C	G	P	W	M	T	I	D	FF			0.3	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bath

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.0	
CEILING			G	P	W	M		I	D	FF			0.0	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Cabinet</u>	B	C	G	P	W	M	T	I	D	FF			3.1	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Hall 1st Flr

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.3	
CEILING			G	P	W	M		I	D	FF			0.0	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF			3.5	
SHELF					W	M		I	D	FF			0.1	
SHELF SUPPORT					W	M		I	D	FF			0.0	
WALL	B	C	G	P	W	M	T	I	D	FF			0.1	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Stairway to 2nd Flr # _____ REPORT # _____

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl W M	I	D	FF				
CEILING			G (P) W M	I	(D)	FF			0.0	
DOOR			W M	I	D	FF				
DOOR TRIM			(W) M	I	(D)	FF			3.0	
SHELF			W M	I	D	FF				
SHELF SUPPORT			W M	I	D	FF				
WALL	B	C	G (P) W M T	I	(D)	FF			8.1	
WINDOW SASH			W M	I	D	FF				
WINDOW TRIM			W M	I	D	FF				
WINDOW SILL			W M	I	D	FF				
FLOOR	CP		Vinyl W	I	D	FF				
Wall Trim	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				

ROOM NAME Bedroom 2 # _____ REPORT # _____

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl (W) M	I	D	(FF)				
CEILING			(G) P W M	(I)	D	FF			0.0	
DOOR			(W) M	I	D	(FF)				
DOOR TRIM			(W) M	I	D	(FF)				
SHELF			W M	I	D	FF				
SHELF SUPPORT			W M	I	D	FF				
WALL	B	C	(G) P W M T	(I)	D	FF			0.0	
WINDOW SASH			(W) M	I	(D)	FF			0.3/3.6	
WINDOW TRIM			(W) M	I	D	(FF)				
WINDOW SILL			(W) M	I	(D)	FF			0.2 2.2	
FLOOR	(CP)		Vinyl W	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				

ROOM NAME Bedroom 3 # _____ REPORT # _____

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl (W) M	I	D	(FF)				
CEILING			(G) P W M	(I)	D	FF			0.0	
DOOR			(W) M	I	D	(FF)				
DOOR TRIM			(W) M	I	D	(FF)				
SHELF			W M	I	D	FF				
SHELF SUPPORT			W M	I	D	FF				
WALL	B	C	(G) P W M T	(I)	D	FF			0.1	
WINDOW SASH			(W) M	I	D	(FF)				
WINDOW TRIM			(W) M	I	D	(FF)				
WINDOW SILL			(W) M	I	D	(FF)				
FLOOR	(CP)		Vinyl W	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				

ROOM NAME Bedroom 4

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		I	D	(FF)				
CEILING			(G)	P	W	M		(D)	D	FF			0.0	
DOOR					(W)	M		I	D	(FF)			0.0	
DOOR TRIM					(W)	M		I	D	(EE)			0.1	
SHELF					(W)	M		(G)	D	FF			0.2	
SHELF SUPPORT					(W)	M		(D)	D	FF			0.2	
WALL	B	C	G	P	(W)	M	T	I	D	(EE)				
WINDOW SASH					(W)	M		I	D	(EE)				
WINDOW TRIM					(W)	M		I	D	(FE)				
WINDOW SILL					(W)	M		I	D	(FF)				
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Sitting Room

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		I	D	(FF)				
CEILING			(G)	P	W	M		(D)	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	(G)	P	W	M	T	(D)	D	FF				
WINDOW SASH					(W)	M		I	(G)	FF			3.1	
WINDOW TRIM					(W)	M		I	D	(FF)				
WINDOW SILL					(W)	M		(D)	(D)	FF			4.4	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Basement / Stairway

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		I	(D)	FF			0.0	
CEILING			(G)	(P)	W	M		I	(D)	FF			0.1	
DOOR					(W)	M		I	(D)	FF				
DOOR TRIM					(W)	M		I	(D)	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL <u>Green</u>	B	C	G	(P)	W	M	T	I	(D)	FF			0.1	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
Wall <u>Green</u>	B	C	G	P	(W)	M	T	I	(D)	FF			0.0	
Cabinet	B	C	G	P	(W)	M	T	I	(D)	FF			0.2	
Wall <u>white</u>	(B)	C	G	P	W	M	T	I	(D)	FF			0.1	
Wall <u>Yellow</u>	(B)								(D)				0.0	