

# W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)  
6960 S. 13th Street, P. O. Box 285  
Oak Creek, WI. 53154-0285  
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 21

## ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority  
STREET 322 Warren Street UNIT/ADDRESS 207 Lawrence  
CITY Sandusky, Ohio UNIT/LOCATION \_\_\_\_\_  
DATE 10-27-93

Substrate:

- B - Brick
- C - Concrete
- G - Gypsum
- P - Plaster
- W - Wood
- M - Metal
- T - Tile
- CP - Carpet

Paint Condition:

- I - intact
- D - defective (peeling, cracked, loose)
- FF - factory finish

Comments: Interior Positives: Living Room - Window Trim + Sill  
Dining Room - Window Trim + Sill Kitchen - Door,  
Window Trim + Sill Bedroom 2 - Window Sill

This testing was accomplished utilizing:  A Warrington Microlead I, Revision 4, X-Ray Fluoroscope  
 A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope

SIGNATURES  
[Signature]  
\_\_\_\_\_  
Technician/Inspector

\_\_\_\_\_  
Agency Representative



\_\_\_\_\_ No indication of Lead Based Paint in this unit.  
\_\_\_\_\_ Paint samples taken for analysis  Lead indicated

207 Lawrence

UNIT ADDRESS


1st Floor

REPORT #

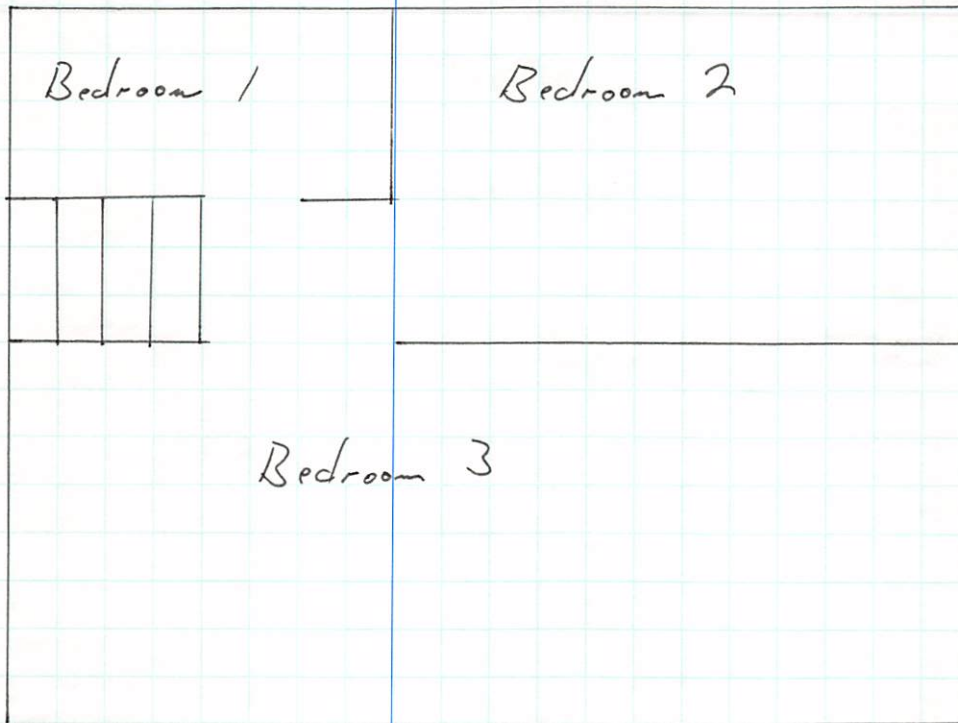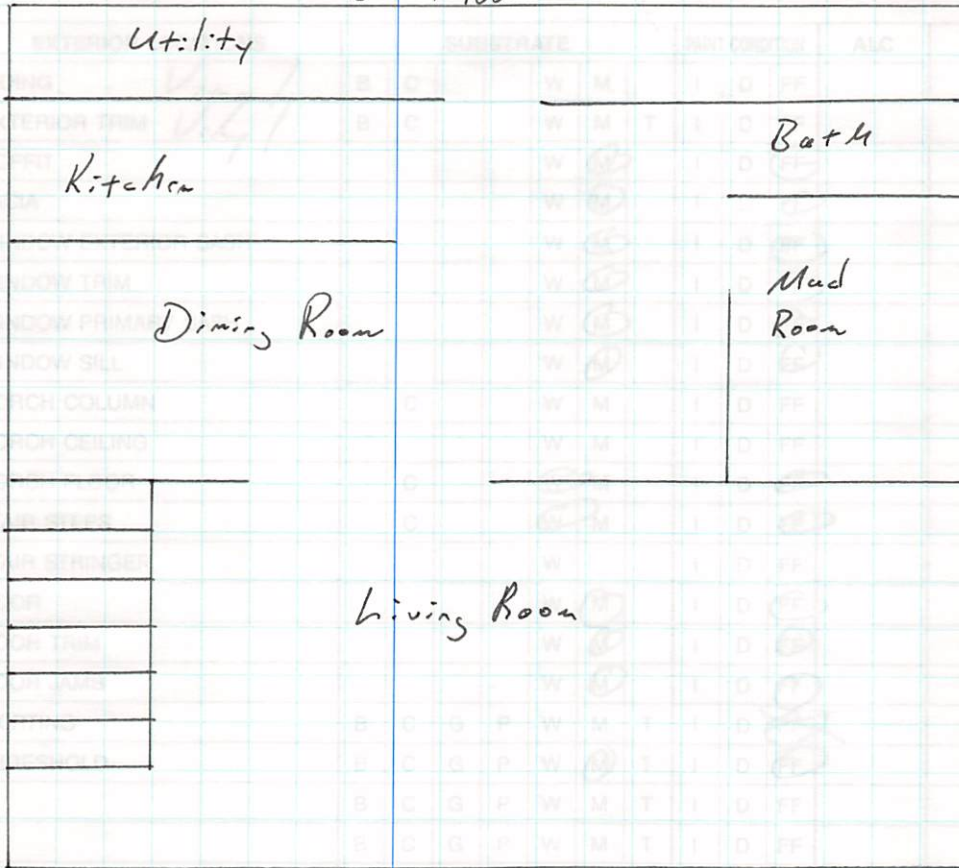

UNIT ADDRESS 207 Lawrence # \_\_\_\_\_ REPORT # \_\_\_\_\_

EXTERIOR LOCATIONS	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING <i>Viny /</i>	B	C			W	M		I	D	FF				
EXTERIOR TRIM <i>Viny /</i>	B	C			W	M	T	I	D	FF				
SOFFIT					W	<del>M</del>		I	D	<del>FF</del>				
FACIA					W	<del>M</del>		I	D	<del>FF</del>				
WINDOW EXTERIOR SASH					W	<del>M</del>		I	D	<del>FF</del>				
WINDOW TRIM					W	<del>M</del>		I	D	<del>FF</del>				
WINDOW PRIMARY SASH					W	<del>M</del>		I	D	<del>FF</del>				
WINDOW SILL					W	<del>M</del>		I	D	<del>FF</del>				
PORCH COLUMN		C			W	M		I	D	FF				
PORCH CEILING					W	M		I	D	FF				
PORCH FLOOR		C			<del>W</del>	<del>M</del>		I	D	<del>FF</del>				
STAIR STEPS		C			<del>W</del>	<del>M</del>		I	D	<del>FF</del>				
STAIR STRINGER					W			I	D	FF				
DOOR					W	<del>M</del>		I	D	<del>FF</del>				
DOOR TRIM					W	<del>M</del>		I	D	<del>FF</del>				
DOOR JAMB					W	<del>M</del>		I	D	<del>FF</del>				
SKIRTING	B	C	G	P	W	M	T	I	D	<del>FF</del>				
THRESHOLD	B	C	G	P	W	<del>M</del>	T	I	D	<del>FF</del>				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				



ROOM NAME Living Room

#

REPORT #

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W)	M	I	(D)	FF		0.0	
CEILING			G	(P)	W	M	(B)	D	FF	0.1	
DOOR				W	(M)	I	D	(E)			
DOOR TRIM				(W)	M	I	D	FF		0.2	
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	(P)	W	M	T	(P)	D	FF	0.0
WINDOW SASH				W	(M)	I	D	FF			
WINDOW TRIM				(W)	M	(I)	D	FF		19.3	
WINDOW SILL				(W)	M	(I)	D	FF		12.4	
FLOOR	(CP)		Vinyl	W		I	D	FF			
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME Dining Room

#

REPORT #

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W)	M	(I)	D	FF		0.0	
CEILING			G	(P)	W	M	(B)	D	FF	0.0	
DOOR				W	M	I	D	FF			
DOOR TRIM				(W)	M	I	(E)	FF		0.0	
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	(P)	W	M	T	(I)	D	FF	0.0
WINDOW SASH				W	(M)	I	D	(FF)			
WINDOW TRIM				(W)	M	(I)	D	FF		19.4	
WINDOW SILL				(W)	M	(I)	D	FF		11.3	
FLOOR	(CP)		Vinyl	W		I	D	FF			
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME Kitchen

#

REPORT #

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W)	M	I	(D)	FF		0.1	
CEILING			G	P	W	M	I	D	FF		
DOOR				(W)	M	I	(B)	FF		20.9	
DOOR TRIM				(W)	M	I	(D)	FF		0.3	
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	(E)	W	M	T	(I)	D	FF	
WINDOW SASH				W	(M)	I	D	(FF)			
WINDOW TRIM				(W)	M	I	(D)	FF		15.7	
WINDOW SILL				(W)	M	I	(D)	FF		12.2	
FLOOR	CP		Vinyl	W		I	D	FF			
<u>Cupboard</u>	B	C	G	P	(W)	M	T	I	(D)	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME Bath

# \_\_\_\_\_

REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF			0.0	
DOOR					W	M		I	D	FF			0.1	
DOOR TRIM					W	M		I	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF			0.0	
WINDOW SILL					W	M		I	D	FF			0.0	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Utility

# \_\_\_\_\_

REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.0	
CEILING			G	P	W	M		I	D	FF			0.1	
DOOR					W	M		I	D	FF			0.1	
DOOR TRIM					W	M		I	D	FF			0.1	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF			0.1	
WINDOW SILL					W	M		I	D	FF			0.0	
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Cabinet</u>	B	C	G	P	W	M	T	I	D	FF			0.0	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Stairway to 2nd Flr/Hall

# \_\_\_\_\_

REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.0	
CEILING			G	P	W	M		I	D	FF			0.2	
DOOR					W	M		I	D	FF			0.0	
DOOR TRIM					W	M		I	D	FF			0.1	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.1	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Stair</u>	B	C	G	P	W	M	T	I	D	FF			0.0	
<u>Riser</u>	B	C	G	P	W	M	T	I	D	FF			0.0	
<u>Stringer</u>	B	C	G	P	W	M	T	I	D	FF			0.0	

ROOM NAME Bedroom 1

# \_\_\_\_\_

REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.2	
CEILING			(G)	P	W	M		(I)	D	FF			0.0	
DOOR					(W)	M		(I)	D	FF			0.2	
DOOR TRIM					(W)	M		(I)	D	FF			0.2	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	(G)	P	W	M	T	(I)	D	FF			0.2	
WINDOW SASH					W	(M)		I	D	FF				
WINDOW TRIM					(W)	M		I	D	FF			0.0	
WINDOW SILL					(W)	M		I	D	FF			0.3	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 2

# \_\_\_\_\_

REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.1	
CEILING			(G)	P	W	M		(I)	D	FF			0.0	
DOOR					(W)	M		(I)	D	FF			0.2	
DOOR TRIM					(W)	M		(I)	D	FF			0.0	
SHELF					(W)	M		(I)	D	FF				
SHELF SUPPORT					(W)	M		(I)	D	FF			0.1	
WALL	B	C	(G)	P	W	M	T	I	D	FF				
WINDOW SASH					W	(M)		I	D	(FF)				
WINDOW TRIM					(W)	M		(I)	D	FF			0.0	
WINDOW SILL					(W)	M		(I)	D	FF			3.5	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 3

# \_\_\_\_\_

REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.3	
CEILING			(G)	P	W	M		(I)	D	FF			0.6	
DOOR					(W)	M		(I)	D	FF			0.0	
DOOR TRIM					(W)	M		(I)	D	FF			0.3	
SHELF					(W)	M		(I)	D	FF			0.1	
SHELF SUPPORT					(W)	M		(I)	D	FF			0.1	
WALL	B	C	(G)	P	W	M	T	(I)	D	FF			0.6	
WINDOW SASH					W	(M)		I	D	(FF)				
WINDOW TRIM					(W)	M		(I)	D	FF			0.0	
WINDOW SILL					(W)	M		(I)	D	FF			0.3	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Mud Room # \_\_\_\_\_ REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF			0.1	
DOOR					W	M		I	D	FF			0.0	
DOOR TRIM					W	M		I	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL <u>Slate</u>	B	C	G	P	W	M	T	①	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	②	FF			0.0	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Basement # \_\_\_\_\_ REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	③	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Stair</u>	B	C	G	P	W	M	T	<del>I</del>	④	FF			0.0	
<u>Stringer</u>	B	C	G	P	W	M	T	I	④	FF			0.0	
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME \_\_\_\_\_ # \_\_\_\_\_ REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				