

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 10

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 414 McKelvey
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-26-93

Substrate:

B - Brick
C - Concrete
 G - Gypsum
 P - Plaster
 W - Wood
 M - Metal
T - Tile
CP - Carpet

Paint Condition:


I - intact
 D - defective (peeling, cracked, loose)
 FF - factory finish

Comments: Exterior Positive: Window Exterior Sash, Trim

This testing was accomplished utilizing: A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
 A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope


SIGNATURES
[Signature] _____
Technician/Inspector Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated

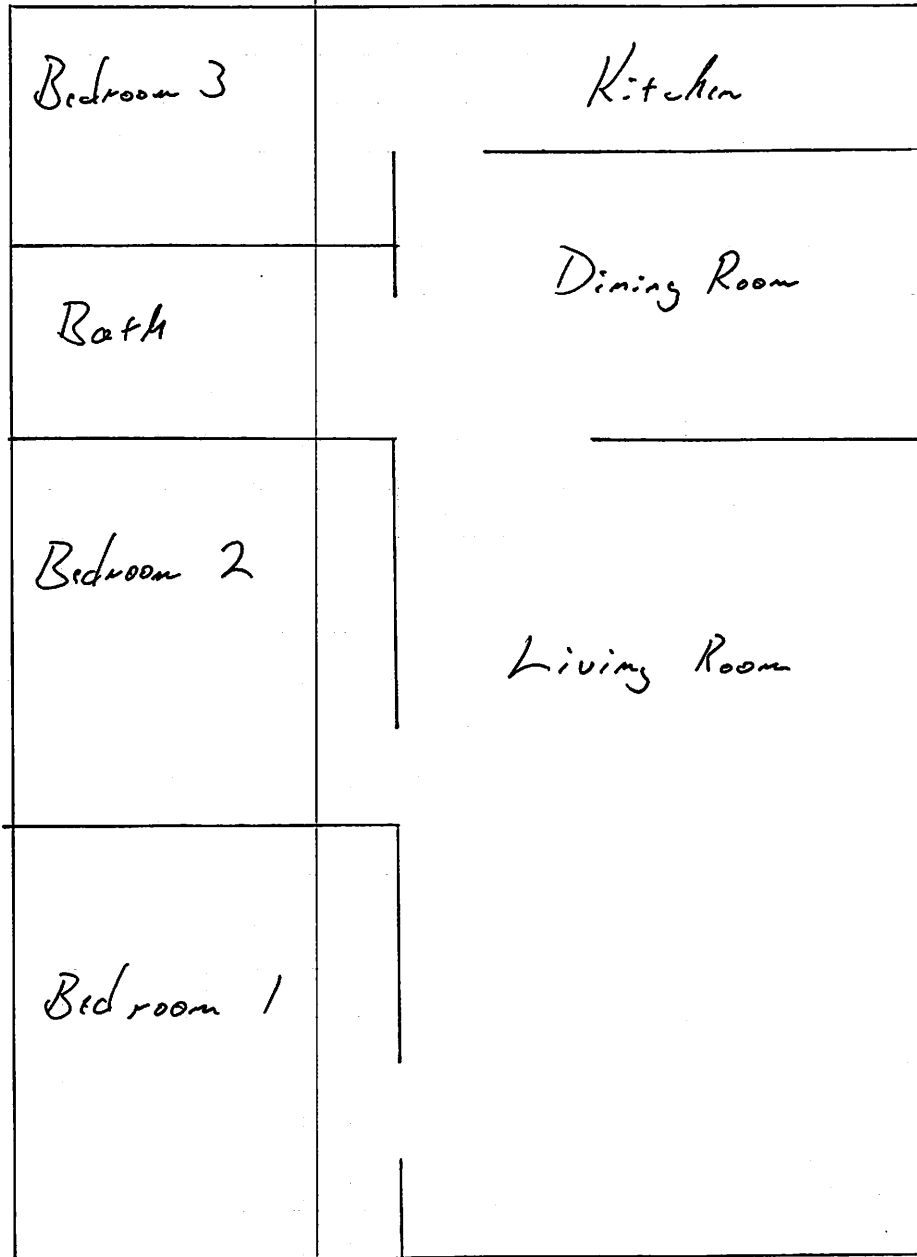

UNIT ADDRESS 414 McKelvey # _____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
SIDING	B	C			(W)	M		I	(D)	FF		0.0
EXTERIOR TRIM	B	C			(W)	M	T	I	(D)	FF		0.1
SOFFIT					(W)	M		I	(D)	FF		0.0
FACIA					(W)	M		I	(D)	FF		0.2
WINDOW EXTERIOR SASH					(W)	M		I	(D)	FF		3.2
WINDOW TRIM					(W)	M		I	(D)	FF		8.2
WINDOW PRIMARY SASH					W	(M)		I	D	(FF)		
WINDOW SILL					(W)	M		I	D	FF		0.0
PORCH COLUMN		C			W	M		I	D	FF		
PORCH CEILING					W	M		I	D	FF		
PORCH FLOOR		(C)			W	M		I	D	FF		
STAIR STEPS		C			W	M		I	D	FF		
STAIR STRINGER					W			I	D	FF		
DOOR					W	M		I	D	FF		
DOOR TRIM					W	M		I	D	FF		
DOOR JAMB					W	M		I	D	FF		
SKIRTING	B	C	G	P	W	M	T	I	D	FF		
THRESHOLD	B	C	G	P	(W)	M	T	I	(D)	FF		2.4
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		

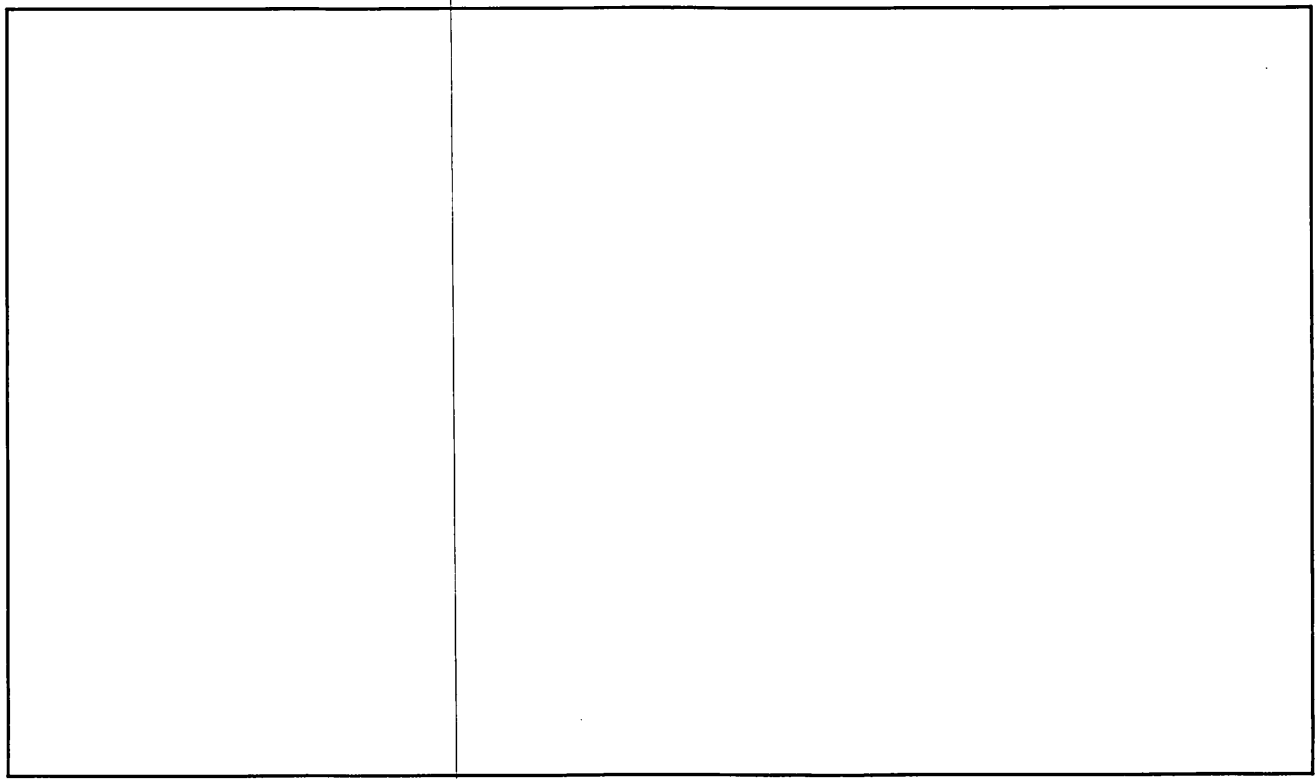

ROOM NAME Living Room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	(W)	M	(D)	D	FF				0.1		
CEILING			G	(P)	W	M	(D)	D	FF				0.0		
DOOR					(W)	M	I	D	FF						
DOOR TRIM					(W)	M	I	D	FF						
SHELF					W	M	I	D	FF						
SHELF SUPPORT					W	M	I	D	FF						
WALL	B	C	G	(P)	W	M	T	(D)	D	FF				0.2	
WINDOW SASH					(W)	M	I	(D)	FF				0.1		
WINDOW TRIM					(W)	M	I	(D)	FF				0.0		
WINDOW SILL					(W)	M	I	(D)	FF				0.2		
FLOOR	(CP)			Vinyl	W		I	D	FF						
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					

ROOM NAME Bedroom 1 # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	(W)	M	(D)	D	FF				0.2		
CEILING			G	(P)	W	M	(D)	D	FF				0.0		
DOOR					(W)	M	I	D	(EE)						
DOOR TRIM					(W)	M	(D)	D	FF				0.0		
SHELF					W	M	I	D	FF						
SHELF SUPPORT					W	M	I	D	FF						
WALL	B	C	G	(P)	W	M	T	(D)	D	FF				0.2	
WINDOW SASH					(W)	M	I	(D)	FF				0.0		
WINDOW TRIM					(W)	M	I	(D)	FF				0.0		
WINDOW SILL					(W)	M	I	(D)	FF				0.0		
FLOOR	(CP)			Vinyl	W		I	D	FF						
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					

ROOM NAME Dining Room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	(W)	M	(D)	D	FF				0.2		
CEILING			G	(P)	W	M	(D)	D	FF				0.1		
DOOR					W	M	I	D	FF						
DOOR TRIM					(W)	M	(D)	D	FF				0.0		
SHELF					W	M	I	D	FF						
SHELF SUPPORT					W	M	I	D	FF						
WALL	B	C	G	(P)	W	M	T	(D)	D	FF				0.1	
WINDOW SASH					(W)	M	(D)	D	FF				0.0		
WINDOW TRIM					(W)	M	(D)	D	FF				0.0		
WINDOW SILL					(W)	M	(D)	D	FF				0.1		
FLOOR	(CP)			Vinyl	W		I	D	FF						
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					
	B	C	G	P	W	M	T	I	D	FF					

ROOM NAME Bedroom 2

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.0	
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF			0.0	
DOOR TRIM					W	M		I	D	FF			0.1	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF			0.0	
WINDOW TRIM					W	M		I	D	FF			0.0	
WINDOW SILL					W	M		I	D	FF			0.2	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Kitchen

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.1	
CEILING <u>Tile</u>			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF			0.0	
DOOR TRIM					W	M		I	D	FF			0.2	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.1	
WINDOW SASH					W	M		I	D	FF			0.0	
WINDOW TRIM					W	M		I	D	FF			0.0	
WINDOW SILL					W	M		I	D	FF			0.2	
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Cupboard</u>	B	C	G	P	W	M	T	I	D	FF			0.2	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bath

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.0	
CEILING			G	P	W	M		I	D	FF			0.1	
DOOR					W	M		I	D	FF			0.2	
DOOR TRIM					W	M		I	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF			0.1	
WINDOW TRIM					W	M		I	D	FF			0.2	
WINDOW SILL					W	M		I	D	FF			0.0	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Basement / Stairway # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF				
CEILING			G	P	W	M	I	D	FF			
DOOR				W	M	I	D	FF				
DOOR TRIM				W	M	I	D	FF				
SHELF				W	M	I	D	FF				
SHELF SUPPORT				W	M	I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF		
WINDOW SASH				W	M	I	D	FF				
WINDOW TRIM				W	M	I	D	FF				
WINDOW SILL				W	M	I	D	FF				
FLOOR	CP		Vinyl	W		I	D	FF				
<i>Wall Trim</i>	B	C	G	P	W	M	T	I	D	FF		0.3
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		

ROOM NAME Bedroom 3 # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF				
CEILING			G	P	W	M	I	D	FF			0.1
DOOR				W	M	I	D	FF				0.2
DOOR TRIM				W	M	I	D	FF				0.0
SHELF				W	M	I	D	FF				
SHELF SUPPORT				W	M	I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF		0.1
WINDOW SASH				W	M	I	D	FF				0.1
WINDOW TRIM				W	M	I	D	FF				6.2
WINDOW SILL				W	M	I	D	FF				3.8
FLOOR	CP		Vinyl	W		I	D	FF				
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		

ROOM NAME Hall # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF				0.1
CEILING			G	P	W	M	I	D	FF			0.2
DOOR				W	M	I	D	FF				0.0
DOOR TRIM				W	M	I	D	FF				0.0
SHELF				W	M	I	D	FF				
SHELF SUPPORT				W	M	I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF		0.2
WINDOW SASH				W	M	I	D	FF				0.1
WINDOW TRIM				W	M	I	D	FF				0.0
WINDOW SILL				W	M	I	D	FF				0.2
FLOOR	CP		Vinyl	W		I	D	FF				
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		