

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 22

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 1509 W. Monroe St.
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-27-93

Substrate:

B - Brick
C - Concrete
G - Gypsum
Ⓟ - Plaster
Ⓜ - Wood
Ⓜ - Metal
T - Tile
CP - Carpet

Paint Condition:

Ⓟ - intact
Ⓧ - defective (peeling, cracked, loose)
FF - factory finish

Comments:

Exterior Positives: Siding, Porch Ceiling, Door
Trim, Threshold

Interior Positive: Bedrooms 2+3 - Window Trim + Sill

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
 A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope



SIGNATURES

Technician/Inspector

Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated


1509 W. Monroe

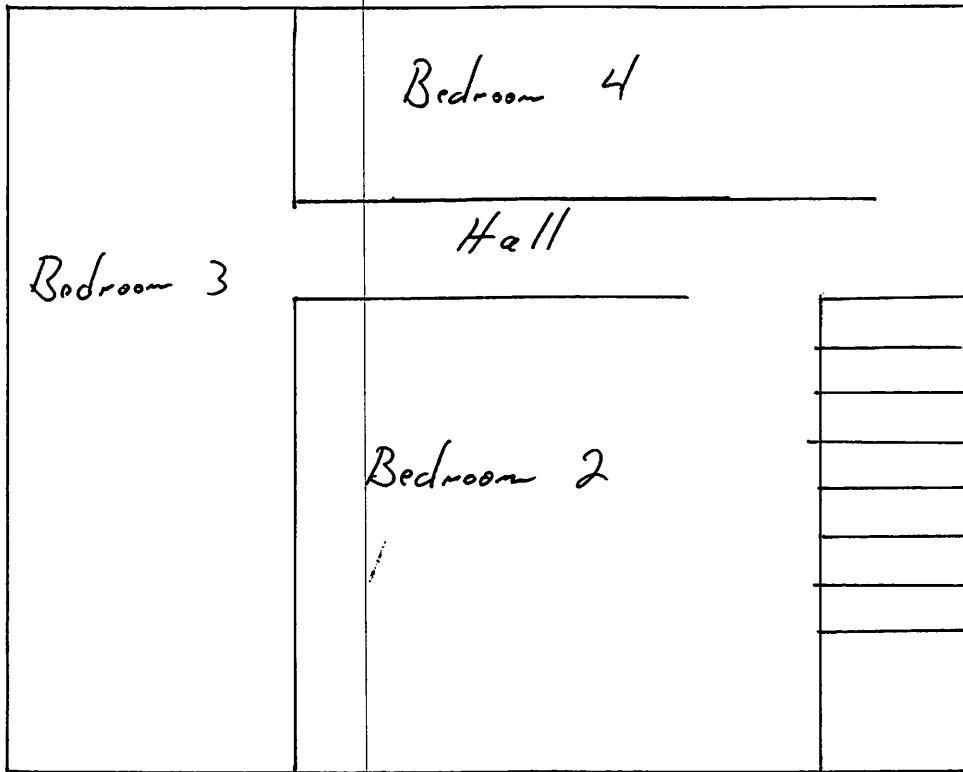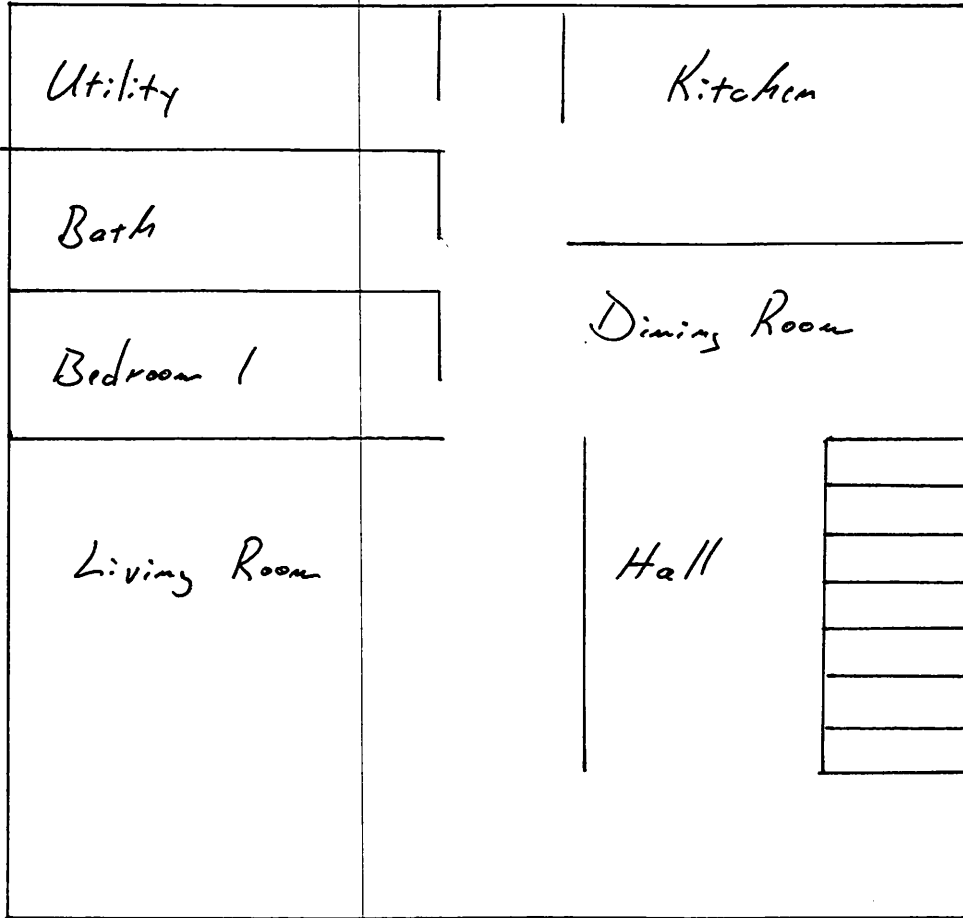

UNIT ADDRESS 1509 W. Meares

REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE						PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING <i>Slate</i>	B	C			W	M		I	ⓓ	FF			17.5
EXTERIOR TRIM	B	C			W	M	T	I	D	FF			
SOFFIT					Ⓜ	M		I	ⓓ	FF			0.2
FACIA					Ⓜ	M		I	ⓓ	FF			0.0
WINDOW EXTERIOR SASH					W	M		I	D	FF			
WINDOW TRIM					Ⓜ	M		I	ⓓ	FF			0.0
WINDOW PRIMARY SASH					W	M		I	D	FF			
WINDOW SILL					Ⓜ	M		I	ⓓ	FF			0.0
PORCH COLUMN		C			W	M		I	D	FF			
PORCH CEILING					Ⓜ	M		I	ⓓ	FF			7.1
PORCH FLOOR		C			W	M		I	D	FF			
STAIR STEPS		C			W	M		I	D	FF			
STAIR STRINGER					W			I	D	FF			
DOOR					W	Ⓜ		I	D	ⓕ			
DOOR TRIM					Ⓜ	M		I	ⓓ	FF			9.1
DOOR JAMB					Ⓜ	M		I	ⓓ	FF			3.7
SKIRTING	B	C	G	P	W	M	T	I	D	FF			
THRESHOLD	B	C	G	P	Ⓜ	M	T	I	ⓓ	FF			4.2
<i>Porch Trim</i>	B	C	G	P	Ⓜ	M	T	I	ⓓ	FF			0.0
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			



ROOM NAME Living Room # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	W	M	I	D	FF			0.0	
CEILING			G	P	W	M	I	D	FF			0.0	
DOOR					W	M	I	D	FF				
DOOR TRIM					W	M	I	D	FF			0.2	
SHELF					W	M	I	D	FF				
SHELF SUPPORT					W	M	I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF		0.0	
WINDOW SASH					W	M	I	D	FF				
WINDOW TRIM					W	M	I	D	FF			0.2	
WINDOW SILL					W	M	I	D	FF			0.0	
FLOOR	CP			Vinyl	W		I	D	FF				
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			

ROOM NAME Dining Room # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	W	M	I	D	FF			0.1	
CEILING			G	P	W	M	I	D	FF			0.0	
DOOR					W	M	I	D	FF			0.0	
DOOR TRIM					W	M	I	D	FF			0.0	
SHELF					W	M	I	D	FF				
SHELF SUPPORT					W	M	I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF		0.0	
WINDOW SASH					W	M	I	D	FF				
WINDOW TRIM					W	M	I	D	FF			0.2	
WINDOW SILL					W	M	I	D	FF			0.2	
FLOOR	CP			Vinyl	W		I	D	FF				
Hutch	B	C	G	P	W	M	T	I	D	FF		0.2	
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			

ROOM NAME Bedroom 1 # N/A REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	W	M	I	D	FF				
CEILING			G	P	W	M	I	D	FF				
DOOR					W	M	I	D	FF				
DOOR TRIM					W	M	I	D	FF				
SHELF					W	M	I	D	FF				
SHELF SUPPORT					W	M	I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			
WINDOW SASH					W	M	I	D	FF				
WINDOW TRIM					W	M	I	D	FF				
WINDOW SILL					W	M	I	D	FF				
FLOOR	CP			Vinyl	W		I	D	FF				
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			

ROOM NAME Bath # _____ REPORT # _____

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD			Vinyl	W	M	I	D	FF			
CEILING			G	P	W	M	D	FF		0.0	
DOOR				W	M	I	D	FF		0.0	
DOOR TRIM				W	M	I	D	FF		0.2	
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	P	W	M	T	D	FF	0.1	
WINDOW SASH				W	M	I	D	FF			
WINDOW TRIM				W	M	I	D	FF		0.2	
WINDOW SILL				W	M	I	D	FF		0.0	
FLOOR	CP		Vinyl	W		I	D	FF			
Cabinet	B	C	G	P	W	M	T	D	FF	0.0	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME Kitchen # _____ REPORT # _____

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD			Vinyl	W	M	I	D	FF			
CEILING			G	P	W	M	D	FF		0.0	
DOOR				W	M	D	D	FF		0.1	
DOOR TRIM				W	M	D	D	FF		0.0	
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	P	W	M	T	D	FF	0.0	
WINDOW SASH				W	M	I	D	FF			
WINDOW TRIM				W	M	D	D	FF		0.1	
WINDOW SILL				W	M	I	D	FF		0.1	
FLOOR	CP		Vinyl	W		I	D	FF			
Cupboard	B	C	G	P	W	M	T	D	FF		
Cabinet	B	C	G	P	W	M	T	D	FF	0.2	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME Utility Room # _____ REPORT # _____

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD			Vinyl	W	M	I	D	FF			
CEILING			G	P	W	M	D	FF		0.1	
DOOR				W	M	D	D	FF		0.0	
DOOR TRIM				W	M	D	D	FF		0.1	
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	P	W	M	T	D	FF	0.1	
WINDOW SASH				W	M	I	D	FF			
WINDOW TRIM				W	M	D	D	FF		0.0	
WINDOW SILL				W	M	D	D	FF		0.0	
FLOOR	CP		Vinyl	W		I	D	FF			
Cabinet	B	C	G	P	W	M	T	D	FF	0.0	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME Basement / Stairway # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF		
CEILING			G	(P)	W	M		I	D	FF		0.1
DOOR					W	(M)		I	D	(FF)		
DOOR TRIM					(W)	M		I	(D)	FF		0.0
SHELF					W	M		I	D	FF		
SHELF SUPPORT					W	M		I	D	FF		
WALL	(B)	C	G	P	W	M	T	(I)	D	FF		0.0
WINDOW SASH					W	(M)		I	D	(FF)		
WINDOW TRIM					(W)	M		(I)	D	FF		0.1
WINDOW SILL					(W)	M		(I)	D	FF		0.0
FLOOR	CP			Vinyl	W			I	D	FF		
<u>Wainscott</u>	B	C	G	P	(W)	M	T	I	(B)	FF		0.0
<u>Stair</u>	B	C	G	P	(W)	M	T	I	(D)	FF		0.1
	B	C	G	P	W	M	T	I	D	FF		

ROOM NAME Hall 1st Flr # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF		0.1
CEILING			G	(P)	W	M		(I)	D	FF		0.0
DOOR					(W)	M		I	D	(FF)		
DOOR TRIM					(W)	M		I	(D)	FF		0.1
SHELF					W	M		I	D	FF		
SHELF SUPPORT					W	M		I	D	FF		
WALL	B	C	G	(P)	W	M	T	(I)	D	FF		0.1
WINDOW SASH					W	M		I	D	FF		
WINDOW TRIM					W	M		I	D	FF		
WINDOW SILL					W	M		I	D	FF		
FLOOR	(CP)			Vinyl	W			I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		

ROOM NAME Stairway to 2nd Flr # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF		0.0
CEILING			G	(P)	W	M		(I)	D	FF		0.0
DOOR					W	M		I	D	FF		
DOOR TRIM					W	M		I	D	FF		
SHELF					W	M		I	D	FF		
SHELF SUPPORT					W	M		I	D	FF		
WALL	B	C	G	(P)	W	M	T	(I)	D	FF		0.1
WINDOW SASH					W	M		I	D	FF		
WINDOW TRIM					W	M		I	D	FF		
WINDOW SILL					W	M		I	D	FF		
FLOOR	CP			Vinyl	W			I	D	FF		
<u>Stairs</u>	B	C	G	P	(W)	M	T	I	D	(FF)		
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		

ROOM NAME Hall 2nd Flr

REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W) M	(D) D	FF				0.0	
CEILING			G (P)	W M	(D) D	FF				0.1	
DOOR				W M	I D	FF					
DOOR TRIM				W M	I D	FF					
SHELF				W M	I D	FF					
SHELF SUPPORT				W M	I D	FF					
WALL	B	C	G (P)	W M T	(D) D	FF				0.0	
WINDOW SASH				W M	I D	FF					
WINDOW TRIM				W M	I D	FF					
WINDOW SILL				W M	I D	FF					
FLOOR	(CP)		Vinyl	W	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					

ROOM NAME Bedroom 2

REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W) M	(D) D	FF				0.1	
CEILING			G (P)	W M	(D) D	FF				0.0	
DOOR				W M	I D	FF					
DOOR TRIM				W M	I D	FF					
SHELF				W (M)	I D	(FF)					
SHELF SUPPORT				W (M)	I D	(FF)					
WALL	B	C	G (P)	W M T	(D) D	FF				0.2	
WINDOW SASH				W (M)	I D	FF					
WINDOW TRIM				(W) M	(D) D	FF				8.4	
WINDOW SILL				(W) M	I D	FF				5.1	
FLOOR	(CP)		Vinyl	W	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					

ROOM NAME Bedroom 3

REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W) M	(D) D	FF				0.1	
CEILING			(G) (P)	W M	(D) D	FF				0.2	
DOOR				(W) M	(D) D	FF				0.1	
DOOR TRIM				(W) M	I D	(FF)				0.1	
SHELF				W (M)	I D	(FF)					
SHELF SUPPORT				W (M)	I D	(FF)					
WALL	B	C	(G) P	W M T	(D) D	FF				0.2	
WINDOW SASH				W (M)	I D	FF					
WINDOW TRIM				(W) M	I D	FF				2.5	
WINDOW SILL				(W) M	I D	FF				2.1	
FLOOR	(CP)		Vinyl	W	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					

ROOM NAME Bedroom 4 N/A # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME _____ # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME _____ # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				