

# W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)  
6960 S. 13th Street, P. O. Box 285  
Oak Creek, WI. 53154-0285  
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 26

## ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Erie Metropolitan Housing Authority  
STREET 322 Warren Street UNIT/ADDRESS 411 Nil  
CITY Sandusky, Ohio UNIT/LOCATION \_\_\_\_\_  
DATE 10-27-93

Substrate:

- B - Brick
- C - Concrete
- G - Gypsum
- P - Plaster
- W - Wood
- M - Metal
- T - Tile
- CP - Carpet

Paint Condition:

- I - intact
- D - defective (peeling, cracked, loose)
- FF - factory finish

Comments: Exterior Positive: Door Jamb  
Interior Positive: Living Room - Window Trim + Sill + Sash  
Dining Room - Window Trim + Sill Bedroom 1 - Window  
Trim + Sill Bath - Window Trim + Sill Bedroom 2 + 3 -  
Window Sash, Trim + Sill

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope  
A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope


SIGNATURES

\_\_\_\_\_  
Technician/Inspector


\_\_\_\_\_  
Agency Representative

\_\_\_\_\_ No indication of Lead Based Paint in this unit.  
\_\_\_\_\_ Paint samples taken for analysis  Lead indicated

411 Neil  
1st Floor

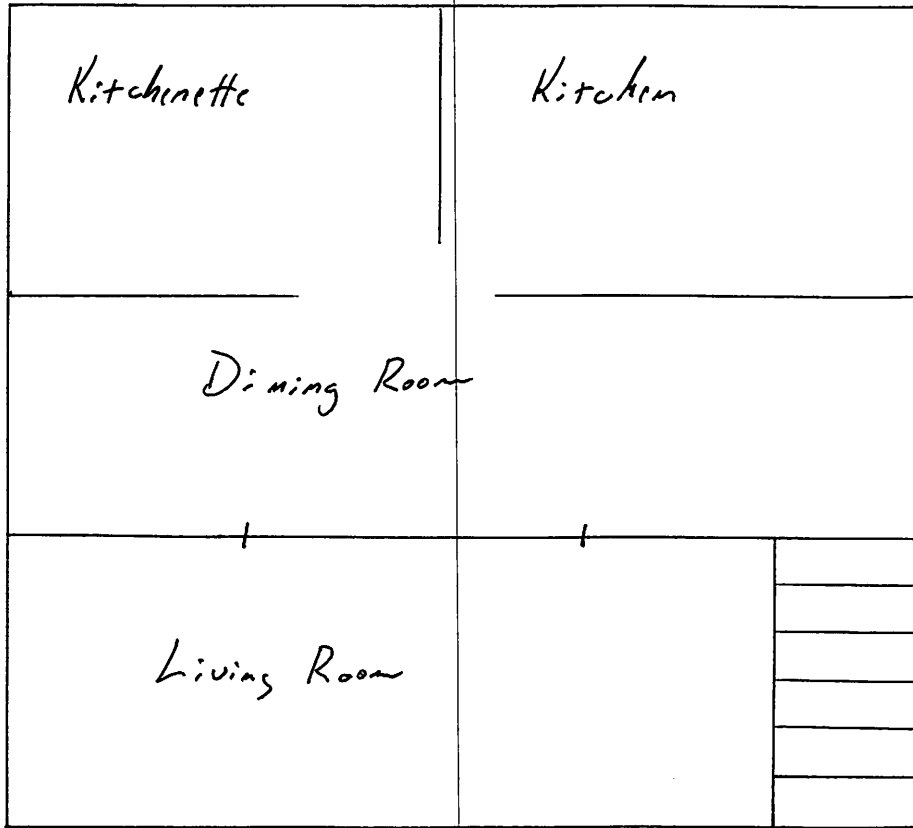


2nd Floor

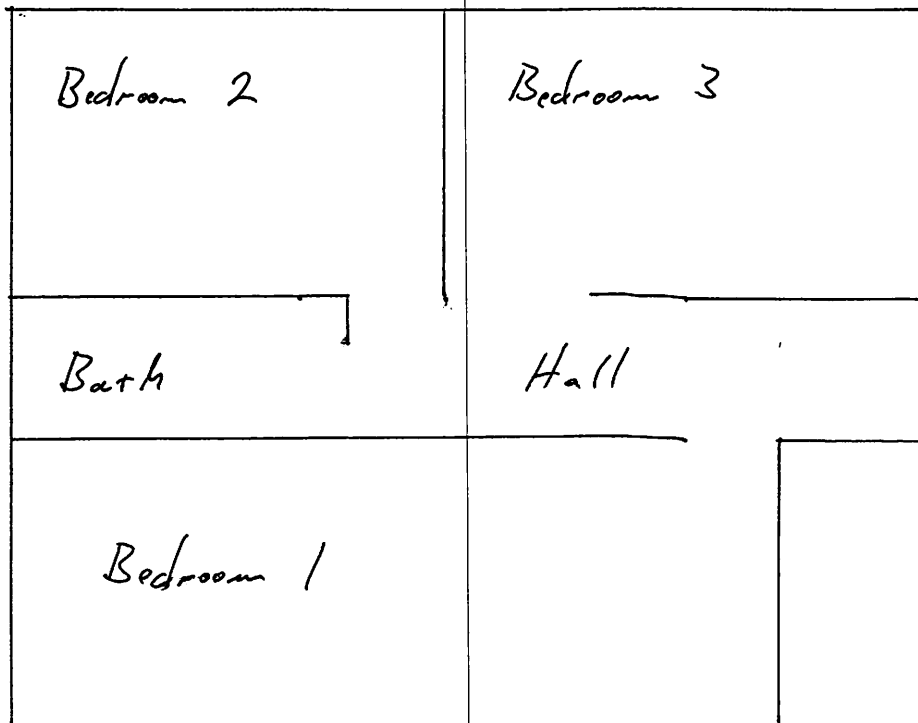

UNIT ADDRESS 411 Neil

# \_\_\_\_\_ REPORT # \_\_\_\_\_

EXTERIOR LOCATIONS	SUBSTRATE						PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING <i>Slatr</i>	B	C			W	M		(1)	D	FF			0.0
EXTERIOR TRIM	B	C			W	M	T	I	D	FF			
SOFFIT					W	M		I	D	FF			
FACIA					W	M		I	D	FF			
WINDOW EXTERIOR SASH					(W)	M		(P)	D	FF			0.0
WINDOW TRIM					(W)	M		(P)	D	FF			0.1
WINDOW PRIMARY SASH					(W)	M		(P)	D	FF			0.0
WINDOW SILL					(W)	M		(P)	D	FF			0.0
PORCH COLUMN		C			W	M		I	D	FF			
PORCH CEILING					(W)	M		(P)	D	FF			0.0
PORCH FLOOR		C			(W)	M		I	D	(FF)			
STAIR STEPS		(C)			W	M		I	D	FF			
STAIR STRINGER					W			I	D	FF			
DOOR					W	M		I	D	FF			
DOOR TRIM					W	M		I	D	FF			
DOOR JAMB					(W)	M		(P)	D	FF			19.2
SKIRTING	B	C	G	P	W	M	T	I	D	FF			
THRESHOLD	B	C	G	P	(W)	M	T	I	(D)	FF			0.0
<i>Porch Trim</i>	B	C	G	P	(W)	M	T	(P)	D	FF			0.0
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			



ROOM NAME Living Room

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF				
CEILING			G	(P)	W	M		(D)	D	FF			0.0	
DOOR					(W)	M		(D)	D	FF			0.2	
DOOR TRIM					(W)	M		(D)	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.1	
WINDOW SASH					(W)	M		(D)	D	FF			2.2	
WINDOW TRIM					(W)	M		(D)	D	FF			2.5	
WINDOW SILL					(W)	M		(D)	D	FF			2.3	
FLOOR	(CP)			Vinyl	W			I	D	FF				
Wall ledge	B	C	G	P	(W)	M	T	(D)	D	FF			0.0	
Columns	B	C	G	P	(W)	M	T	(D)	D	FF			0.0	
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Dining Room

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF			0.1	
CEILING			G	(P)	W	M		(D)	D	FF			0.0	
DOOR					(W)	M		(D)	D	FF			0.2	
DOOR TRIM					(W)	M		(D)	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.0	
WINDOW SASH					(W)	M		(D)	D	FF			0.0	
WINDOW TRIM					(W)	M		(D)	D	FF			2.6	
WINDOW SILL					(W)	M		(D)	D	FF			3.1	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Kitchen

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		(D)	D	FF			0.1	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	(D)	D	FF			0.0	
WINDOW SASH					(W)	M		(D)	D	FF			0.0	
WINDOW TRIM					(W)	M		(D)	D	FF			0.0	
WINDOW SILL					(W)	M		(D)	D	FF			0.0	
FLOOR	CP			Vinyl	W			I	D	FF				
Cupboard	B	C	G	P	(W)	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 1 # \_\_\_\_\_ REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W)	M			(I)	D	FF			0.0	
CEILING			(G) P	W	M			(I)	D	FF			0.0	
DOOR				(W)	M			I	D	(FF)				
DOOR TRIM				(W)	M			(I)	D	FF			0.1	
SHELF				(W)	M			(I)	D	FF			0.0	
SHELF SUPPORT				(W)	M			(I)	D	FF			0.0	
WALL	B	C	(G) P	W	M	T		(I)	D	FF			0.0	
WINDOW SASH				(W)	M			(I)	D	FF			0.1	
WINDOW TRIM				(W)	M			(I)	D	FF			2.3	
WINDOW SILL				(W)	M			(I)	D	FF			2.7	
FLOOR	(CP)		Vinyl	W				I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bath # \_\_\_\_\_ REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M			I	D	FF				
CEILING			(S) P	W	M			(I)	D	FF			0.0	
DOOR				(W)	M			I	D	(FF)				
DOOR TRIM				(W)	M			(I)	D	FF			0.1	
SHELF				W	M			I	D	FF				
SHELF SUPPORT				W	M			I	D	FF				
WALL	B	C	(G) P	W	M	T		(I)	D	FF			0.0	
WINDOW SASH				(W)	M			(I)	D	FF			0.2	
WINDOW TRIM				(W)	M			I	(D)	FF			2.8	
WINDOW SILL				(W)	M			(I)	D	FF			3.7	
FLOOR	CP		Vinyl	W				I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 2 # \_\_\_\_\_ REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W)	M			I	(D)	FF				
CEILING			(G) P	W	M			(I)	D	FF			0.0	
DOOR				W	M			I	D	FF				
DOOR TRIM				(W)	M			(I)	D	FF			0.2	
SHELF				W	M			I	D	FF				
SHELF SUPPORT				W	M			I	D	FF				
WALL	B	C	(G) P	W	M	T		(I)	D	FF			0.1	
WINDOW SASH				(W)	M			(I)	D	FF			2.8	
WINDOW TRIM				(W)	M			(I)	D	FF			3.1	
WINDOW SILL				(W)	M			(I)	D	FF			2.7	
FLOOR	(CP)		Vinyl	W				I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Kitchenette

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING				G	P	W	M	I	D	FF			0.1	
DOOR					W	M		I	D	FF			0.0	
DOOR TRIM					W	M		I	D	FF			0.2	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF			0.0	
WINDOW TRIM					W	M		I	D	FF			0.2	
WINDOW SILL					W	M		I	D	FF			0.1	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Stairway to 2nd Flr

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING				G	P	W	M	I	D	FF			0.0	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.1	
WINDOW SASH					W	M		I	D	FF			0.0	
WINDOW TRIM					W	M		I	D	FF			0.0	
WINDOW SILL					W	M		I	D	FF			0.0	
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Stripes</u>	B	C	G	P	W	M	T	I	D	FF			0.0	
<u>Railing</u>	B	C	G	P	W	M	T	I	D	FF			0.0	
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Hall

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.0	
CEILING				G	P	W	M	I	D	FF			0.1	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Basement / Stair well # \_\_\_\_\_ REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF			0.1	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF			0.2	
Wall Cap	B	C	G	P	W	M	T	I	D	FF			0.0	
Basement Door	B	C	G	P	W	M	T	I	D	FF			3.3	
Stair	B	C	G	P	W	M	T	I	D	FF			0.2	
Railway													0.1	

ROOM NAME \_\_\_\_\_ # \_\_\_\_\_ REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME \_\_\_\_\_ # \_\_\_\_\_ REPORT # \_\_\_\_\_

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				