

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 6

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 605 W. Osborne
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-25-93

Substrate:

B - Brick
C - Concrete
G - Gypsum
 P - Plaster
 W - Wood
 M - Metal
T - Tile
CP - Carpet

Paint Condition:

Intact
 D - defective (peeling, cracked, loose)
 FF - factory finish


Comments: Exterior Positive: Porch Column, Porch Ceiling
Beam,

Interior Positive: Bath - Door Trim, Window Sash,
Window Sill Pantry - Window Sash, Trim + Sill
Stairway - Baseboard, Window Sash, Trim + Sill
Bedrooms 2, 3 + 4 - Baseboard, Door, Door Trim, Window
Sash, Trim + Sill

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope

SIGNATURES


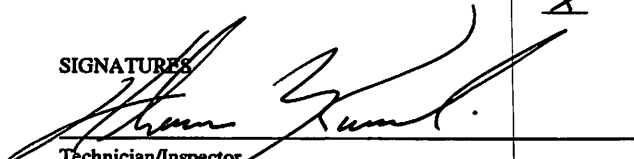


Technician/Inspector

Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated

605 Osborn.

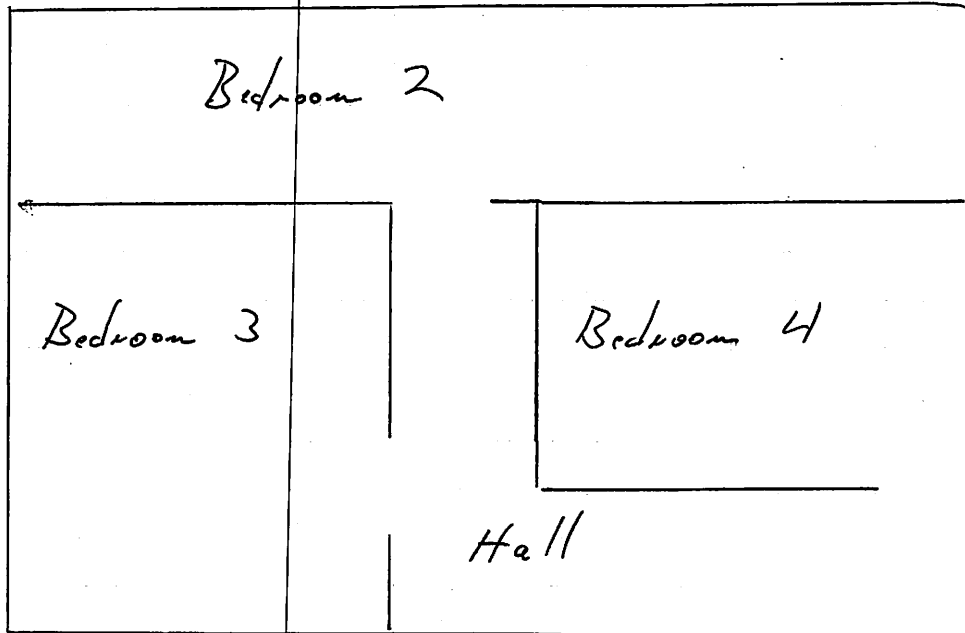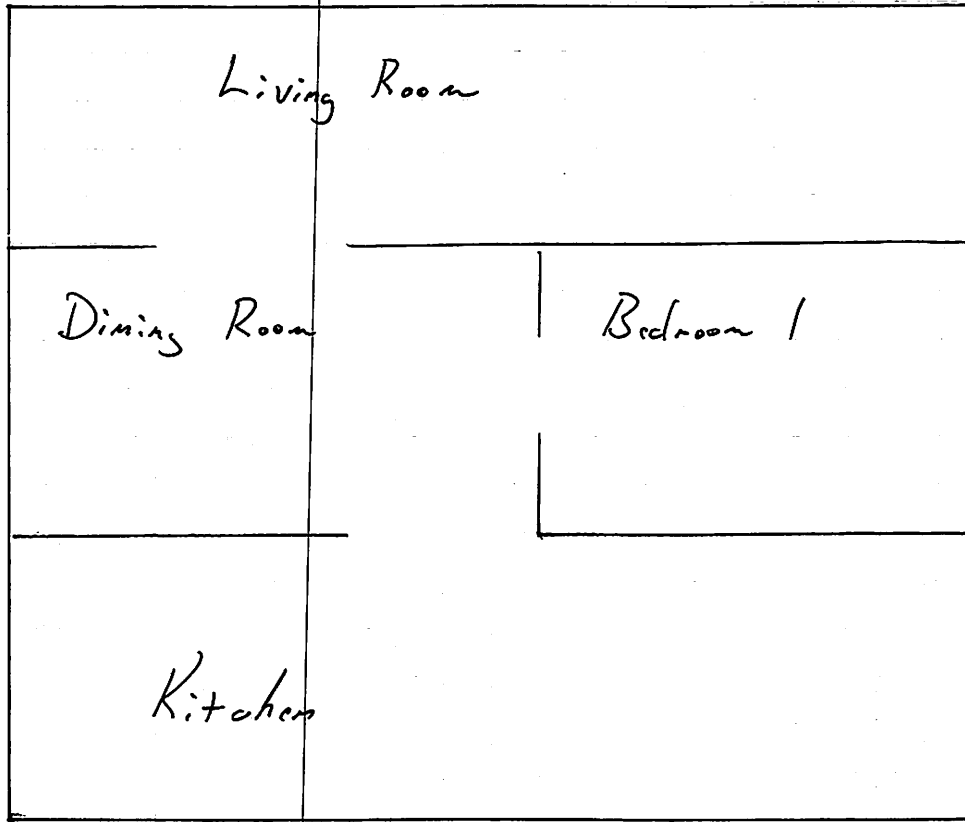

UNIT ADDRESS 605 W. Osborne

_____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
	B	C			W	M		I	D	FF				
SIDING <i>Vinyl</i>	B	C			W	M		I	D	FF				
EXTERIOR TRIM <i>Vinyl</i>	B	C			W	M	T	I	D	FF				
SOFFIT					W	M		I	D	FF				
FACIA					W	M		I	D	FF				
WINDOW EXTERIOR SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW PRIMARY SASH					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
PORCH COLUMN		C			W	M		I	D	FF			2.6	
PORCH CEILING <i>Brck</i>					W	M		I	D	FF			51.0	
PORCH FLOOR		C			W	M		I	D	FF			0.2	
STAIR STEPS		C			W	M		I	D	FF				
STAIR STRINGER					W			I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
DOOR JAMB					W	M		I	D	FF				
SKIRTING	B	C	G	P	W	M	T	I	D	FF				
THRESHOLD	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Living Room # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W) M	I	D	(FF)				
CEILING			G	(P) W M	(I)	D	FF			0.1	
DOOR				W (M)	I	D	(FF)				
DOOR TRIM				(W) M	I	D	(FF)				
SHELF				W M	I	D	FF				
SHELF SUPPORT				W M	I	D	FF				
WALL	B	C	G	P (W) M T	I	D	FF				
WINDOW SASH				(W) M	I	D	(FF)				
WINDOW TRIM				(W) M	I	D	(FF)				
WINDOW SILL				(W) M	I	D	(FF)				
FLOOR	(CP)		Vinyl	W	I	D	FF				
	B	C	G	P W M T	I	D	FF				
	B	C	G	P W M T	I	D	FF				
	B	C	G	P W M T	I	D	FF				

ROOM NAME Dining Room # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W) M	I	D	(FF)				
CEILING			G	(S) (W) M	I	D	(FF)				
DOOR				W M	I	D	FF				
DOOR TRIM				(W) M	I	D	(FF)				
SHELF				(W) M	I	D	(FF)				
SHELF SUPPORT				(W) M	I	D	(FF)				
WALL	B	C	G	P (W) M T	I	D	(FF)				
WINDOW SASH				(W) M	I	D	(FF)				
WINDOW TRIM				(W) M	I	D	(FF)				
WINDOW SILL				(W) M	I	D	(FF)				
FLOOR	(CP)		Vinyl	W	I	D	FF				
	B	C	G	P W M T	I	D	FF				
	B	C	G	P W M T	I	D	FF				
	B	C	G	P W M T	I	D	FF				

ROOM NAME Bedroom 1 # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W) M	I	D	(FF)				
CEILING			G	(P) W M	(I)	D	FF			0.1	
DOOR				(W) M	I	D	(FF)				
DOOR TRIM				(W) M	I	D	(FF)				
SHELF				W M	I	D	FF				
SHELF SUPPORT				W M	I	D	FF				
WALL	B	C	G	(P) W M T	(I)	D	FF			0.2	
WINDOW SASH				(W) M	I	D	(FF)				
WINDOW TRIM				(W) M	I	D	(FF)				
WINDOW SILL				(W) M	I	D	(FF)				
FLOOR	(CP)		Vinyl	W	I	D	FF				
	B	C	G	P W M T	I	D	FF				
	B	C	G	P W M T	I	D	FF				
	B	C	G	P W M T	I	D	FF				

ROOM NAME Kitchen

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
								I	D	FF				
BASEBOARD				Vinyl	(W)	M		I	D	(FF)				
CEILING				G	(P)	W	M	(I)	D	FF			0.1	
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		I	D	(FF)				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL <u>Vinyl</u>	B	C	G	P	(W)	M	T	I	D	FF				
WINDOW SASH					(W)	M		(I)	D	FF			0.0	
WINDOW TRIM					(W)	M		(I)	D	FF			-0.1	
WINDOW SILL					(W)	M		(I)	D	FF			0.2	
FLOOR	CP			(Vinyl)	W			I	D	FF				
<u>Cupboard</u>	B	C	G	P	(W)	M	T	I	D	(FF)				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bath

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
								I	D	FF				
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING <u>T.16</u>				G	(P)	W	M	I	D	FF				
DOOR					(W)	M		(I)	D	FF			0.0	
DOOR TRIM					(W)	M		(I)	D	FF			10.1	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.2	
WINDOW SASH					(W)	M		I	(D)	FF			14.1	
WINDOW TRIM					(W)	M		I	(D)	FF				
WINDOW SILL					(W)	M		I	(D)	FF			12.1	
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Cabinet</u>	B	C	G	P	(W)	M	T	I	(D)	FF			0.0	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Pantry

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
								I	D	FF				
BASEBOARD				Vinyl	(W)	M		I	D	(FF)				
CEILING				G	(P)	W	M	(I)	D	FF			0.1	
DOOR					W	(M)		I	D	(FF)				
DOOR TRIM					(W)	M		I	D	(FF)				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.1	
WINDOW SASH					(W)	M		(I)	D	FF			9.2	
WINDOW TRIM					(W)	M		(I)	D	FF			13.1	
WINDOW SILL					(W)	M		(I)	D	FF			13.7	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Stairway to 2nd Flr. # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W) M	(D) D	FF				11.0	
CEILING			G (P)	W M	(D) D	FF				0.0	
DOOR				W M	I D	FF					
DOOR TRIM				W M	I D	FF					
SHELF				W M	I D	FF					
SHELF SUPPORT				W M	I D	FF					
WALL	B	C	G (P)	W M T	(D) D	FF				0.2	
WINDOW SASH				(W) M	(D) D	FF				11.1	
WINDOW TRIM				(W) M	(D) D	FF				14.0	
WINDOW SILL				(W) M	(D) D	FF				5.3	
FLOOR	CP		Vinyl	W	I D	FF					
Stairs CP	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					

ROOM NAME Bedroom 2 # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W) M	(D) D	FF				11.8	
CEILING			G (P)	W M	(D) D	FF				0.0	
DOOR				(W) M	(D) D	FF				12.2	
DOOR TRIM				(W) M	(D) D	FF				16.1	
SHELF				W M	I D	FF					
SHELF SUPPORT				W M	I D	FF					
WALL	B	C	G (P)	W M T	(D) D	FF				0.0	
WINDOW SASH				(W) M	I (D) D	FF				9.7	
WINDOW TRIM				(W) M	(D) D	FF				11.2	
WINDOW SILL				(W) M	(D) D	FF				13.8	
FLOOR	(CP)		Vinyl	W	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					

ROOM NAME Bedroom 3 # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W) M	(D) D	FF				8.3	
CEILING			G (P)	W M	(D) D	FF				0.0	
DOOR				(W) M	(D) D	FF				7.7	
DOOR TRIM				(W) M	I (D) D	FF				9.1	
SHELF				W M	I D	FF					
SHELF SUPPORT				(W) M	(D) D	FF				10.4	
WALL	B	C	G (P)	W M T	(D) D	FF				0.0	
WINDOW SASH				(W) M	(D) D	FF				2.9	
WINDOW TRIM				(W) M	(D) D	FF				8.0	
WINDOW SILL				(W) M	(D) D	FF				2.7	
FLOOR	(CP)		Vinyl	W	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					
	B	C	G P	W M T	I D	FF					

ROOM NAME Bedroom 4 # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	(W)	M	(D)	D	FF			9.1
CEILING			G	(P)	W	M	(D)	D	FF		0.0
DOOR				(W)	M	(D)	D	FF			14.1
DOOR TRIM				(W)	M	(T)	D	FF			15.6
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	(P)	(W)	M	T	(D)	D	FF	0.0
WINDOW SASH				(W)	M	(D)	D	FF			5.3
WINDOW TRIM				(W)	M	(D)	D	FF			14.1
WINDOW SILL				(W)	M	(D)	D	FF			11.7
FLOOR	(CP)		Vinyl	W		I	D	FF			
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME Basement # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF			
CEILING			G	P	W	M	I	D	FF		
DOOR				(W)	M	I	D	(P)			0.1
DOOR TRIM				(W)	M	I	D	(P)			0.0
SHELF				(W)	M	I	(D)	FF			0.1
SHELF SUPPORT				(W)	M	I	(D)	FF			0.2
WALL	B	(C)	G	P	W	M	T	I	(D)	FF	0.0
WINDOW SASH				W	M	I	D	FF			
WINDOW TRIM				W	M	I	D	FF			
WINDOW SILL				W	M	I	D	FF			
FLOOR	CP		Vinyl	W		I	D	FF			
<u>Stair</u>	B	C	G	P	(W)	M	T	I	(D)	FF	0.1
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME _____ # _____ REPORT # _____

COMPONENT	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF			
CEILING			G	P	W	M	I	D	FF		
DOOR				W	M	I	D	FF			
DOOR TRIM				W	M	I	D	FF			
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	P	W	M	T	I	D	FF	
WINDOW SASH				W	M	I	D	FF			
WINDOW TRIM				W	M	I	D	FF			
WINDOW SILL				W	M	I	D	FF			
FLOOR	CP		Vinyl	W		I	D	FF			
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	
	B	C	G	P	W	M	T	I	D	FF	