

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 20

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Erie Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 222 Perry
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-27-93

Substrate:

- B - Brick
- C - Concrete
- G - Gypsum
- P - Plaster
- W - Wood
- M - Metal
- T - Tile
- CP - Carpet

Paint Condition:

- I - intact
- D - defective (peeling, cracked, loose)
- F - factory finish

Comments: Interior Positive: Bath - Door, Door Trim Bedroom 2 -
Window Trim + Sill Stairway - Window Sash, Trim +
Sill Bedroom 3 - Window Sash, Trim + Sill
Basement Stairway - Ceiling, Wall

This testing was accomplished utilizing: A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
 A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope

SIGNATURES

[Signature]



Technician/Inspector

Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated

222 Perry

1st Floor

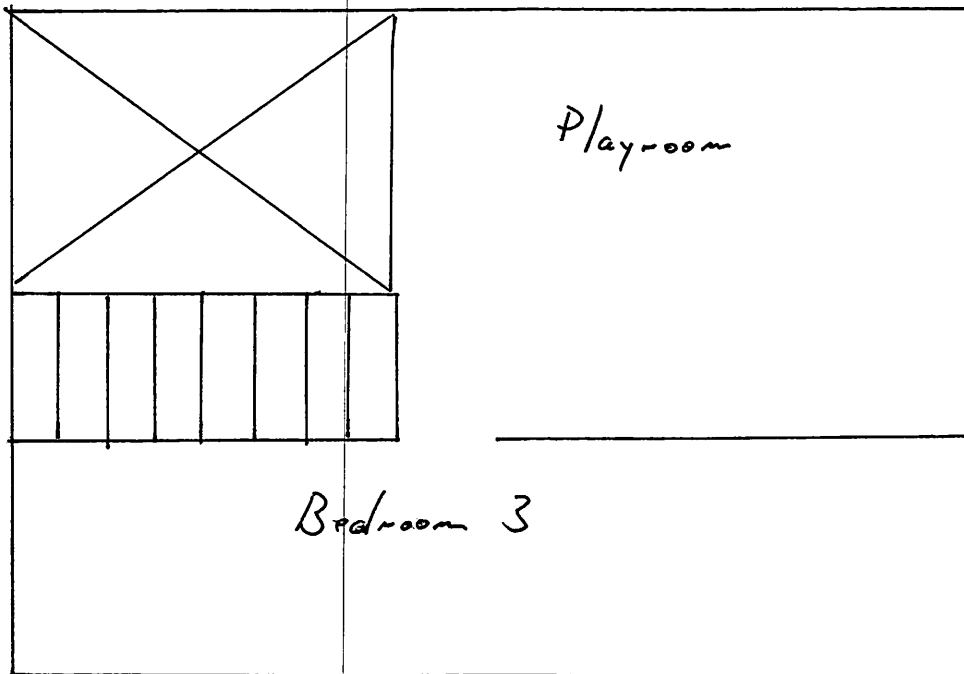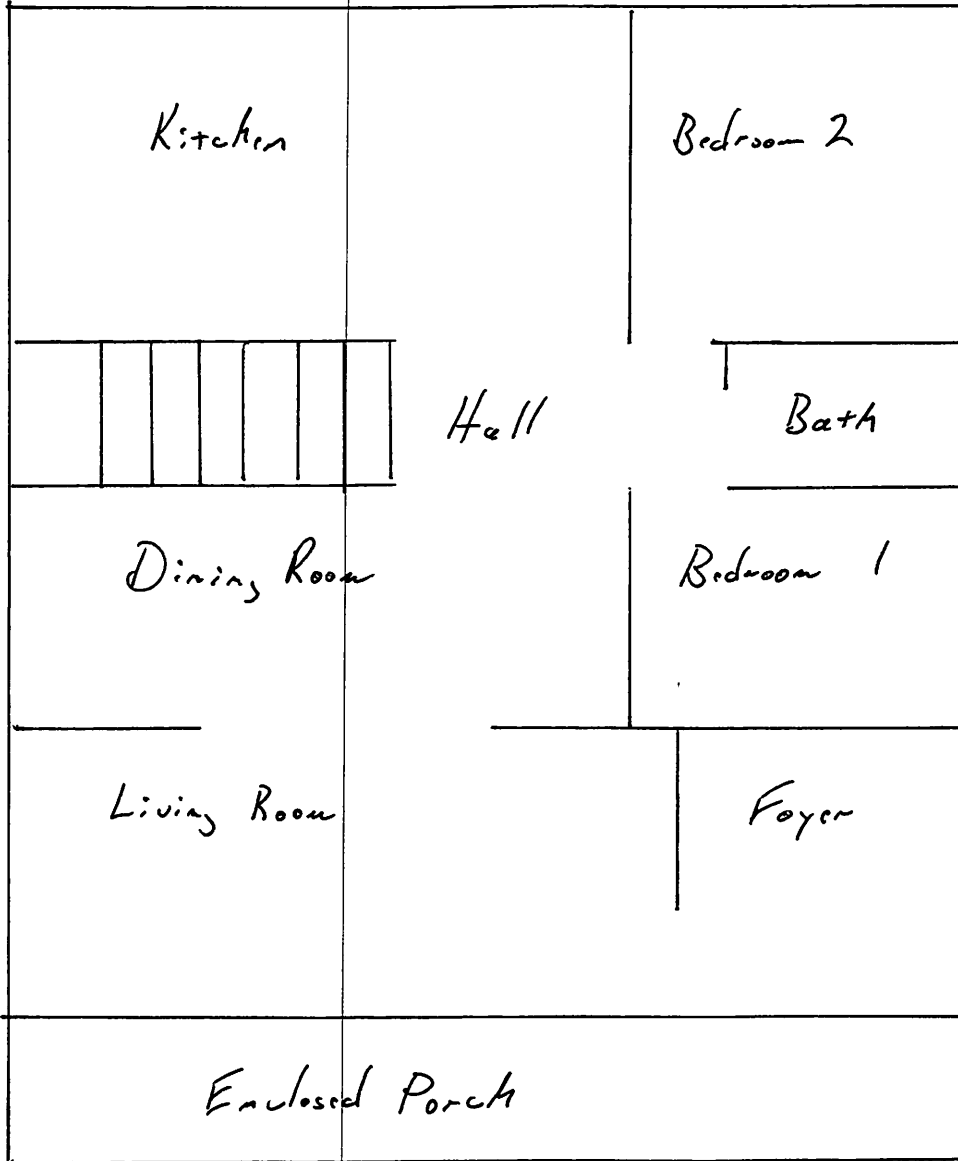

UNIT ADDRESS 222 Perry

REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE							PAINT CONDITION		ALC	SEL	CLC	(NOTES)
	B	C			W	M	T	I	D				
SIDING	B	C			W	M		I	D	FF		0.0	
EXTERIOR TRIM	B	C			W	M	T	I	D	FF		0.0	
SOFFIT					W	M		I	D	FF		0.2	
FACIA					W	M		I	D	FF		0.0	
WINDOW EXTERIOR SASH					W	M		I	D	FF			
WINDOW TRIM					W	M		I	D	FF		0.1	
WINDOW PRIMARY SASH					W	M		I	D	FF			
WINDOW SILL					W	M		I	D	FF		0.0	
PORCH COLUMN		C			W	M		I	D	FF			
PORCH CEILING					W	M		I	D	FF			
PORCH FLOOR		C			W	M		I	D	FF			
STAIR STEPS		C			W	M		I	D	FF			
STAIR STRINGER					W			I	D	FF			
DOOR					W	M		I	D	FF			
DOOR TRIM					W	M		I	D	FF		0.3	
DOOR JAMB					W	M		I	D	FF		0.0	
SKIRTING	B	C	G	P	W	M	T	I	D	FF		0.0	
THRESHOLD	B	C	G	P	W	M	T	I	D	FF		0.2	
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			

UNIT ADDRESS 222 Perry Garage

_____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE						PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING	B	C			(W)	M		I	(D)	FF			0.0
EXTERIOR TRIM	B	C			(W)	M	T	I	(D)	FF			0.2
SOFFIT					W	M		I	D	FF			
FACIA					W	M		I	D	FF			
WINDOW EXTERIOR SASH					W	M		I	D	FF			
WINDOW TRIM					W	M		I	D	FF			
WINDOW PRIMARY SASH					W	M		I	D	FF			
WINDOW SILL					W	M		I	D	FF			
PORCH COLUMN		C			W	M		I	D	FF			
PORCH CEILING					W	M		I	D	FF			
PORCH FLOOR		C			W	M		I	D	FF			
STAIR STEPS		C			W	M		I	D	FF			
STAIR STRINGER					W			I	D	FF			
DOOR <i>Overhead</i>					(W)	M		I	(D)	FF			0.1
DOOR TRIM					(W)	M		I	(D)	FF			0.1
DOOR JAMB					W	M		I	D	FF			
SKIRTING	B	C	G	P	W	M	T	I	D	FF			
THRESHOLD	B	C	G	P	W	M	T	I	D	FF			
<i>Side Door</i>	B	C	G	P	(W)	M	T	I	(D)	FF			0.0
<i>Door Trim</i>	B	C	G	P	(W)	M	T	I	(D)	FF			0.1
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			

ROOM NAME Enclosed Porch

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF			0.1	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF			0.2	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.2	
WINDOW SASH					W	M		I	D	FF			0.1	
WINDOW TRIM					W	M		I	D	FF			0.8	
WINDOW SILL					W	M		I	D	FF			0.3	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Foyer

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF			0.1	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF			0.1	
SHELF SUPPORT					W	M		I	D	FF			0.2	
WALL	B	C	G	P	W	M	T	I	D	FF			0.1	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR <u>Tile</u>	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Living Room

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF			0.1	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Dining Room

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M	I	D	(EP)					
CEILING			G	(P)	W	M	(I)	D	FF			0.0		
DOOR					W	M	I	D	FF					
DOOR TRIM					(W)	M	I	D	(FF)					
SHELF					W	M	I	D	FF					
SHELF SUPPORT					W	M	(I)	D	FF					
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.1	
WINDOW SASH					(W)	M	I	D	(FF)					
WINDOW TRIM					(W)	M	I	D	(FF)					
WINDOW SILL					(W)	M	I	D	(FF)					
FLOOR	(CP)			Vinyl	W		I	D	FF					
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Hall

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M	(I)	D	(FF)			0.1		
CEILING			G	(P)	W	M	(I)	D	FF			0.1		
DOOR					(W)	M	I	(D)	FF			0.1		
DOOR TRIM					(W)	M	I	(D)	(FF)			0.0		
SHELF					W	M	I	D	FF					
SHELF SUPPORT					W	M	I	D	FF					
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.0	
WINDOW SASH					(W)	M	I	D	(FF)					
WINDOW TRIM					(W)	M	I	D	(FF)					
WINDOW SILL					(W)	M	I	D	(FF)					
FLOOR	(CP)			Vinyl	W		I	D	FF					
<u>Cabinet</u>	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 1

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M	(I)	(D)	FF			0.1		
CEILING			G	(P)	W	M	(I)	D	FF			0.1		
DOOR					(W)	M	(I)	D	FF			0.1		
DOOR TRIM					(W)	M	(I)	D	FF			0.0		
SHELF					(W)	M	(I)	D	FF			0.1		
SHELF SUPPORT					(W)	M	(I)	D	FF			0.1		
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.1	
WINDOW SASH					(W)	M	I	(D)	FF			0.3		
WINDOW TRIM					(W)	M	I	(D)	FF			0.3		
WINDOW SILL					(W)	M	I	(D)	FF			0.3		
FLOOR	(CP)			Vinyl	W		I	D	FF					
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bath

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		①	D	FF			0.1	
DOOR					W	M		①	D	FF			2.7	
DOOR TRIM					W	M		①	D	FF			2.5	
SHELF					W	M		①	D	FF				
SHELF SUPPORT					W	M		①	D	FF				
WALL	B	C	G	P	W	M	T	①	D	FF			0.	
WINDOW SASH					W	M		①	D	FF				
WINDOW TRIM					W	M		①	D	FF				
WINDOW SILL					W	M		①	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 2

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		①	D	FF			0.1	
CEILING			G	P	W	M		①	D	FF			0.1	
DOOR					W	M		①	D	FF			0.2	
DOOR TRIM					W	M		①	D	FF			0.1	
SHELF					W	M		①	D	FF			0.0	
SHELF SUPPORT					W	M		①	D	FF			0.1	
WALL	B	C	G	P	W	M	T	①	D	FF			0.	
WINDOW SASH					W	M		①	D	FF			0.3	
WINDOW TRIM					W	M		①	D	FF			2.6	
WINDOW SILL					W	M		①	D	FF			3.1	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Kitchen

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		①	D	FF			0.1	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		①	D	FF			0.2	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	①	D	FF			0.0	
WINDOW SASH					W	M		I	D	EP				
WINDOW TRIM					W	M		①	D	FF			0.1	
WINDOW SILL					W	M		①	D	FF			0.1	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Stairway to 2nd Fl # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.1	
CEILING			G	P	(W)	M		(I)	D	FF				
DOOR					(W)	M		(I)	D	FF			0.2	
DOOR TRIM					(W)	M		(I)	D	FF			0.0	
SHELF					(W)	M		(I)	D	FF				
SHELF SUPPORT					(W)	M		(I)	D	FF				
WALL	B	C	G	(P)	(W)	M	T	(I)	D	FF			0.3	
WINDOW SASH					(W)	M		(I)	(D)	FF			1.8	
WINDOW TRIM					(W)	M		(I)	(D)	FF			2.4	
WINDOW SILL					(W)	M		(I)	(D)	FF			1.7	
FLOOR	CP			Vinyl	(W)			(I)	D	FF				
<u>Wall Cap</u>	B	C	G	P	(W)	M	T	(I)	D	FF			0.3	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bed room 3 # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.1	
CEILING			G	P	(W)	M		(I)	D	FF			0.1	
DOOR					(W)	M		(I)	(D)	FF			0.2	
DOOR TRIM					(W)	M		(I)	(D)	FF			0.1	
SHELF					(W)	M		(I)	D	FF				
SHELF SUPPORT					(W)	M		(I)	D	FF				
WALL	B	C	G	P	(W)	M	T	(I)	D	FF			0.3 0.3	
WINDOW SASH					(W)	M		(I)	(D)	FF			3.0	
WINDOW TRIM					(W)	M		(I)	(D)	FF			3.1	
WINDOW SILL					(W)	M		(I)	(D)	FF			2.4	
FLOOR	CP			(Vinyl)	(W)			(I)	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Play room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	(W)	M		(I)	(D)	FF			0.1	
DOOR					(W)	M		(I)	D	FF				
DOOR TRIM					(W)	M		(I)	D	FF				
SHELF					(W)	M		(I)	D	FF				
SHELF SUPPORT					(W)	M		(I)	D	FF				
WALL	B	C	G	P	(W)	M	T	(I)	(D)	FF			0.1	
WINDOW SASH					(W)	M		(I)	D	FF			0.0	
WINDOW TRIM					(W)	M		(I)	D	FF			0.2	
WINDOW SILL					(W)	M		(I)	D	FF			0.1	
FLOOR	CP			(Vinyl)	(W)			(I)	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Basement

REPORT # _____

COMPONENT	SUBSTRATE						PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M	I	D	FF				
CEILING			G	P	W	M	I	D	FF				
DOOR					W	M	I	D	FF				
DOOR TRIM					W	M	I	D	FF				
SHELF					W	M	I	D	FF				
SHELF SUPPORT					W	M	I	D	FF				
WALL <i>Green</i>		(B)	C	G	P	W	M	T	I	(D)	FF		0.0
WINDOW SASH					W	M	I	D	FF				
WINDOW TRIM					W	M	I	D	FF				
WINDOW SILL					W	M	I	D	FF				
FLOOR	CP			Vinyl	W		I	D	FF				
<i>Wall Red</i>	(B)	C	G	P	W	M	T	I	(D)	FF		0.0	
<i>Both Room Wall</i>	B	C	G	P	(W)	M	T	(D)	D	FF		0.1	
<i>Cabinet</i>	B	C	G	P	(W)	M	T	I	(D)	FF		0.2	

ROOM NAME Stairway to Basement

REPORT # _____

COMPONENT	SUBSTRATE						PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M	I	(D)	FF				0.2
CEILING			G	(P)	W	M	(D)	D	FF				2.3
DOOR					(W)	M	I	(D)	FF				0.2
DOOR TRIM					(W)	M	I	(D)	FF				0.1
SHELF					W	M	I	D	FF				
SHELF SUPPORT					W	M	I	D	FF				
WALL	B	C	G	(P)	W	M	T	I	(D)	FF		1.9	
WINDOW SASH					W	M	I	D	FF				
WINDOW TRIM					W	M	I	D	FF				
WINDOW SILL					W	M	I	D	FF				
FLOOR	CP			Vinyl	W		I	D	FF				
<i>Stair</i>	B	C	G	P	(W)	M	T	I	(D)	FF		0.1	
<i>Stringer</i>	B	C	G	P	(W)	M	T	I	(D)	FF		0.0	
<i>Milk Chute</i>	B	C	G	P	W	M	T	I	D	FF			

ROOM NAME _____

REPORT # _____

COMPONENT	SUBSTRATE						PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M	I	D	FF				
CEILING			G	P	W	M	I	D	FF				
DOOR					W	M	I	D	FF				
DOOR TRIM					W	M	I	D	FF				
SHELF					W	M	I	D	FF				
SHELF SUPPORT					W	M	I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			
WINDOW SASH					W	M	I	D	FF				
WINDOW TRIM					W	M	I	D	FF				
WINDOW SILL					W	M	I	D	FF				
FLOOR	CP			Vinyl	W		I	D	FF				
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			