

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 19

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 1301 Prospect
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-26-93

Substrate:

B - Brick
C - Concrete
G - Gypsum
P - Plaster
W - Wood
M - Metal
T - Tile
CP - Carpet

Paint Condition:

I - intact
D - defective (peeling, cracked, loose)
FP - factory finish

Comments:

Exterior Positive: Siding, Window Sashes, Trim + Sill, Door Trim, Porch Wall

Interior Positive: Living Room - Baseboard, Window Sash, Trim + Sill Bedroom 1 - Baseboard, Door Trim, Window Sash, Trim + Sill Family Room - Baseboard, Door Trim, Window Sash, Trim + Sill Bedrooms 2 & 3 - Baseboard, Door, Door Trim, Window Sash, Trim + Sill Dining Room - Baseboard, Door Trim, Window Trim + Sill, Wainscott Bath - Door, Door Trim Kitchen - Door, Door Trim, Window Sash, Trim + Sill, Cupboard, Wainscott Basement / Stairway - Door, Door Trim,

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
 A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope


SIGNATURES

Thomas G. ...
Technician/Inspector

Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated


1301 Prospect

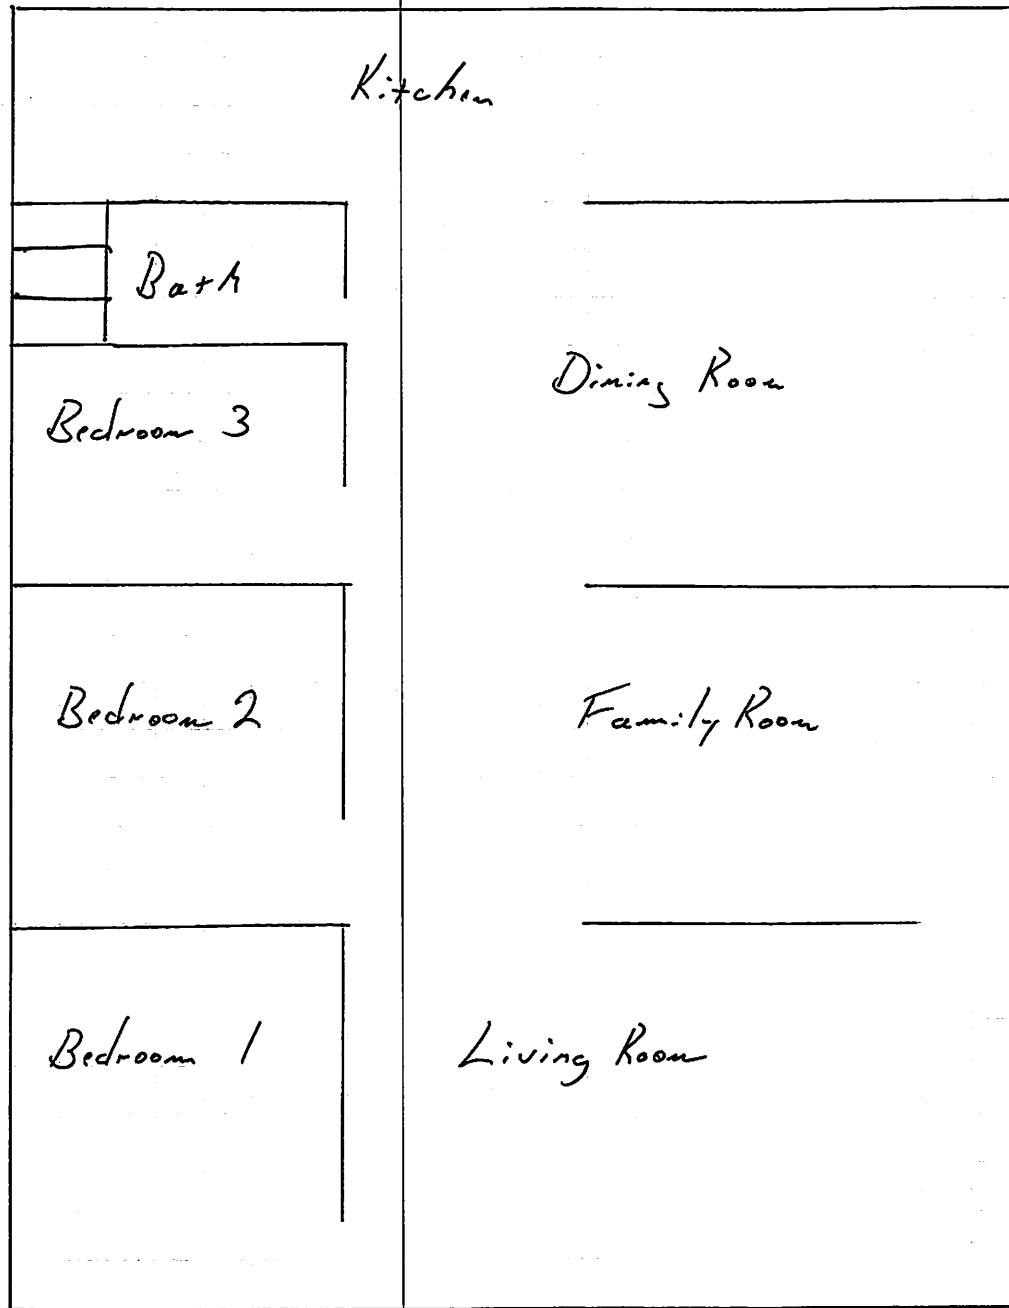

UNIT ADDRESS 1301 Prospect

_____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING <i>Slate</i>	B	C			W	M		<input checked="" type="radio"/>	D	FF			2.5	
EXTERIOR TRIM	B	C			W	M	T	I	D	FF				
SOFFIT					W	M		I	D	FF				
FACIA					W	M		I	D	FF				
WINDOW EXTERIOR SASH					W	M		I	D	FF				
WINDOW TRIM					<input checked="" type="radio"/> W	M		<input checked="" type="radio"/> I	D	FF			6.7	
WINDOW PRIMARY SASH					<input checked="" type="radio"/> W	M		I	<input checked="" type="radio"/> D	FF			6.6	
WINDOW SILL					<input checked="" type="radio"/> W	M		<input checked="" type="radio"/> I	<input checked="" type="radio"/> D	FF			8.2	
PORCH COLUMN		C			<input checked="" type="radio"/> W	M		I	<input checked="" type="radio"/> D	FF			5.4	
PORCH CEILING					W	M		I	D	FF				
PORCH FLOOR	<input checked="" type="radio"/> B	C			<input checked="" type="radio"/> W	M		I	<input checked="" type="radio"/> D	FF			0.0	
STAIR STEPS		C			<input checked="" type="radio"/> W	M		I	<input checked="" type="radio"/> D	FF			0.0	
STAIR STRINGER					<input checked="" type="radio"/> W			I	<input checked="" type="radio"/> D	FF			0.0	
DOOR					<input checked="" type="radio"/> W	M		<input checked="" type="radio"/> I	D	FF			0.0	
DOOR TRIM					<input checked="" type="radio"/> W	M		<input checked="" type="radio"/> I	D	FF			4.6	
DOOR JAMB					<input checked="" type="radio"/> W	M		<input checked="" type="radio"/> I	D	FF			0.0	
SKIRTING	B	C	G	P	W	M	T	I	D	FF				
THRESHOLD	B	C	G	P	W	<input checked="" type="radio"/> M	T	I	D	<input checked="" type="radio"/> FF				
<i>Porch Wall</i>	B	C	G	P	<input checked="" type="radio"/> W	M	T	I	<input checked="" type="radio"/> D	FF			7.1	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

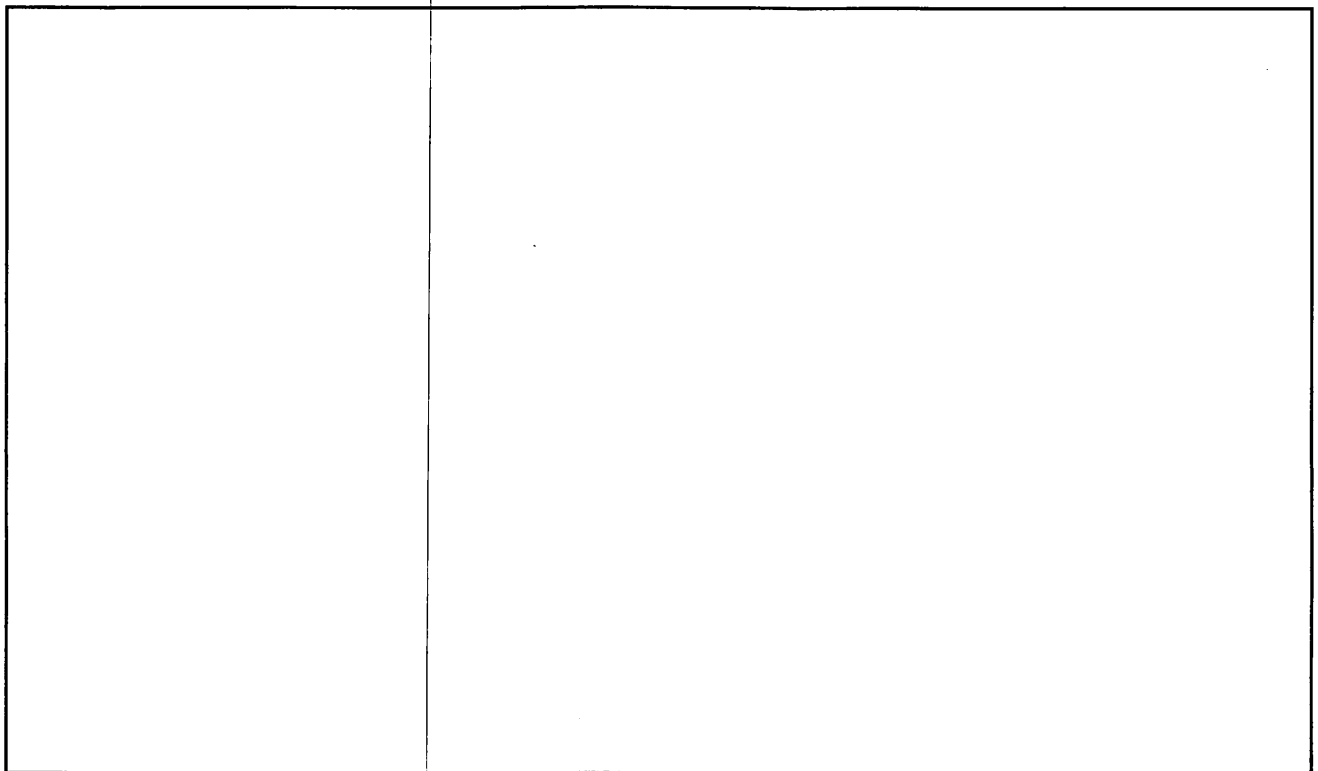

ROOM NAME Bedroom 2

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF			4.9	
CEILING			G	(P)	W	M		(D)	D	FF			0.1	
DOOR					(W)	M		(D)	D	FF			3.7	
DOOR TRIM					(W)	M		(D)	D	FF			3.9	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.0	
WINDOW SASH					(W)	M		(D)	D	FF			4.7	
WINDOW TRIM					(W)	M		(D)	D	FF			4.5	
WINDOW SILL					(W)	M		(D)	D	FF			9.3	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Dining Room

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF			3.4	
CEILING <u>Tile</u>			G	P	W	M		I	D	FF				
DOOR					W	(M)		I	D	(FF)				
DOOR TRIM					(W)	M		(D)	D	FF			4.1	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	(W)	M	T	I	D	(FF)				
WINDOW SASH					(W)	M		(D)	D	FF			0.0	
WINDOW TRIM					(W)	M		(D)	D	FF			3.1	
WINDOW SILL					(W)	M		(D)	D	FF			2.5	
FLOOR	(CP)			Vinyl	W			I	D	FF				
<u>Wainscott</u>	B	C	G	P	(W)	M	T	I	(D)	FF			3.8	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 3

#

REPORT #

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(D)	D	FF			2.8	
CEILING <u>Tile</u>			G	P	W	M		I	D	FF				
DOOR					(W)	M		(D)	D	FF			3.1	
DOOR TRIM					(W)	M		(D)	D	FF			4.3	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	(W)	M	T	I	D	(FF)				
WINDOW SASH					(W)	M		(D)	D	FF			9.2	
WINDOW TRIM					(W)	M		(D)	D	FF			4.0	
WINDOW SILL					(W)	M		(D)	D	FF			5.5	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bath

#

REPORT #

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			Vinyl	W	M	I	D	FF		
CEILING			G	(P) W	M	(D) I	D	FF		0.0
DOOR				(W) W	M	I	(D) D	FF		3.1
DOOR TRIM				(W) W	M	I	(D) D	FF		4.4
SHELF				W	M	I	D	FF		
SHELF SUPPORT				W	M	I	D	FF		
WALL	B	C	G	(P) W	M	T	(D) I	D	FF	0.0
WINDOW SASH				W	M	I	D	FF		
WINDOW TRIM				W	M	I	D	FF		
WINDOW SILL				W	M	I	D	FF		
FLOOR	CP		(Vinyl)	W		I	D	FF		
	B	C	G	P	W	M	T	I	D	FF
	B	C	G	P	W	M	T	I	D	FF
	B	C	G	P	W	M	T	I	D	FF

ROOM NAME Kitchen

#

REPORT #

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD			Vinyl	W	M	I	D	FF			
CEILING			G	(P) W	M	(D) I	D	FF		0.0	
DOOR				(W) W	M	(D) I	D	FF		6.7	
DOOR TRIM				(W) W	M	(D) I	D	FF		9.3	
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	(P) W	M	T	(D) I	D	FF	0.0	
WINDOW SASH				(W) W	M	I	D	FF		4.9	
WINDOW TRIM				(W) W	M	I	D	FF		3.3	
WINDOW SILL				(W) W	M	I	D	FF		2.9	
FLOOR	CP		Vinyl	W		I	D	FF			
<u>Cupboard</u>	B	C	G	P	W	M	T	I	D	FF	2.2
<u>Wainscott</u>	B	C	G	P	W	M	T	I	D	FF	5.2
	B	C	G	P	W	M	T	I	D	FF	

ROOM NAME Basement / Stairway

#

REPORT #

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD			Vinyl	W	M	I	D	FF			
CEILING			G	(P) W	M	I	(D) D	FF		0.0	
DOOR				(W) W	M	I	(D) D	FF		7.1	
DOOR TRIM				(W) W	M	I	(D) D	FF		3.3	
SHELF				W	M	I	D	FF			
SHELF SUPPORT				W	M	I	D	FF			
WALL	B	C	G	(P) W	M	T	(D) I	D	FF	0.2	
WINDOW SASH				W	M	I	D	FF			
WINDOW TRIM				W	M	I	D	FF			
WINDOW SILL				W	M	I	D	FF			
FLOOR	CP		Vinyl	W		I	D	FF			
<u>Stair</u>	B	C	G	P	(W) W	M	T	I	(D) D	FF	0.0
<u>Staircase</u>	B	C	G	P	(W) W	M	T	I	D	FF	0.0
	B	C	G	P	W	M	T	I	D	FF	