

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 8

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 407 Rouse
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-25-93

Substrate:

B - Brick
C - Concrete
 G - Gypsum
P - Plaster
 W - Wood
 M - Metal
T - Tile
CP - Carpet

Paint Condition:

I - intact
 D - defective (peeling, cracked, loose)
 FF - factory finish

Comments:

Exterior Positive: Siding, Window Trim + Sill,
Parade Trim

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
 A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope



SIGNATURES

Technician/Inspector

Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated


407 Reese

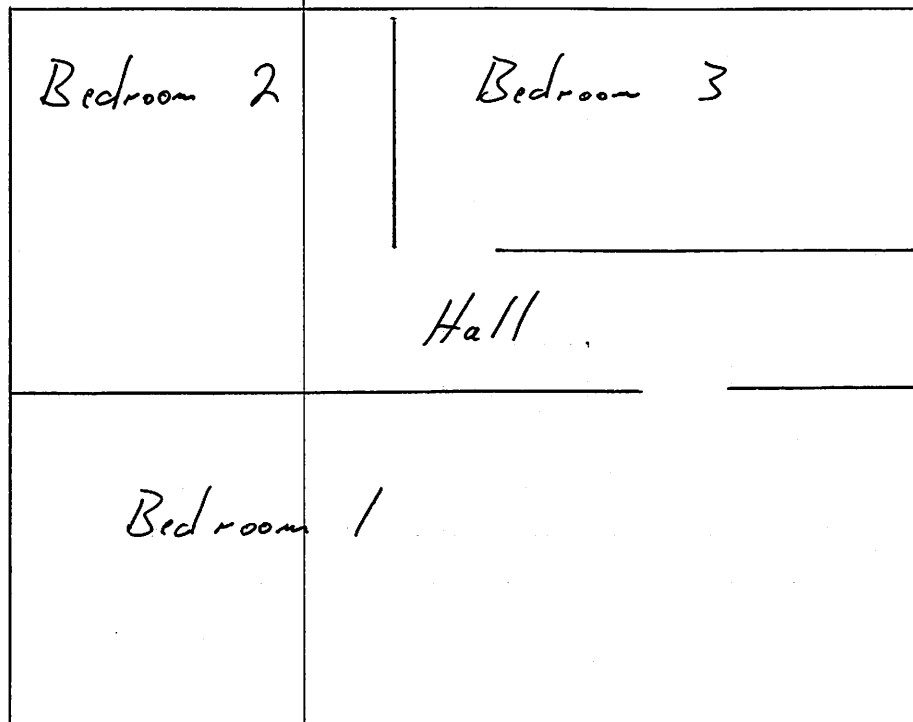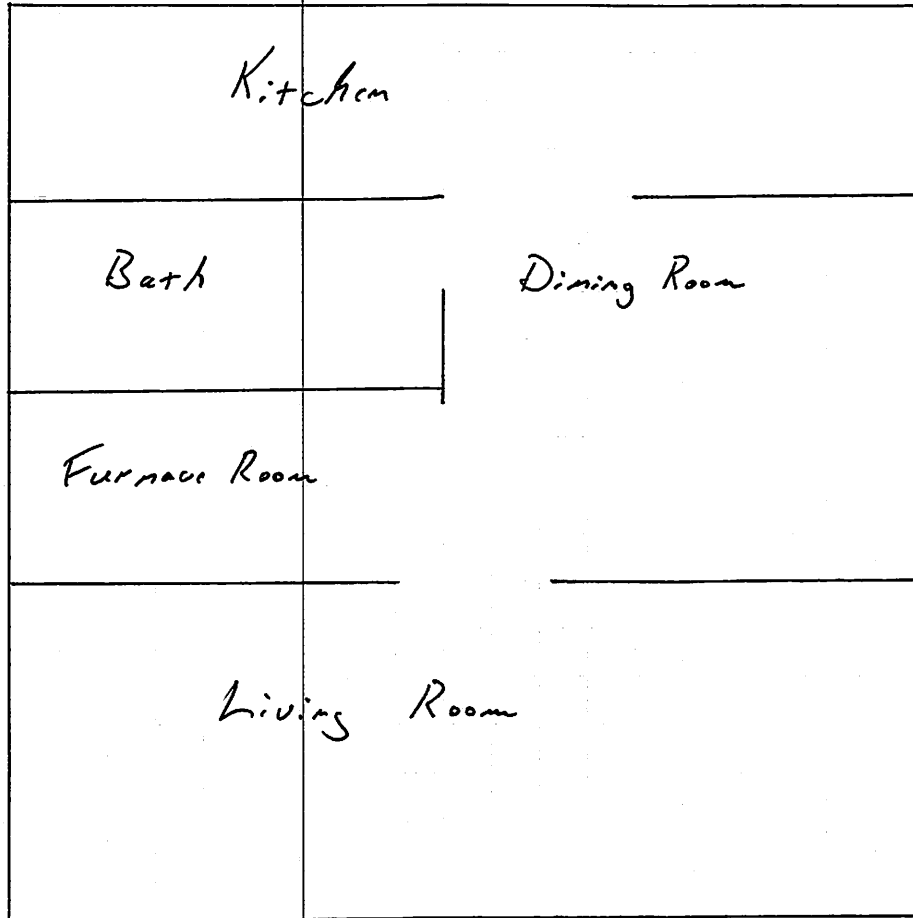

UNIT ADDRESS 407 Reese

_____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE						PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING <i>Slate</i>	B	C			W	M	<input checked="" type="checkbox"/>	D	FF			17.1	
EXTERIOR TRIM	B	C			W	<input checked="" type="checkbox"/> M	T	I	D	FF			
SOFFIT					W	<input checked="" type="checkbox"/> M		I	D	FF			
FACIA					W	<input checked="" type="checkbox"/> M		I	D	FF			
WINDOW EXTERIOR SASH					W	<input checked="" type="checkbox"/> M		I	D	<input checked="" type="checkbox"/> FF			
WINDOW TRIM					<input checked="" type="checkbox"/> W	M		I	<input checked="" type="checkbox"/> D	FF		30.1	
WINDOW PRIMARY SASH					W	<input checked="" type="checkbox"/> M		I	D	<input checked="" type="checkbox"/> FF			
WINDOW SILL					<input checked="" type="checkbox"/> W	M		I	<input checked="" type="checkbox"/> D	FF		28.9	
PORCH COLUMN		C			W	M		I	D	FF			
PORCH CEILING					<input checked="" type="checkbox"/> W	M		I	D	<input checked="" type="checkbox"/> FF			
PORCH FLOOR		<input checked="" type="checkbox"/> C			W	M		I	D	FF			
STAIR STEPS		<input checked="" type="checkbox"/> C			W	M		I	D	FF			
STAIR STRINGER					W			I	D	FF			
DOOR					W	<input checked="" type="checkbox"/> M		I	D	<input checked="" type="checkbox"/> FF			
DOOR TRIM					W	<input checked="" type="checkbox"/> M		I	D	<input checked="" type="checkbox"/> FF			
DOOR JAMB					W	<input checked="" type="checkbox"/> M		I	D	<input checked="" type="checkbox"/> FF			
SKIRTING	B	C	G	P	W	M	T	I	D	FF			
THRESHOLD	B	C	G	P	W	<input checked="" type="checkbox"/> M	T	I	D	<input checked="" type="checkbox"/> FF			
<i>Porch Trim</i>	B	C	G	P	<input checked="" type="checkbox"/> W	M	T	I	<input checked="" type="checkbox"/> D	FF		3.1	
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			

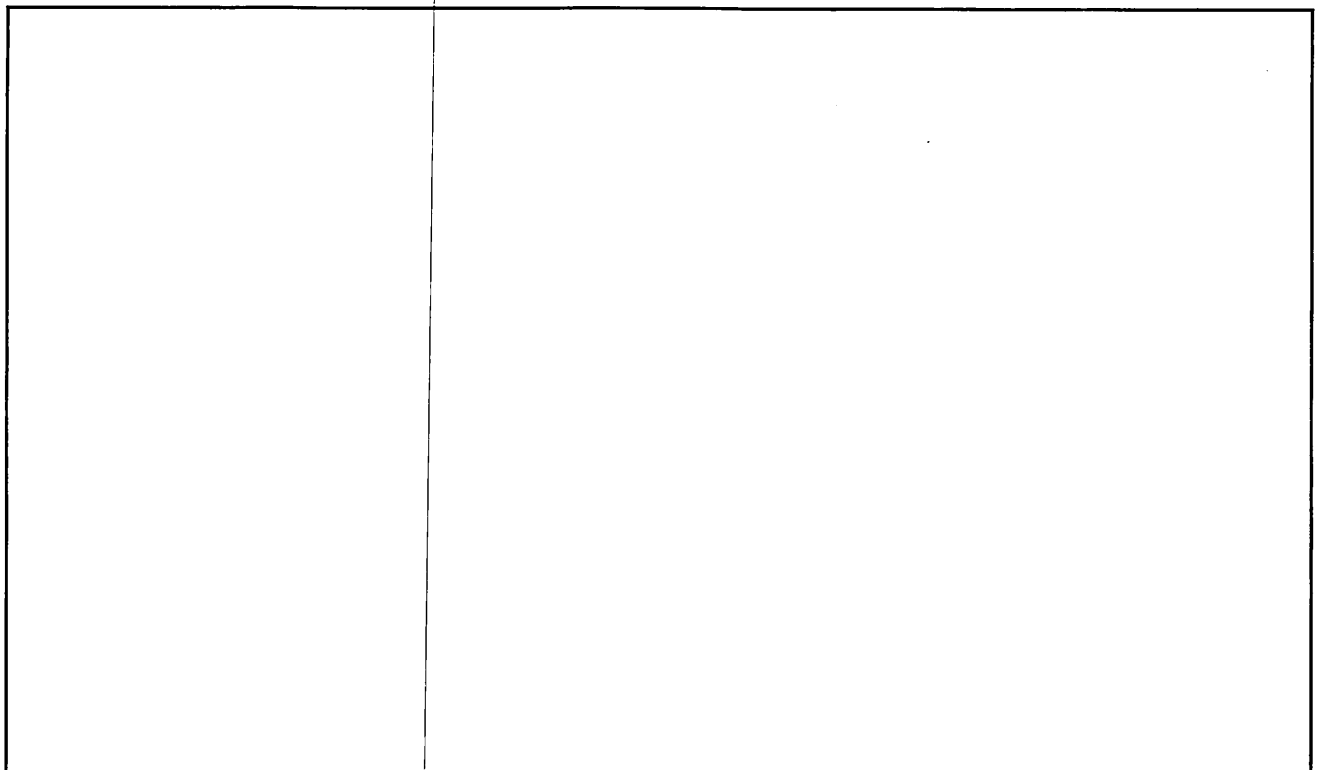

ROOM NAME Kitchen

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		D	D	FF			0.0	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		D	D	FF			0.0	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	D	D	FF			0.2	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Porch

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		D	D	FF			0.0	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	D	D	FF			0.2	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		D	D	FF			0.1	
WINDOW SILL					W	M		D	D	FF			0.1	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Dining Room

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		D	D	FF			0.2	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	D	D	FF			0.2	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		D	D	FF			0.2	
WINDOW SILL					W	M		D	D	FF			0.2	
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Stairway to 2nd Floor # _____ REPORT # _____

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			(Vinyl) W M	I	D	FF				
CEILING			(G) P W M	(1)	D	FF			0.1	
DOOR			W M	I	D	FF				
DOOR TRIM			W M	I	D	FF				
SHELF			W M	I	D	FF				
SHELF SUPPORT			W M	I	D	FF				
WALL	B	C	(G) P W M T	(1)	D	FF			0.0	
WINDOW SASH			W M	I	D	FF				
WINDOW TRIM			W M	I	D	FF				
WINDOW SILL			W M	I	D	FF				
FLOOR	CP		(Vinyl) W	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				

ROOM NAME Hall # _____ REPORT # _____

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			(Vinyl) W M	I	D	FF				
CEILING			(G) P W M	(1)	D	FF				
DOOR			(W) M	I	D	(FF)				
DOOR TRIM			(W) M	I	D	(FF)				
SHELF			W M	I	D	FF				
SHELF SUPPORT			W M	I	D	FF				
WALL	B	C	(G) P W M T	(1)	D	FF				
WINDOW SASH			W M	I	D	FF				
WINDOW TRIM			W M	I	D	FF				
WINDOW SILL			W M	I	D	FF				
FLOOR	CP		(Vinyl) W	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				

ROOM NAME Bedroom 1 # _____ REPORT # _____

COMPONENT	SUBSTRATE			PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD			(Vinyl) W M	I	D	FF				
CEILING			(G) P W M	(1)	D	FF			0.2	
DOOR			(W) M	I	D	(FF)				
DOOR TRIM			(W) M	I	D	(FF)				
SHELF			W M	I	D	FF				
SHELF SUPPORT			W M	I	D	FF				
WALL	B	C	(G) P W M T	(1)	D	FF			0.1	
WINDOW SASH			(W) M	I	D	(FF)				
WINDOW TRIM			(W) M	(1)	D	FF			0.2	
WINDOW SILL			(W) M	(1)	D	FF			0.0	
FLOOR	(CP)		(Vinyl) W	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				
	B	C	G P W M T	I	D	FF				

ROOM NAME Bedroom 2 # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			(G)	P	W	M		(I)	D	FF			0.2	
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		I	D	(FF)				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	(G)	P	W	M	T	(I)	D	FF			0.1	
WINDOW SASH					W	(M)		I	D	(FF)				
WINDOW TRIM					(W)	M		(I)	D	FF			0.0	
WINDOW SILL					(W)	M		(I)	D	FF			0.2	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 3 # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			(G)	P	W	M		(I)	D	FF			0.1	
DOOR					(W)	M		I	D	(FF)				
DOOR TRIM					(W)	M		I	D	(FF)				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	(G)	P	W	M	T	(I)	D	FF			0.0	
WINDOW SASH					W	(M)		I	D	(FF)				
WINDOW TRIM					(W)	M		(I)	D	FF			0.0	
WINDOW SILL					(W)	M		(I)	D	FF			0.1	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME _____ # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				