

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 7

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 628 Taylor
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-25-93

Substrate:

B - Brick
C - Concrete
G - Gypsum
 Plaster

Wood
 Metal
T - Tile
CP - Carpet

Paint Condition:

intact
 defective (peeling, cracked, loose)
 factory finish

Comments:

Exterior Positive: Porch Column, Porch Floor,
Door Trim, Door Sams, Threshold

Interior Positive: None

This testing was accomplished utilizing:

A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope



SIGNATURES

[Signature]
Technician/Inspector

Agency Representative

_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated


628 Taylor

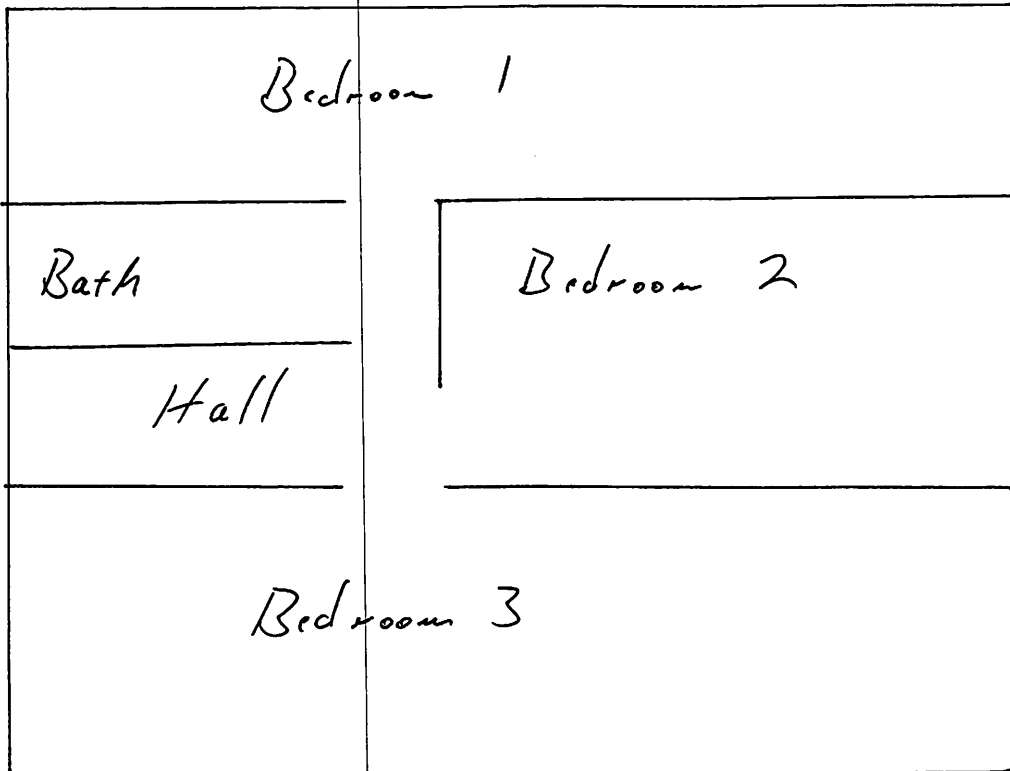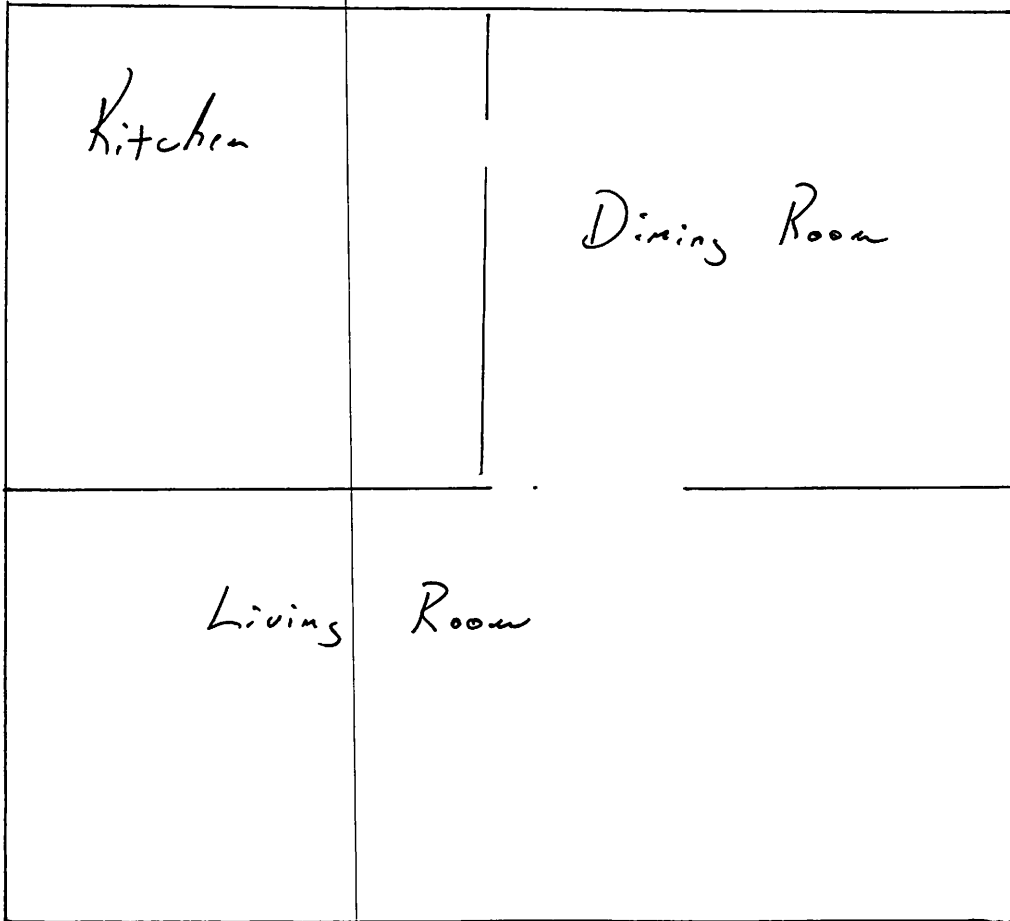

UNIT ADDRESS 628 Taylor

_____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE						PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING <i>Ving 1</i>	B	C			W	M		I	D	FF			
EXTERIOR TRIM <i>Ving 1</i>	B	C			W	M	T	I	D	FF			
SOFFIT					W	M		I	D	FF			
FACIA					W	M		I	D	FF			
WINDOW EXTERIOR SASH					W	M		I	D	FF			
WINDOW TRIM					W	M		I	D	FF			
WINDOW PRIMARY SASH					W	M		I	D	FF			
WINDOW SILL					W	M		I	D	FF			
PORCH COLUMN		C			W	M		I	D	FF		46.3	
PORCH CEILING					W	M		I	D	FF			
PORCH FLOOR		C			W	M		I	D	FF		7.4	
STAIR STEPS		C			W	M		I	D	FF			
STAIR STRINGER					W			I	D	FF			
DOOR					W	M		I	D	FF		0.2	
DOOR TRIM					W	M		I	D	FF		12.1	
DOOR JAMB					W	M		I	D	FF		11.3	
SKIRTING	B	C	G	P	W	M	T	I	D	FF			
THRESHOLD	B	C	G	P	W	M	T	I	D	FF		17.4	
<i>Railing</i>	B	C	G	P	W	M	T	I	D	FF		0.2	
	B	C	G	P	W	M	T	I	D	FF			
	B	C	G	P	W	M	T	I	D	FF			

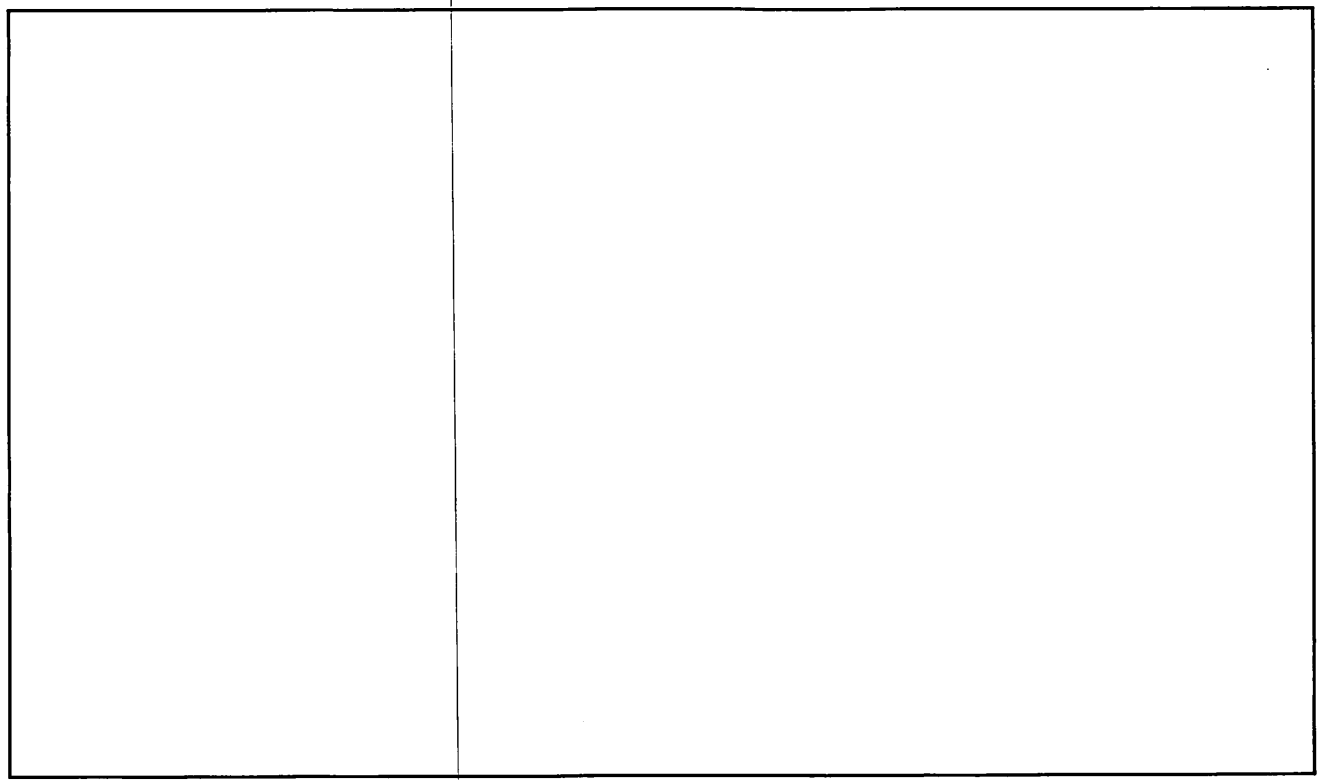

UNIT ADDRESS 628 Taylor Garage # _____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
SIDING	(B)	C			W	M		I	D	FF				
EXTERIOR TRIM	B	C			(W)	M	T	(D)	D	FF			0.0	
SOFFIT					W	M		I	D	FF				
FACIA					(W)	M		(D)	D	FF			0.0	
WINDOW EXTERIOR SASH					(W)	M		I	(D)	FF			0.0	
WINDOW TRIM					(W)	M		(D)	D	FF			0.0	
WINDOW PRIMARY SASH					W	M		I	D	FF				
WINDOW SILL					(W)	M		(D)	D	FF			0.1	
PORCH COLUMN		C			W	M		I	D	FF				
PORCH CEILING					W	M		I	D	FF				
PORCH FLOOR		C			W	M		I	D	FF				
STAIR STEPS		C			W	M		I	D	FF				
STAIR STRINGER					W			I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
DOOR JAMB					W	M		I	D	FF				
SKIRTING	B	C	G	P	W	M	T	I	D	FF				
THRESHOLD	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Living Room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.3	
CEILING			G	(P)	W	M		(I)	D	FF			0.0	
DOOR					(W)	M		(I)	D	FF			0.0	
DOOR TRIM					(W)	M		(I)	D	FF			0.3	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.0	
WINDOW SASH					W	(M)		I	D	FF				
WINDOW TRIM					(W)	M		I	D	FF			0.1	
WINDOW SILL					(W)	M		I	D	FF			0.2	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Dining Room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.1	
CEILING			G	(P)	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					(W)	M		(I)	D	FF			0.1	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.3	
WINDOW SASH					W	(M)		I	D	(FF)				
WINDOW TRIM					(W)	M		(I)	D	FF			0.1	
WINDOW SILL					(W)	M		(I)	D	FF			0.2	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Kitchen # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.1	
CEILING <u>Tile</u>			G	(P)	W	M		(I)	D	FF				
DOOR					(W)	M		(I)	D	FF			0.2	
DOOR TRIM					(W)	M		(I)	D	FF			0.3	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.2	
WINDOW SASH					W	(M)		I	D	(FF)				
WINDOW TRIM					(W)	M		(I)	D	FF			0.2	
WINDOW SILL					(W)	M		(I)	D	FF			0.0	
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Cupboard</u>	B	C	G	P	(W)	M	T	(I)	D	FF			0.1	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Basement / Stairway # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	W	W	M		I	D	FF			0.1	
DOOR					W	M		I	D	FF			0.0	
DOOR TRIM					W	M		I	D	FF			0.1	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.2	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Weirscott</u>	B	C	G	P	W	M	T	I	D	FF			0.0	
<u>Stairway</u>	B	C	G	P	W	M	T	I	D	FF			0.2	
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Stairway to 2nd Flr # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.0	
CEILING			G	P	W	M		I	D	FF			0.0	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF			0.1	
WINDOW SILL					W	M		I	D	FF			0.2	
FLOOR	CP			Vinyl	W			I	D	FF				
<u>Railing</u>	B	C	G	P	W	M	T	I	D	FF			0.1	
<u>Stair</u>	B	C	G	P	W	M	T	I	D	FF			0.2	
<u>Stringer</u>	B	C	G	P	W	M	T	I	D	FF			0.1	

ROOM NAME Bath # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.1	
CEILING <u>Tile</u>			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF			0.0	
DOOR TRIM					W	M		I	D	FF			0.1	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.2	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 1

_____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		I	D	FF			0.1	
CEILING			G	(P)	W	M		(I)	D	FF			0.0	
DOOR					(W)	M		(I)	D	FF			0.0	
DOOR TRIM					(W)	M		(I)	D	FF			0.1	
SHELF					(W)	M		I	D	(FF)				
SHELF SUPPORT					(W)	M		I	D	(FF)				
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.0	
WINDOW SASH					W	(M)		I	D	FF				
WINDOW TRIM					(W)	M		(I)	D	FF			0.2	
WINDOW SILL					(W)	M		(I)	D	FF			0.1	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 2

_____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(I)	D	FF			0.0	
CEILING			G	(P)	W	M		(I)	D	FF			0.2	
DOOR					(W)	M		(I)	D	FF			0.0	
DOOR TRIM					(W)	M		(I)	D	FF			0.3	
SHELF					(W)	M		I	D	(FF)				
SHELF SUPPORT					(W)	M		I	D	(FF)				
WALL	B	C	G	(P)	W	M	T	(I)	D	FF			0.1	
WINDOW SASH					W	(M)		I	D	(FF)				
WINDOW TRIM					(W)	M		(I)	D	FF			0.0	
WINDOW SILL					(W)	M		(I)	D	FF			0.3	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bedroom 3

_____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		I	D	(FF)				
CEILING			G	(P)	W	M		(I)	D	FF			0.1	
DOOR					(W)	M		(I)	D	FF			0.1	
DOOR TRIM					(W)	M		(I)	D	FF			0.0	
SHELF					(W)	M		I	D	(FF)				
SHELF SUPPORT					(W)	M		I	D	(FF)				
WALL	B	C	G	P	(W)	M	T	I	D	(FF)				
WINDOW SASH					(W)	M		I	D	FF			0.1	
WINDOW TRIM					(W)	M		I	D	FF			0.0	
WINDOW SILL					(W)	M		I	D	FF			0.2	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Hall

_____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF			0.1	
CEILING			G	P	W	M		I	D	FF			0.0	
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF			0.3	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
<i>Acoustic Panel</i>	B	C	G	P	W	M	T	I	D	FF			0.2	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME _____ # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME _____ # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING			G	P	W	M		I	D	FF				
DOOR					W	M		I	D	FF				
DOOR TRIM					W	M		I	D	FF				
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				