

LBP

W. O., LTD.

(A DIVISION OF SCHAUER & ASSOCIATES, INC.)
6960 S. 13th Street, P. O. Box 285
Oak Creek, WI. 53154-0285
(414)768-9588, (800)628-2590, Fax (414)764-2088

Report No. 27

ON SITE LEAD PAINT X-RAY FLUORESCENCE EVALUATION RECORD

AGENCY Eric Metropolitan Housing Authority
STREET 322 Warren Street UNIT/ADDRESS 408 E. Washington
CITY Sandusky, Ohio UNIT/LOCATION _____
DATE 10-28-'93

Substrate:

- B - Brick
- C - Concrete
- G - Gypsum
- P - Plaster
- ⊕ - Wood
- Ⓜ - Metal
- T - Tile
- CP - Carpet

Paint Condition:

- ⓪ intact
- Ⓧ - defective (peeling, cracked, loose)
- Ⓛ - factory finish

Comments: Exterior Positive: Porch Column, Door, Door Trim,
Door Sash

Interior Positive: Kitchen - Door Bedroom 1 -
Window Sash Bedroom 2 - Wall Bedroom 3 - Window
Sash Basement - Door

This testing was accomplished utilizing:

- A Warrington Microlead I, Revision 4, X-Ray Fluoroscope
- A Scitec Map 3 Spectrum Analyzer, X-Ray Fluoroscope

SIGNATURES

[Signature]


Technician/Inspector

Agency Representative


_____ No indication of Lead Based Paint in this unit.
_____ Paint samples taken for analysis Lead indicated

408 E. Washington

1st Floor

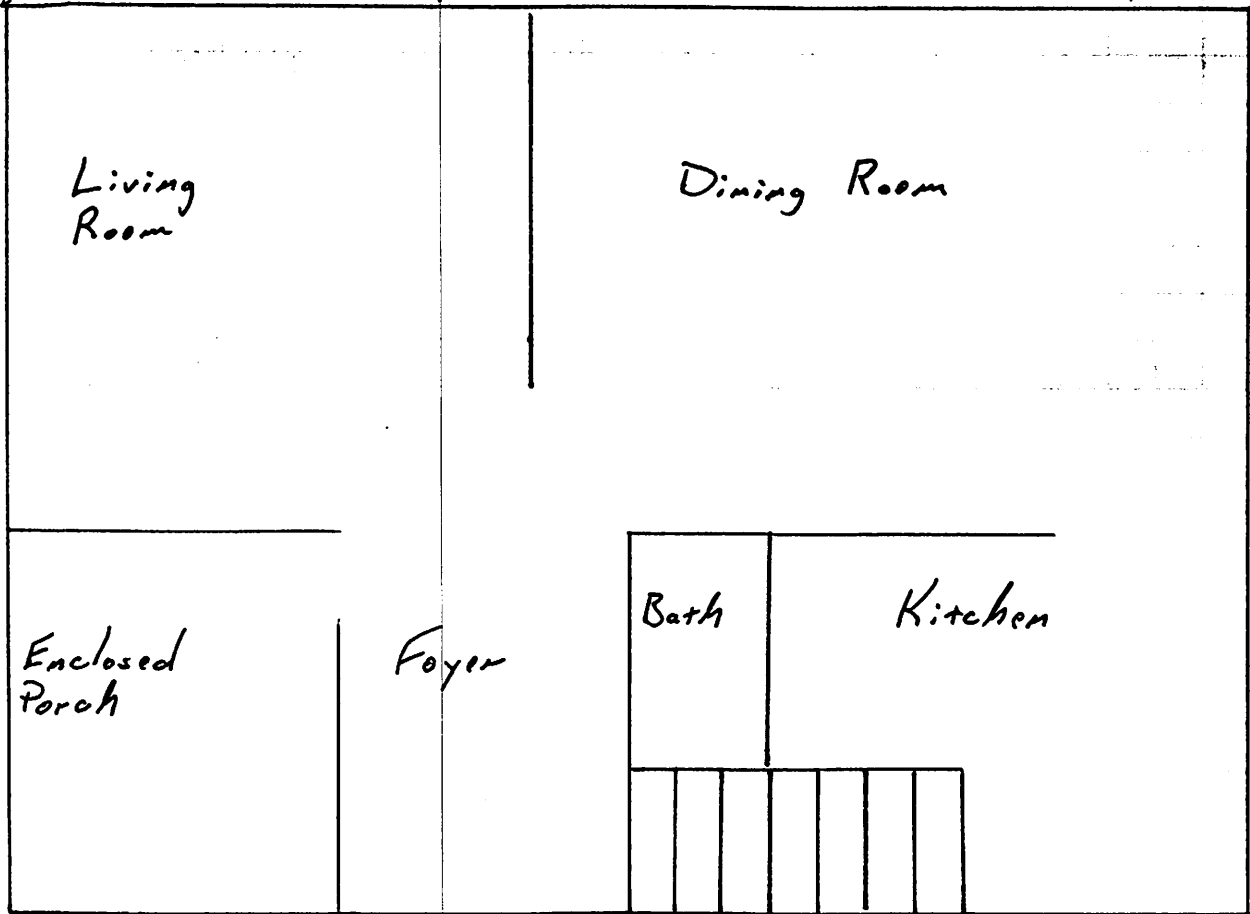

2nd Floor

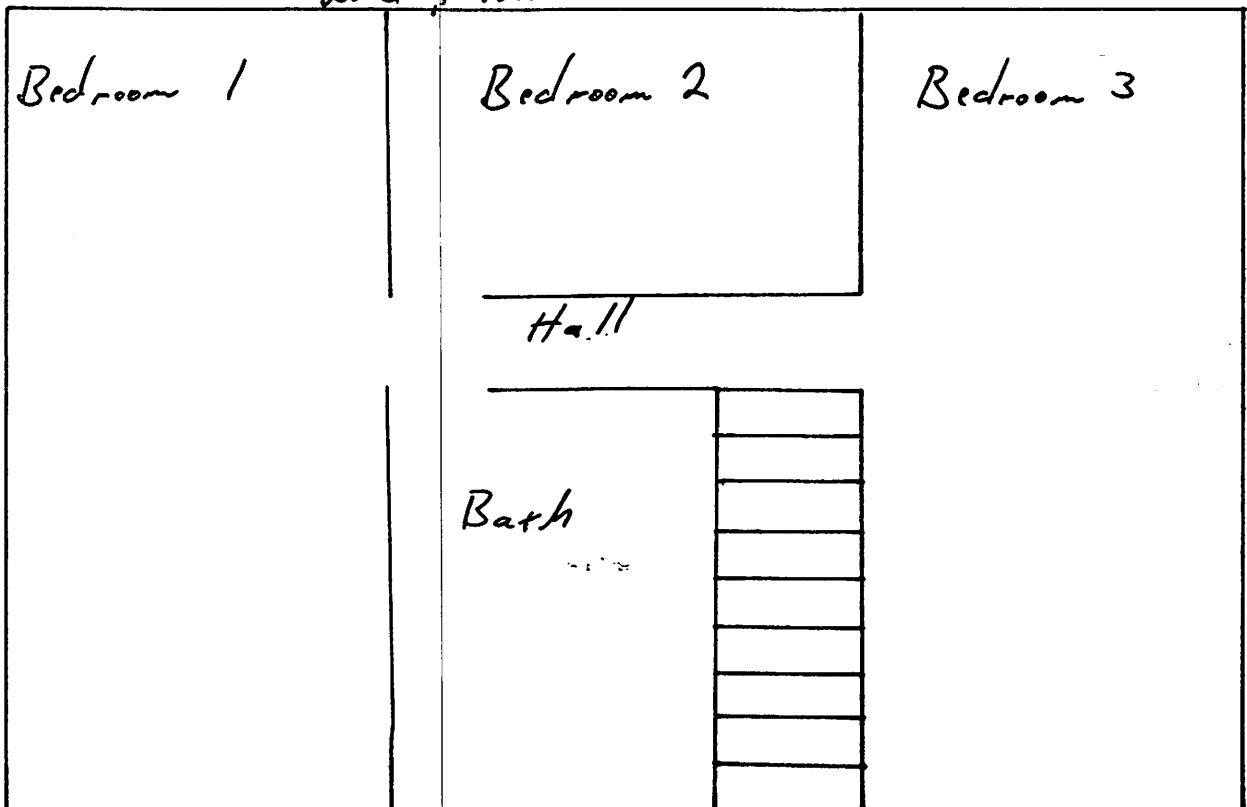

UNIT ADDRESS 408 E. Washington # _____ REPORT # _____

EXTERIOR LOCATIONS	SUBSTRATE				PAINT CONDITION			ALC	SEL	CLC	(NOTES)	
SIDING	B	C		W	W		I	D	EP			
EXTERIOR TRIM	B	C		W	W	T	I	D	EP			
SOFFIT				W	M		I	D	FF			
FACIA				W	M		I	D	FF			
WINDOW EXTERIOR SASH				W	W		I	D	FF			
WINDOW TRIM				W	M		D	D	FF		0.1	
WINDOW PRIMARY SASH				W	W		I	D	FF			
WINDOW SILL				W	M		D	D	FF		0.2	
PORCH COLUMN - Back		C		W	M		D	D	FF		3.3	
PORCH CEILING - Back				W	M		D	D	FF			
PORCH FLOOR - Back		C		W	M		D	D	FF		0.2	
STAIR STEPS - Back		C		W	M		D	D	FF		0.0	
STAIR STRINGER - Back				W			D	D	FF		0.0	
DOOR				W	M		D	D	FF		2.0	
DOOR TRIM				W	M		D	D	FF		2.1	
DOOR JAMB				W	M		D	D	FF		1.7	
SKIRTING	B	C	G	P	W	M	T	I	D	FF		
THRESHOLD	B	C	G	P	W	M	T	I	D	FF	0.0	
Basics - Back	B	C	G	P	W	M	T	I	D	FF		
Porch Trim	B	C	G	P	W	M	T	I	D	FF	0.1	
	B	C	G	P	W	M	T	I	D	FF		
	B	C	G	P	W	M	T	I	D	FF		

Ceorge

siding w-D - 0.0
 Columns w-D - 0.0
 Window all M - FF
 Orisk w-D - 0.0
 Back - w-I - 13.4

ROOM NAME Enclosed Porch

REPORT # _____

COMPONENT	SUBSTRATE						PART CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	W	M	I	D	FF					
CEILING			G	P	W	M	I	D	FF					
DOOR					(W)	M	(D)	D	FF			0.1		
DOOR TRIM					(W)	M	(D)	D	FF			0.0		
SHELF					W	M	I	D	FF					
SHELF SUPPORT					W	M	I	D	FF					
WALL	B	C	G	P	W	(M)	T	(D)	D	FF			0.1	
WINDOW SASH					W	(M)	(D)	D	FF			0.0		
WINDOW TRIM					(W)	M	(D)	D	FF			0.1		
WINDOW SILL					(W)	M	(D)	D	FF			0.1		
FLOOR	(CP)			Vinyl	W		I	D	FF					
<u>Porch Ceiling</u>	B	C	G	P	(W)	M	T	(D)	D	FF			0.3	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Foyer

REPORT # _____

COMPONENT	SUBSTRATE						PART CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	(W)	M	I	D	(FF)					
CEILING			G	(P)	W	M	I	(D)	FF			0.1		
DOOR					(W)	M	I	D	(FF)					
DOOR TRIM					(W)	M	I	D	(FF)					
SHELF					W	M	I	D	FF					
SHELF SUPPORT					W	M	I	D	FF					
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.0	
WINDOW SASH					(W)	M	I	D	(FF)					
WINDOW TRIM					(W)	M	I	D	(FF)					
WINDOW SILL					(W)	M	I	D	(FF)					
FLOOR	(CP)			Vinyl	W		I	D	FF					
<u>Wall Trim</u>	B	C	G	P	(W)	M	T	I	D	(FF)				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Living Room

REPORT # _____

COMPONENT	SUBSTRATE						PART CONDITION			ALC	SEL	CLC	(NOTES)	
BASEBOARD				Vinyl	(W)	M	I	D	(FF)					
CEILING <u>Tile</u>			G	P	W	M	I	D	FF					
DOOR					W	M	I	D	FF					
DOOR TRIM					(W)	M	I	D	(FF)					
SHELF					W	M	I	D	FF					
SHELF SUPPORT					W	M	I	D	FF					
WALL	B	C	G	(P)	W	M	T	(D)	D	FF			0.2	
WINDOW SASH					(W)	M	I	D	(FF)					
WINDOW TRIM					(W)	M	I	D	(FF)					
WINDOW SILL					(W)	M	I	D	(FF)					
FLOOR	(CP)			Vinyl	W		I	D	FF					
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Dining Room # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M	I	D	(FF)					
CEILING			G	(P)	W	M	(D)	D	FF			0.1		
DOOR					W	M	I	D	FF					
DOOR TRIM					(W)	M	I	D	(FF)					
SHELF					W	M	I	D	FF					
SHELF SUPPORT					W	M	I	D	FF					
WALL	B	C	G	(P)	W	M	T	(D)	D	FF		0.0		
WINDOW SASH					(W)	M	I	D	(FF)					
WINDOW TRIM					(W)	M	I	D	(FF)					
WINDOW SILL					(W)	M	I	D	(FF)					
FLOOR	BR			(Vinyl)	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bath # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M	(I)	D	FF			0.3		
CEILING				(P)	(W)	M	(D)	D	FF			0.1		
DOOR					(W)	M	I	D	(FF)					
DOOR TRIM					(W)	M	I	D	(FF)					
SHELF					W	M	I	D	FF					
SHELF SUPPORT					W	M	I	D	FF					
WALL	B	C	G	(P)	W	M	T	(D)	D	FF		0.0		
WINDOW SASH					W	M	I	D	FF					
WINDOW TRIM					W	M	I	D	FF					
WINDOW SILL					W	M	I	D	FF					
FLOOR	CP			(Vinyl)	W			I	D	FF				
Wall Trim	B	C	G	(P)	(W)	M	T	(D)	D	FF		0.2		
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Kitchen # _____ REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M	I	D	FF					
CEILING <u>Drop</u>			G	P	W	M	I	D	FF					
DOOR					(W)	M	(D)	D	FF			3.1		
DOOR TRIM					(W)	M	(D)	D	FF			0.0		
SHELF					W	M	I	D	FF					
SHELF SUPPORT					W	M	I	D	FF					
WALL <u>Tile</u>	B	C	G	(P)	W	M	T	(D)	D	FF				
WINDOW SASH					(W)	M	(D)	D	FF			0.0		
WINDOW TRIM					(W)	M	(D)	D	FF			0.0		
WINDOW SILL					(W)	M	(D)	D	FF			0.2		
FLOOR	CP			(Vinyl)	W			I	D	FF				
Cabinet	B	C	G	P	(W)	M	T	(D)	D	FF		0.0		
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Stairway to 2nd Fl # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W) M	I	D	(FF)				
CEILING			G	(P)	W M	(I)	D	FF			0.0	
DOOR					W M	I	D	FF				
DOOR TRIM					W M	I	D	FF				
SHELF					W M	I	D	FF				
SHELF SUPPORT					W M	I	D	FF				
WALL	B	C	G	(P)	W M T	(I)	D	FF			0.1	
WINDOW SASH					(W) M	I	D	(FF)				
WINDOW TRIM					(W) M	I	D	(FF)				
WINDOW SILL					(W) M	I	D	(FF)				
FLOOR		(CP)		Vinyl	W	I	D	FF				
<u>Stair Railings</u>	(CP)	B	C	G	P	W M T	I	D	FF			
		B	C	G	P	(W) M T	I	D	(FF)			
		B	C	G	P	W M T	I	D	FF			

ROOM NAME Bedroom 1 # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W) M	I	(D)	FF			0.3	
CEILING			G	(P)	W M	(I)	D	FF			0.0	
DOOR					(W) M	(I)	D	FF			0.1	
DOOR TRIM					(W) M	(I)	D	FF			0.2	
SHELF					W M	I	D	FF				
SHELF SUPPORT					W M	I	D	FF				
WALL	B	C	G	(P)	W M T	I	(D)	FF			0.3	
WINDOW SASH					(W) M	(I)	D	FF			3.1	
WINDOW TRIM					(W) M	(I)	D	FF			0.3	
WINDOW SILL					(W) M	(I)	D	FF			0.2	
FLOOR		(CP)		Vinyl	W	I	D	FF				
		B	C	G	P	W M T	I	D	FF			
		B	C	G	P	W M T	I	D	FF			
		B	C	G	P	W M T	I	D	FF			

ROOM NAME Bedroom 2 # _____ REPORT # _____

COMPONENT	SUBSTRATE					PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W) M	(I)	D	FF			0.3	
CEILING			G	(P)	W M	(I)	D	FF			0.2	
DOOR					(W) M	(I)	D	FF			0.2	
DOOR TRIM					(W) M	(I)	D	FF			0.1	
SHELF					(W) M	(I)	D	FF			0.2	
SHELF SUPPORT					(W) M	(I)	D	FF			0.2	
WALL	B	C	G	(P)	W M T	(I)	D	FF			4.5	
WINDOW SASH					(W) M	(I)	D	FF			0.3	
WINDOW TRIM					(W) M	(I)	D	FF			0.1	
WINDOW SILL					(W) M	(I)	D	FF			0.3	
FLOOR		(CP)		Vinyl	W	I	D	FF				
<u>Cabinet</u>		B	C	G	P	(W) M T	(I)	D	FF		0.1	
		B	C	G	P	W M T	I	D	FF			
		B	C	G	P	W M T	I	D	FF			

ROOM NAME Bedroom 3

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(1)	D	FF			2.1	
CEILING			G	(P)	W	M		(1)	D	FF			0.1	
DOOR					(W)	M		(1)	D	FF			0.0	
DOOR TRIM					(W)	M		(1)	D	FF			0.1	
SHELF					(W)	M		(1)	D	FF			0.1	
SHELF SUPPORT					(W)	M		(1)	D	FF			0.2	
WALL	B	C	G	(P)	W	M	T	(1)	D	FF			0.0	
WINDOW SASH					(W)	M		(1)	D	FF			3.1	
WINDOW TRIM					(W)	M		(1)	D	FF			0.2	
WINDOW SILL					(W)	M		(1)	D	FF			0.1	
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Bath

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	W	M		I	D	FF				
CEILING <u>Drop</u>			G	P	W	M		I	D	FF				
DOOR					(W)	M		(1)	D	FF			0.1	
DOOR TRIM					(W)	M		(1)	D	FF			0.2	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL <u>Tile</u>	B	C	G	P	W	M	T	I	D	FF				
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	CP			(Vinyl)	W			I	D	FF				
<u>Cabinet</u>	B	C	G	P	(W)	M	T	(1)	D	FF			0.0	
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				

ROOM NAME Hall

REPORT # _____

COMPONENT	SUBSTRATE							PAINT CONDITION			ALC	SEL	CLC	(NOTES)
BASEBOARD				Vinyl	(W)	M		(1)	D	FF			0.1	
CEILING			G	(P)	W	M		(1)	D	FF			0.1	
DOOR					W	M		I	D	FF				
DOOR TRIM					(W)	M		(1)	D	FF			0.2	
SHELF					W	M		I	D	FF				
SHELF SUPPORT					W	M		I	D	FF				
WALL	B	C	G	(P)	W	M	T	(1)	D	FF			0.0	
WINDOW SASH					W	M		I	D	FF				
WINDOW TRIM					W	M		I	D	FF				
WINDOW SILL					W	M		I	D	FF				
FLOOR	(CP)			Vinyl	W			I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				
	B	C	G	P	W	M	T	I	D	FF				